

This document describes resolved issues, new and changed features, and known issues in OmniVista 3600 Air Manager 8.0.11 and previous releases. The release notes include the following sections:

- "What's New in This Release" on page 1
- "Changes" on page 22
- "Fixed Issues" on page 28
- "Known Issues" on page 55

### What's New in This Release

The following enhancements have been added in OV3600 8.0.11:

- "OAW-IAP324 and OAW-IAP325 Support" on page 2

The following issues have been resolved in OV3600 8.0.10.1:

- "Issues Fixed in OV3600 8.0.10.1" on page 29

The following issues have been resolved in OV3600 8.0.10:

- "Issues Fixed in OV3600 8.0.10" on page 29

The following enhancements have been added in OV3600 8.0.10:

- "Third-Party Device Support in OV3600 8.0.10" on page 2
- "Alcatel-Lucent Instant Configuration Enhancements" on page 3
- "Instant 4.2.1 Feature Support" on page 3
- "Firmware Upgrade Failure Timeout " on page 4

The following enhancements have been added in OV3600 8.0.9.2:

- "OAW-AP324 and OAW-AP325 Support" on page 4

The following enhancements have been added in OV3600 8.0.9.1:

- "CentOS Update" on page 4

The following enhancements have been added in OV3600 8.0.9:

- "Firmware Distribution Over HTTP" on page 4
- "Alcatel-Lucent Instant 4.2" on page 4
- "Alcatel-Lucent Instant 4.1.2.0" on page 6
- "Brocade Network Advisor Support " on page 6
- "Third-Party Device Support in 8.0.9" on page 6

The following enhancements have been added in OV3600 8.0.8.1:

- "Licensing Enhancements" on page 7

The following enhancements have been added in OV3600 8.0.8:

- "Aruba Mobility Access Switch Enhancements in ArubaOS 7.3. or Earlier" on page 7
- "Aruba Mobility Access Switch Enhancements in ArubaOS 7.3.1.0 or Later" on page 7
- "Aruba Mobility Access Switch Enhancements in ArubaOS 7.3.2.0 or Later" on page 8
- "Aruba Mobility Access Switch Enhancements in ArubaOS 7.4.0.0 or Later" on page 9

- "Juniper Device Monitoring Enhancements" on page 11
- "RF Health Report Enhancements " on page 15
- "VisualRF Enhancements in HTML5" on page 19

The following enhancements have been added in OV3600 8.0.7:

- "New Supported Devices" on page 22
- "VisualRF Support for Third-Party Devices " on page 11
- "Instant Improvements " on page 15
- "RF Health Report Enhancements " on page 15
- "HTTP Request Retry Attempts" on page 16
- "MIB Improvements" on page 16

The following enhancements have been added in OV3600 8.0.6:

- "Third-Party Device Support " on page 11
- "UCC Dashboard Improvements " on page 14
- "New Configuration API " on page 15

The following enhancements have been added in OV3600 8.0.5:

- "Instant Improvements " on page 15
- "Mobility Access Switch Support Enhancements" on page 16

The following enhancements have been added in OV3600 8.0.4:

- "Instant Improvements " on page 15
- "Bulk Editing of the Switching File " on page 16
- "Site to Site IKE " on page 16
- "API for Streaming Raw Records " on page 17

The following enhancements were added in OV3600 8.0.x releases prior to OV3600 8.0.4.

- "Usage Column in AP Table " on page 17
- "Support for SCP for Alcatel-Lucent Firmware Upgrades " on page 17
- "Creating Custom Filtered Views " on page 17
- "VisualRF Support for Third-Party Devices " on page 11
- "AppRF Enhancements" on page 19
- "UCC Visibility" on page 20
- "Additive Licensing" on page 21
- "Client Health Graph" on page 21

## **OAW-IAP324 and OAW-IAP325 Support**

Beginning with OV3600 8.0.11, OV3600 supports the OAW-IAP324 and OAW-IAP325 access points.

## **Third-Party Device Support in OV3600 8.0.10**

### **Cisco**

Support for stacking of the Cisco 3650.

### **HP**

Added support for the following HP devices:

- MSM-775 controller
- HP425 AP
- HP560 AP
- HP-350 AP
- HP-355 AP
- HP-365 AP
- HP-385 AP
- 1910, 1920, and 1950 series Comware switches

## Alcatel-Lucent Instant Configuration Enhancements

OV3600 8.0.10 introduces the following Instant configuration enhancements:

- In order to reduce confusion when using the Instant GUI configuration, OV3600 now makes it clear whether the user is making changes at the group level or virtual controller level. When a specific virtual controller is selected, on the **OV3600** link is highlighted and the remaining links are greyed out. If the user clicks on one of the grayed-out links, OV3600 will prompt the to continuing working at the virtual-controller level or not. If the user clicks **OK**, the grayed-out links become highlighted. If the user clicks **Cancel**, the user is moved to the group level to continue configuration.
- Uplink configuration is now supported at the group level.
- Configuration template for thin OAW-IAPs. Prior to 8.0.10, template configuration for Instant only applied to virtual controllers. To create a thin OAW-IAP virtual controller template, navigate to **Group > Template** and use the **Alcatel-Lucent Instant Thin AP (Any Model)** option.
- OV3600 now calculates the uptime of a device based on the actual uptime of the device, not just the time that the device is connected to the OV3600.
- Existing clients with an unknown device type are now automatically updated when OV3600's OUI table is updated.
- The **Overrides** tab in the IGC has been update. Overrides are now displayed as a list of CLI commands that from the group configuration per virtual controller. Additionally, a **Remove All Overrides** button has been added at the virtual controller level to remove all overrides configured on the specified virtual controller.
- The IGC supports uplink configuration at the group and virtual controller levels.

### Instant 4.2.1 Feature Support

OV3600 8.0.10 introduces support for the following Instant 4.2.1 features in IGC. For more information about each of these features, see the *Alcatel-Lucent Instant 6.4.3.4-4.2.1.0 User Guide*.

- **Dynamic Proxy for RADIUS and TACACS:** IGC now supports dynamic proxy for RADIUS and TACACS. To enable this feature in IGC, navigate to **System > General > Dynamic Proxy** and check the **RADIUS** and/or **TACACS** check boxes and click **OK**.
- **Deauth of Inactive Clients:** Instant can now be configured to deauth clients when they become inactive. To configure this feature in IGC, navigate to **Networks > General > Show Advanced Options > Miscellaneous** and select **Enabled** from the **Deauth inactive clients** drop-down menu. This feature is disabled by default.
- **Time Based Services:** You can configure time range profiles using the OAW-IAP UI and CLI. These Time Range Profiles can be enabled on an IAP to allow or deny access to an SSID only during a specific period of time. You can create different types of time profiles, namely:
  - **Periodic:** The SSIDs and user roles will be provided access to the websites periodically within the specified time range. The user needs to select the **Period type** (day/weekday/weekend/daily) and the time range (**Start Time** and **End Time**) to create the periodic profile.

- **Absolute:** The SSIDs and user roles will be provided access to the websites only during the specified date and time duration.
- **XML-API Server Configuration Enhancement:** You can now configure up to 8 XML API server entries on OAW-IAP. You can also create XML API requests with appropriate authentication commands.
- **DHCP Enforcement:** You can now block traffic for OAW-IAP clients that do not obtain IP address from DHCP by selecting **Enable** under **Networks > General > Enforce DHCP** in the IGC.
- **Very High Throughput Configuration:** You can now enable or disable Very High Throughput (VHT) function on devices that support VHT. VHT is enabled by default on 802.11ac series OAW-IAPs. However, you can disable VHT if you want the 802.11ac IAPs to function as 802.11n OAW-IAPs. You can configure VHT on SSID or a 5 GHz radio profile. If you enable or disable VHT on an SSID, the configuration is applicable only to the clients connecting through that SSID. To disable or enable VHT on all SSIDs, configure VHT on the 5 GHz radio profile.
- **Minimum RSSI:** You can now configure the minimum Received Signal Strength indicator (RSSI) for probe and auth requests. The minimum can be specified between 0 and 100 dB.
- **Deny Inter User Bridging:** you can disable bridging traffic between two clients connected to the same AP on the same VLAN if you have security and traffic management policies defined in upstream devices.
- **Cellular SIM PIN Locking:** IAPs support SIM PIN lock function for 3G/4G modems that support the SIM locking feature to prevent fraudulent use. The IAP can now lock and unlock the SIM PIN using the **pin-enable** and **pin-puk** parameters in the **per-ap-settings** of the Instant configuration template.
- **Ethernet Type for L2 ACL:** Ethernet is now a configureable value in L2 ACLs and traffic can now be filtered based on the Ethernet field in the frame header.

## Firmware Upgrade Failure Timeout

Beginning with OV3600 8.0.10, you can configure the amount of time OV3600 continues to retry a firmware upgrade after a failure. The timeout limit range is from five minutes to 60 minutes. To configure this option, navigate to **OV3600 Setup > General > Firmware Upgrade/Reboot Options**.

## OAW-AP324 and OAW-AP325 Support

Beginning with OV3600 8.0.9.2, OV3600 supports the OAW-AP324 and OAW-AP325 access points.

## CentOS Update

Beginning with OV3600 8.0.9.1, the OV3600 software installation package is bundled with CentOS 6.6.

## Firmware Distribution Over HTTP

Beginning with OV3600 8.0.9, firmware distribution over HTTP is disabled by default. To enable this feature, navigate to **AMP Setup > General > Firmware Upgrade/Reboot Options** and select the **Yes** radio button for the **Enable firmware distribution via http** option.

This change impacts upgrades from Instant 4.0 and lower. Enable this feature before upgrading from Instant 4.0 or lower.

## Alcatel-Lucent Instant 4.2

OV3600 8.0.9 introduces support for Instant 6.4.3.x-4.2.0.0, also known as Instant 4.2. The following enhancements have been added to support Instant 4.2:

- **Support for Multiple XML API Server Configuration:** Users can now configure up to four XML API server entries on an IAP. These server entries can be edited or deleted if required. To configure this feature for a virtual controller or group of virtual controllers, navigate to **Instant Config > Services > Network Integration**.

- **Prevent Inter-user Bridging:** If you have security and traffic management policies defined in upstream devices, you can disable bridging traffic between two clients connected to the same AP on the same VLAN. When inter-user bridging is denied, the clients can connect to the Internet but cannot communicate with each other, and the bridging traffic between the clients is sent to the upstream device to make the forwarding decision. To find this option in the IGC, navigate to **Networks > New Network > General > Show advanced options > Deny inter user bridging**.
- **RadSec Certificate Support:** You can now upload RadSec and RadSec CA certificates to the IAP. These certificates are used for client authentication when RADIUS communication over TLS is enabled. To access this feature, navigate to **Instant Config > Security > Authentication Servers > New** or **Edit**.
- **Dell Service Tag for IAPs:** The **APs/Devices > Monitor** tab displays the Dell Service tag for Dell Networking W-Series IAPs running Instant 4.2.



This feature is not supported by some earlier W-Series OAW-IAP models, including the OAW-IAP92, OAW-IAP93, OAW-IAP104, OAW-IAP105, OAW-IAP114, OAW-IAP115, OAW-IAP134, OAW-IAP135, OAW-IAP155, OAW-IAP155P, OAW-IAP175, RAP-3WN and RAP-3WNP.

- **Inactivity Timeout:** This feature allows you to specify a session timeout interval in seconds, minutes or hours. If a client session is inactive for the specified duration, the session expires and the users are required to log in again. You can specify a value within the range of 60-86400 seconds (24 hours) for a client session. The default value is 1000 seconds. To access this feature, navigate to **Instant Config > Networks**, then selected **Wired** for **Type** and click **Show advanced options**.
- **Creating Custom Error Page for Web Access Blocked by AppRF Policies:** You can create a list of URLs to redirect users to when they access blocked websites. You can define an access rule to use these redirect URLs and assign the rule to a user role in the WLAN network. To find this option in IGC, navigate to **Security > Custom Blocked Page URL > New**.
- **Voice Traffic Prioritization:** In the 6.4.3.x-4.2 release, IAPs comply with Spectralink's Voice Interoperability for Enterprise Wireless (VIEW) Certification to ensure interoperability and high performance between Spectralink 84-Series, 87-Series, and 8020/8030 Wireless Telephones and WLAN infrastructure products. You can configure the following parameters in a WLAN SSID profile for voice traffic and Spectralink Voice Prioritization:
  - **Traffic Specification (TSPEC)**—Prioritizes time-sensitive traffic such as voice traffic initiated by the client.
  - **TSPEC Bandwidth**—Reserves bandwidth for voice traffic.
  - **Spectralink Voice Protocol (SVP)**—Prioritizes voice traffic for SVP handsets.
 To find these options in IGC, navigate to **Networks > New Network > General > Show advanced options > WMM**.
- **Captive Portal Server Offload:** This feature enables the external captive portal to reduce the load on the Portal server. This load on the external captive portal server by ensuring that the non-browser client applications are not unnecessarily redirected to the external portal server. To find this option in IGC, navigate to **Security > External Captive Portal > New**.
- **Configurable Transmission Power Limits for Radio Profiles:** The **Customize ARM power range** option is added to the radio profile configuration window to allow administrators to set transmit power limits for a specific radio band. To find this option in the IGC, navigate to **RF > Radio**.
- **Accounting Server Configuration in Wired Profiles:** You can now configure accounting servers for a wired network profile. You can either use the same server for authentication and accounting, or configure a separate accounting server. To enable accounting for wired profile users, configure an accounting server and set an accounting interval. To find this option in the IGC, navigate to **Networks > New Network > Security** and select the authentication server from the drop-down menu.
- **DNS IP Configuration for Virtual Controller:** You can explicitly configure the DNS IP address for Virtual Controllers. IAPs can obtain their DNS IP addresses from per AP configuration ( **ip-address** command), from

the DHCP server, or from the Virtual Controller DNS IP address configuration. The Virtual Controller DNS IP address is only used for APs and does not apply to the clients connected to the APs. To find this option in the IGC, navigate to **System > General** and then select a virtual controller. Then change the **Virtual Controller network settings** drop-down menu to **Custom** and complete your configuration.

- **Configuring Multiple Exclusion Ranges of IP Subnets:** IAPs now allow you to configure multiple exclusion ranges of IP subnets in a local, L2 DHCP profile. Based on the size of the subnet and the configured exclusion range, the IP addresses before and after the defined range are excluded. To find this option in the IGC, navigate to **DHCP Server > New** and enter the IP Range in the **IP Address Range** fields.
- **Configurable USB Port Status:** IAPs now allow you to set the USB port status to **enabled** or **disabled** based on your uplink preferences. If you do not want to use cellular uplink or 3G/4G USB modems in your current network, set the USB status to disabled. By default, the USB port status is enabled. To find this option in the IGC, navigate to **Access Points**, select an AP from the list, and then click **Uplink**.

Instant 6.4.3.x-4.2 does not support the OAW-IAP92 and OAW-IAP93.

For more information about the features and enhancements in Instant 4.2, refer to the following documents:

- *Alcatel-Lucent Instant 6.4.3.x-4.2 User Guide*
- *Alcatel-Lucent Instant 6.4.3.x-4.2 Quick Start Guide*
- *Alcatel-Lucent Instant 6.4.3.x-4.2 Release Notes*

## Alcatel-Lucent Instant 4.1.2.0

OV3600 8.0.9 introduces support for Instant 6.4.2.3-4.1.2.0.

## Brocade Network Advisor Support

In OV3600 8.0.9, OV3600 supports Brocade Network Advisor. Once integrated, a link to the Network Advisor is listed on the **Switch Monitoring** page in the **Device Info** section.

To integrate Brocade Network Advisor with OV3600:

1. Log in to OV3600.
2. Navigate to **AMP Setup > External Server**.
3. Enter the IP Address or Hostname of the Brocade Network Advisor.
4. Click **Save**.

## Third-Party Device Support in 8.0.9

OV3600 8.0.9 introduces monitoring support for the following devices:

### HP

- MSM417
- MSM425
- MSM525
- MSM527
- MSM560
- 830 Unified Wired-WLAN Switch
- 850 Unified Wired-WLAN Switch
- 870 Unified Wired-WLAN Switch
- 7500 Switch Series
- 10500 Switch Series



---

OV3600 supports these devices for monitoring only, not configuration. These devices are also not currently supported by VisualRF.

---

## Cisco

The Cisco 3850/3650 acting as a switch.

## Licensing Enhancements

OV3600 8.0.9 introduces the following licensing enhancements:

### License Expiration Email Notifications

For licenses with an expiration date, the administrator can configure email messages to notify specified parties of when a license is set to expire. OV3600 sends an expiration notification email six months, three months, one month, and one week prior to expiration. Additionally, the email lists time remain for each expiring license installed on the OV3600. This feature is disabled by default.

To configure Expiry Notifications:

1. Navigate to **Home > License > Expiry Notification Settings**.
2. Check the **Receive Email Notifications** check box to enable.
3. Insert any number of email addresses separated by spaces, commas, or semicolons.
4. Click **Save**.

### New Single Device License

OV3600 8.0.9 introduces support for the LIC-AW license SKU. This new license represents a single device monitored by OV3600.

### Subscription License

OV3600 8.0.9 introduces support for three new subscription-based license SKUs. These licenses are available in one, three, and five year subscriptions.

The new SKUs are:

- SUB1-AW-K12: One-year license
- SUB3-AW-K12: Three-year license
- SUB5-AW-K12: Five-year license

## Aruba Mobility Access Switch Enhancements in ArubaOS 7.3. or Earlier

OV3600 8.0.8 introduces the following enhancements to support for Aruba MAS devices:

### Bulk Override

**Destination Prefix**, **Destination Prefix Mask**, and **Next-Hop Address** are now support bulk override for Aruba MAS devices running version 7.3 or earlier. These are modified under **Groups > Switch Config > Layer 3 Features > IP** in the OV3600.

## Aruba Mobility Access Switch Enhancements in ArubaOS 7.3.1.0 or Later

OV3600 8.0.8 introduces the following enhancements to support for Aruba MAS devices running ArubaOS 7.3.1.0 or later:

### 802.1x Authentication Profile

**Deny DHCP** support in the **802.1x Authentication Profile** for devices running version 7.3.1.0 or later. To configure Deny DHCP:

1. Navigate to **Groups > Switch Config > Security & Authentication > 802.1x**.
2. Click **Add**.
3. Select **Yes** to enable or **No** to disable deny DHCP.

Deny DHCP is disabled by default.

**Delay EAP Success** support in the **802.1x Authentication Profile** for devices running version 7.3.1.0 or later. To configure Delay EAP Success:

1. Navigate to **Groups > Switch Config > Security & Authentication > 802.1x**.
2. Click **Add**.
3. Select **Yes** to enable or **No** to disable delay EAP success.

This feature is disabled by default.

### Web SSH Management Profile

Enable or disable Webserver in the **Web SSH Management** profile for devices running 7.3.1.0 or later. To enable or disable Webserver:

1. Navigate to **Groups > Switch Config > System Features > Web Server**.
2. Click **Yes** to enable or **No** to disable Webserver in the **Enable Webserver** field.
3. Click Save to complete the configuration. This feature is enabled by default.

Enable or disable Captive Portal Ports in the **Web SSH Management Profile** for devices running 7.3.1.0 or later. To enable or disable Captive Portal Ports:

1. Navigate to **Groups > Switch Config > System Features > Web Server**.
2. Click **Yes** to enable or **No** to disable Captive Portal Ports in the **Enable Captive Portal Ports (8080/8081)** field.
3. Click **Save** to complete the configuration. This feature is enabled by default.

### Aruba Mobility Access Switch Enhancements in ArubaOS 7.3.2.0 or Later

OV3600 8.0.8 introduces the following enhancements to support for Aruba MAS devices running ArubaOS 7.3.2.0 or later:

#### Aruba Central

**Aruba Central** support for Aruba MAS Devices running version 7.3.2.0 and later. To enable Aruba Central Configuration in OV3600:

1. Navigate to **Groups > Switch Config > System Features > General Config > Aruba Central Configuration**.
2. Select **Yes** to enable or **No** to disable.
3. Click **Save**. This feature is enabled by default.

#### BPDU Filtering Support

**BPDU filtering** support in the **Rapid-PVST+ Port Profile** for devices running version 7.3.2.0 or later. To configure BPDU filtering in the OV3600:

1. Navigate to **Groups > Switch Config > Layer 2 Features > STP > Rapid-PVST+ > Interface Config**.
2. Click **Add**.
3. Select **default** or **unconditional** from the drop-down menu next to the **BPDU Filter** option.
4. Click **Add** to complete the configuration.



BPDU filtering support in the **MSTP Port Profile** for devices running version 7.3.2.0 or later. To configure BPDU filtering in the OV3600:

1. Navigate to **Groups > Switch Config > Layer 2 Features > STP > MSTP > Interface Config**.
2. Click **Add**.
3. Select **default** or **unconditional** from the drop-down menu next to the **BPDU Filter** option.
4. Click **Add** to complete the configuration.

### Storm Control Bandwidth Range

The storm control bandwidth range has been increased to 1-100. The default value is still 50. This feature is modified in the OV3600 under **Groups > Switch Config > Layer 2 Features > Switchport**.

### Aruba Mobility Access Switch Enhancements in ArubaOS 7.4.0.0 or Later

OV3600 8.0.8 introduces the following enhancements to support for Aruba MAS devices ArubaOS 7.4.0.0 or later:

#### Aruba-VPN Pools Profile

**Aruba-VPN Pools** profile configuration support for devices running version 7.4.0.0 or later. To add a new Aruba-VPN Pool profile:

1. Navigate to **Groups > Switch Config > System Features > DHCP > Aruba-VPN Pools**.
2. Click **Add**.
3. Fill in the fields to complete the configuration.

#### Deny Inter User Traffic in a User Role

**Deny Inter User Traffic** support in a **User Role** for devices running version 7.4.0.0 or later. To configure Deny Inter User Traffic:

1. Navigate to **Groups > Switch Config > Security & Authentication > User Roles**.
2. Click **Add** to create new role or selecting an existing role to edit.
3. Select **Yes** to enable or **No** to disable deny inter user traffic in the **Deny Inter User Traffic** field.

Deny Inter User Traffic is disabled by default.

#### Device-Group Profile

**Device-Group** profile configuration support for devices running version 7.4.0.0 or later. To add a Device-Group profile:

1. Navigate to **Groups > Switch Config > Interfaces > Device-Group**.
2. Fill in the fields to complete the configuration.

#### Dynamic DNS Client Profile

**Dynamic DNS Client** profile configuration support for devices running version 7.4.0.0 or later. To configure a Dynamic DNS Client profile:

1. Navigate to **Groups > Switch Config > Layer 3 Features > Dynamic DNS Client**.
2. Click **Add**.
3. Populate the fields relevant to your configuration.
4. Click **Add** to complete the configuration.

## IGMPv3 Snooping

Support for **IGMPv3 Snooping** configuration on devices running version 7.4.0.0 or later. To enable configure **IGMPv3 Snooping** in the OV3600:

1. Navigate to **Groups > Switch Config > Multicast Features > IGMP Snooping (v1/v2)**
2. Click **Add** or select an existing IGMP snooping profile.
3. For both **IGMPv3 Snooping** and **IGMPv3 Snooping Proxy**, select **Yes** to enable or **No** to disable in the appropriate field.

This feature is disabled by default.

## Invert and Range Options

The **Invert** and **Range** options under **Groups > Switch Config > Security & Authentication > Network Aliases > Destination** have been removed.

## NAT Pool

**NAT Pool** configuration support for devices running version 7.4.0.0 or later. To configure a NAT Pool profile in the OV3600:

1. Navigate to **Groups > Switch Config > Security & Authentication > NAT Pools**
2. Click **Add**.
3. Configure the NAT Pool completing the UI fields.
4. Click **Add** to complete the configuration.

## Probe Profile

The **Probe** profile for L3 interface monitoring configuration support for devices running version 7.4.0.0 or later. To add a new Routed VLAN Interface profile:

1. Navigate to **Groups > Switch Config > Layer 3 Features > Probe**.
2. Click **Add**.
3. Fill in the fields to complete the configuration.

## Rogue Containment Profile

**Rogue AP Containment** profile configuration support for devices running version 7.4.0.0 or later. To add a new Rogue AP Containment profile:

1. Navigate to **Groups > Switch Config > System Features > Rogue AP Containment**.
2. Complete the configuration.
3. Click **Save**.

## Route Metrics

Support for route metrics for DHCP Client-enabled L3 Interfaces on devices running version 7.4.0.0 or later. To configure **Interface Metrics**:

1. Navigate to **Groups > Switch Config > Interfaces > Routed VLAN Interfaces**.
2. Enter value between 0 and 65535 in the **Interface Metric** field.
3. Click **Add** to complete the configuration.

By default, the value is set to 0.

## Route VLAN Interfaces Profile

**Routed VLAN Interface** profile configuration support for devices running version 7.4.0.0 or later. To add a new Routed VLAN Interface profile:

1. navigate to **Groups > Switch Config > Interfaces > Routed VLAN Interfaces**.
2. Click **Add**.
3. Fill in the fields to complete the configuration.

### Standby Interface VLAN

**Standby Interface VLAN** configuration support on devices running version 7.4.00 or later. To configure a **Standby VLAN Interface** in the OV3600:

1. Navigate to **Groups > Switch Config > Security & Authentication > Virtual Private Networking > IPSEC > IPSEC MAP**.
2. Click **Add** or select an existing IPSEC Map.
3. Select an interface VLAN from the drop-down menu next to **Standby Interface VLAN** or click the **plus (+)** symbol to configure a new one.
4. Click **Add** to complete the configuration.

### Juniper Device Monitoring Enhancements

OV3600 8.0.8 introduces the following for Juniper devices:

- A tab on the OV3600 Setup page has been renamed from **Third Party Integration** to **Juniper**. A link to Network Director appears on the **Switch Monitoring** page: **Link to Juniper Network Director**.
- dot11 counters on the Juniper WLAN
- The collection of CPU and memory information from Juniper switches. This information is displayed on the monitoring page of the switch and can be included in reports and triggers.

In OV3600 8.0.7, OV3600 supports Juniper Network Director (ND) 2.0. Once integrated, a link to the ND is listed on the **Switch Monitoring** page in the **Device Info** section. Clicking the link redirects the user to the ND UI, where they are prompted for ND login credentials. Users are redirected to the URL

**https://<nd>/mode=Monitor&deviceip=<x.x.x.x>**.



---

Currently, AMP does not have visibility into devices managed in ND. ND will display an error if a device with IP address is not found.

---

To integrate ND with OV3600:

1. Login to the OV3600.
2. Navigate to **AMP Setup > External Server**.
3. Enter the IP Address or Hostname of the ND.
4. Click **Save**.

### VisualRF Support for Third-Party Devices

Beginning in OV3600 8.0.7, the following third-party devices are supported in VisualRF:

- Cisco Controllers: 3650, 3850, and 8510
- Cisco Access Points: 1700, 2700, and 702W
- Juniper Controllers: WLC100, WLC2, WLC2800, WLC8, WLC800, WLC880, and WLCJUNOSV

### Third-Party Device Support

OV3600 8.0.6 introduces support for the following third-party devices.

## Brocade

The Brocade ICX6610-48 switch is now supported in VisualRF. OV3600 supports Brocade switches operating as standalone and stacked switches.

**Table 1:** *Supported Firmware for switches*

Firmware Version	Model Type
08.0.20T211 and 08.0.30aT213	ICX6610-48

## Cisco

The following Cisco products are supported for monitoring, configuration, and software upgrades.

**Table 2:** *Supported Firmware for controllers*

Firmware Version	Model Type
03.06.01E, 03.03.05SE, 03.06.01E, 03.07.00E	<ul style="list-style-type: none"><li>• 3650</li><li>• 3850</li></ul>
7.4.121.0, 7.6.130.0, 8.0.100.0, 8.0.110.0	8510
10.2.111.0 (IOS: 15.3(3)JN3)	2700

**Table 3:** *Supported Firmware for APs*

Firmware Version	Model Type
10.2.111.0 (IOS: 15.3(3)JN3)	<ul style="list-style-type: none"><li>• 1700</li><li>• 2700</li><li>• 702W</li></ul>

## Dell Networking

The following Dell Networking products are supported for monitoring using OV3600.

**Table 4:** *Supported Firmware for switches*

Firmware Version	Model Type
8.3.2.0	<ul style="list-style-type: none"><li>• E150</li><li>• E300</li><li>• E600</li><li>• E610</li><li>• E1200</li><li>• E1200i</li></ul>
8.4.2.9	<ul style="list-style-type: none"><li>• C300</li><li>• C150</li></ul>

**Table 4:** *Supported Firmware for switches (Continued)*

Firmware Version	Model Type
8.4.2.6	<ul style="list-style-type: none"><li>• S25n</li><li>• S25pac</li><li>• S25pdc</li><li>• S25v</li><li>• S50</li><li>• S50nac</li><li>• S50ndc</li><li>• S50e</li><li>• S50v</li><li>• S2410cp</li><li>• S2410p</li></ul>

## Juniper

The following Juniper products are supported for controller and AP discovery and monitoring.

**Table 5:** *Supported Firmware for APs*

Firmware Version	Model Type
9.1.0.6.0	<ul style="list-style-type: none"><li>• WLA321</li><li>• WLA322</li><li>• WLA522</li><li>• WLA532</li><li>• WLA632</li></ul>

**Table 6:** *Supported Firmware for controllers*

Firmware Version	Model Type
9.1.0.6.0	<ul style="list-style-type: none"><li>• WLC100</li><li>• WLC2</li><li>• WLC2800</li><li>• WLC8</li><li>• WLC800</li><li>• WLC880</li><li>• WLC JunosV</li></ul>

## Meru

The following Meru controllers and APs are now supported in VisualRF.

**Table 7: Supported Firmware for APs**

Firmware Version	Model Type
6.1.1-25	<ul style="list-style-type: none"><li>• AP302</li><li>• AP320i</li><li>• AP332i</li><li>• AP433i</li><li>• AP433is</li><li>• AP822e</li><li>• AP822i</li><li>• AP832e</li><li>• AP832i</li><li>• RS4000</li></ul>

**Table 8: Supported Firmware for controllers**

Firmware Version	Model Type
6.1.1-25	<ul style="list-style-type: none"><li>• MC1550</li><li>• MC3200</li><li>• MC4200</li></ul>



---

VisualRF support for the for the AP433i, AP433e, AP433is, AP822i, and AP822e is not included in OV3600 8.0.6

---

### Motorola

The following Motorola autonomous APs are now supported in VisualRF.

**Table 9: Supported Firmware for APs**

Firmware Version	Model Type
5.4.2.0-30R	<ul style="list-style-type: none"><li>• AP621</li><li>• AP622</li><li>• AP6521</li><li>• AP6522</li><li>• AP6532</li><li>• AP7161</li></ul>

**Table 10: Supported Firmware for controllers**

Firmware Version	Model Type
5.4.2.0-30R	RFS4000

### UCC Dashboard Improvements

Starting with OV3600 8.0.6, on the UCC dashboard, The MOS (Mean Opinion Score) is now visible in the Call details, Client Details and Client dialog page. The MOS is updated after a call has ended.

## New Configuration API

A new configuration API has been added in OV3600 8.0.6 that changes customer variables, Instant VC variables, and configuration push.

## Instant Improvements

OV3600 8.0.7 added the following:

- The IGC CLI model now initializes when the AMP starts for the first time. If the IGC engine is not currently running, it may be disabled. You can enable it on the Groups Basic page. The engine may take a few minutes to start after it is enabled.
- After an IAP receives configuration information from OV3600, the Virtual Controller now enters a confirmation message in the AMP Device Events log. The message displayed reads: "Configuration is successfully synchronized from management server."
- OV3600 now supports bulk configuration of thin AP radio roles and ARM mode.
- Support has been added for batch collection of debug data from OV3600 to IAP groups.

OV3600 8.0.5 added the following:

- IAP certificate authentication performance has been improved.

OV3600 8.0.4 added the following:

- Instant 4.1.1 CLI in template mode.
- Instant 4.1 and Instant 4.1.1 GUI Config (IGC)

## RF Health Report Enhancements



---

Starting in OV3600 8.0.8, the folder, client, and radio statistics in the RF Health Report are unchecked and disabled by default. Additionally, upon upgrade to OV3600 8.0.8, these options will become unchecked and disabled in any previously configured RF Health Report definitions.

---

In OV3600 8.0.7, a number of enhancements have been added to the RF Health Report. A report can now be summarized by:

- Top Folders By Worst Client and Radio Statistics Combined 2.4 GHz and 5 GHz
- Client and Radio Statistics by Folder - Combined 2.4 GHz and 5 GHz
- Top Folders By Worst Client and Radio Statistics 2.4 GHz
- Client and Radio Statistics by Folder - 2.4 GHz
- Top Folders By Worst Client and Radio Statistics 5 GHz
- Client and Radio Statistics by Folder - 5 GHz

The statistics displayed can be Client Health, Client SNR, Radio Noise, Radio Utilization, or Radio Interference. The thresholds for the statistics are defined in the corresponding fields below. These thresholds are defined by a specified percentage (0-100%) or dBm (-110-0 dBm) for Radio Noise Threshold.

To enable these:

1. Login to the OV3600
2. Navigate to **Reports > Definitions**.
3. Select **Daily RF Health Report**.
4. Check any options under **Summarize report by**.
5. Select the statistics to be displayed from the **Top Folder Sorting Column** drop-down menu.
6. Define any thresholds appropriate to your report.
7. Click **Save and Run** or **Save**.

## HTTP Request Retry Attempts

In OV3600 8.0.7, you can configure the number of HTTP request retry attempts. Also, more log information regarding **amp\_events** about an HTTP retry has been added.

## MIB Improvements

In OV3600 8.0.7, two new enhanced traps have been added: **apUp** and **apDown**. These traps now allow the AP MAC address and the AP name to be added. They support rogue containment so there is no mismatch in the AP list when the AP is in **monitor\_only** mode and the IGC is enabled.

Because the error is not set in the configuration response from the AP when the IGC is enabled, the error is displayed by the IGC instead.

## Mobility Access Switch Support Enhancements

In OV3600 8.0.5, The drop-down list of Show commands on the switch monitoring page are now categorized. The commands are grouped as follows:

- Switch Details
- ArubaStack
- LLDP/CDP
- Power over Ethernet
- Layer 1 / Layer 2
- Layer 3
- Tunneling (IPSEC/GRE)
- Authentication & 802.1x Troubleshooting
- User Details

Support for parsing the bandwidth values for wired clients connected to an Aruba Mobility Access Switch has been added. Now AMP shows the data usage for wired clients connected to the switch.

## Bulk Editing of the Switching File

Starting in OV3600 8.0.4, the VLAN bulk edit allows you to update the following switching configuration options at the same time:

- access-vlan
- native-vlan
- trunk allowed vlan <list>

## Site to Site IKE

OV3600 8.0.4 introduces a Site to Site IKE configuration page under **switch Config > Advanced Services > VPN Services > IKE > Site to Site IKE** as shown in [Figure 1](#). This page allows you to configure Site to Site IKE on a switch. Refer to the Virtual Private Networks chapter in the *Alcatel-Lucent AOS-W User Guide* for more information about IKE.



**Figure 1: Site to Site IKE**

Configure DPD:  Yes  No

Permit Invalid Certificates:  Yes  No

Disable Aggressive Mode:  Yes  No

XAuth:  Yes  No

CA-Certificate for VPN Clients: Certificate Name, type uniqueness conflicts between "Aruba Config" and "Controller Override" may result in pushing unintended certificate to the controller. --None--

Server-Certificate for VPN Clients: Certificate Name, type uniqueness conflicts between "Aruba Config" and "Controller Override" may result in pushing unintended certificate to the controller. --None--

Configure IKE Certificate-Group for VPN Clients:  Yes  No

**Site to Site IKE Shared Secrets**

Add New Site to Site IKE Shared Secret

## API for Streaming Raw Records

An API, which streams raw records for reports in CSV format, is available in OV3600 8.0.4. This API is a beta version only. To try this API, please contact your support person for details.

## Usage Column in AP Table

In OV3600 8.0.2, a usage column, which can be filtered and sorted, has been added to the AP table.

## Support for SCP for Alcatel-Lucent Firmware Upgrades

In OV3600 8.0.2, SCP is now supported for uploading a firmware file to a switch when performing a firmware upgrade. An option has been added to select SCP when uploading a firmware file to the OV3600.

## Creating Custom Filtered Views

In OV3600 8.0.2, the custom filtered views feature supports up to 20 data columns. The columns in these customizable tables resize automatically to fit their contents, but if the table still does not fit within the browser page, a scroll bar appears below the table, allowing you to scroll and view the additional columns. The columns in the default view for each of the following pages are defined in OV3600 and cannot be modified. However, you can now create a new view in each of these pages that returns custom information based on the filter parameters and data columns you selected when creating that new view.

- **APs/Devices > List**
- **APs/Devices > Up**
- **APs/Devices > Down**
- **APs/Devices > Mismatched**
- **Groups > Monitor**
- **Clients > Connected**
- **Clients > All**
- **RAPIDS > List**

**Figure 2: Default View of Devices**

Device	Status	Configuration	Controller	Folder	Group	Clients	Usage	IP Address	Type
CN18DWY09T	Up	Good	MSM720	HP	HP	0	0 bps	10.51.1.2	HP ProCurve M...
MSM720	Up	Good	-	HP	HP	0	0 bps	10.51.3.104	HP ProCurve M...
SG102LBW12	Up	Good	-	HP	HP	0	0 bps	10.51.3.103	HP ProCurve M...

To create a new filtered view, navigate to any page that contains a default view list, such as **APs/Devices > List**.

1. Click the icon. The **Filtered View** page opens.
2. Enter the name of the new view.
3. (Optional) OV3600 administrators can select the **Is Global** check box to give all users access to the filtered view. Administrators are able to edit any global view they can see in the filtered view drop-down list.
4. Click **Add Filter**. A new list of parameters is added to the **Filter** field.
5. Scroll the list of parameters and select a **Device** or **Radio** parameter. If required, enter search parameters such as "=" to refine the filter parameters.
6. (Optional) To create a filtered view with multiple filter parameters, click **Add Filter** again and define any additional filter parameters. For example, to create a view that displays APs with more than zero clients but less than five clients, you would need to create one filter with the parameters **Clients > 0**, and a second filter with the parameters **Clients < 5**.
7. Drag and drop data columns from the **Available Columns** list to the **Current Columns** list to the columns display in the view. You can reorder the columns in the **Current Columns** list by dragging and dropping a data column to a different place in the list.
8. Click **OK**. The name of the new view is added to the view list.
9. Click the name of the new view. A new page displays the results of the new view, based on the configured filters.

You can edit a custom filtered view at any time, by selecting the view in the view list, then selecting the icon and modifying filter parameters and column displays.

**Table 11: Filter icons**

Icon	Description
	Click this icon to create a custom filtered view.
	Click this icon to edit an existing custom filtered view.
	Click this icon to clone a custom filtered view.
	Click this icon to delete a custom filtered view.

## VisualRF Enhancements in HTML5

This section describes the new features associated with the HTML5-based UI for VisualRF.

### Copy a Floor in the Same Building

In OV3600 8.0.8, the Floor plan **Duplicate** option lets you copy a floor in a building when you want to create a duplicate floor in the same building.

### Floor Upload Wizard

Starting in OV3600 8.0.0, the **Floor Upload Wizard** allows you define the parameters required to complete a new floor plan. The wizard has three pages:

- **Scale** - This page allows you define the lengths and width of the new floor plan.
- **Region** - This page provides drawing tools you use to define the floor plan boundary and planning region(s).
- **Access Points** - This page gives you the option to plan an AP deployment, or to add APs that are already deployed.

### Navigation Improvements

Starting in OV3600 8.0.0:

- You can select between the **Map** and **List** views from the **VisualRF** page. The **Map** view shows the geographic location of each campus. The **List** view is a sortable table that lists the names of building and campuses in the network, the number of floors in each building and the name of each floor. You can click any of the links in the table to view that campus, building or floor plan in VisualRF.
- When you select a campus in VisualRF and drill down to view buildings and floor plans within that campus, the VisualRF page displays your path in a breadcrumbs format, such as **Campus One > Building One > Floor 2**. Click a link in the breadcrumb list to view the selected campus or building.
- The **Network** page now displays **Properties**, **View**, and **Edit** menu links in the Map view. In the List view, the menu links appear after you select a campus name from the list. These links display information for the selected network, campus, building or floor level.
- A new drop-down menu in VisualRF lists all campuses in the network. To access this menu, click the arrow to the left of the **Network** label on the **VisualRF** page. Select a campus name, then expand the list to access a building or floor in the campus.
- The VisualRF **Overlays** menu contains three new overlays:
  - AppRF: Identifies clients who are contributing to the usage of one or more selected applications.
  - Channel: Identifies the overlapping and specific regions for selected channels on a floor plan.
  - UCC: Displays the call quality of Unified Communication and Collaboration (UCC) calls.
- The new HTML5 UI replaces the Flash UI as the default view.



---

The HTML5-based UI does not support wired overlays or wired devices. The **VisualRF Plan** was not migrated to HTML5. To administer wired overlays and devices, go to **VisualRF > Setup** and click **No** in the **Enable HTML5-based UI** field.

---

## AppRF Enhancements

This section describes enhancements to the AppRF visibility features introduced in OV3600 8.0.0.

### AppRF Overlay

The AppRF overlay identifies clients who are using one or more selected applications, such as YouTube or Facebook. The overlay uses colors to show usage thresholds. To see the usage, mouse over the client icon. The threshold colors for the following usage categories are preset and cannot be edited:

- Green: Client has used between 0 and 20 MB in the past two hours.

- Yellow: Client has used between 20 MB and 1 GB in the past two hours.
- Red: Client has used more than 1 GB in the past two hours.

## AppRF Reports

The AppRF reports show the top client destinations and applications for all groups and folders. The available options for this report are:

- Top Applications Summary
- Top Destination Summary
- Top ten Applications By Device Types
- Top ten Applications By User Roles
- Top ten Applications By SSIDs
- Top three Applications For Top Ten Users
- User Detail

Note that the **User Detail** report is available only to users configured in the report definition.

## UCC Visibility

OV3600 8.0.0 introduces an aggregated view of the UCC calls made in the network. The administrator can see a top level view of the call quality assessment, and further drill down into a specific view based on the analysis required.

### Home>UCC charts

The **Home>UCC** page provides the four charts described below.

- **Call Quality:** This set of graphs show the quality of calls on the network over the selected time period. The **Trend** chart shows the number of calls with good, fair, or poor client health over the selected time period. The **Distribution** graph shows the relative proportions of calls with each quality type, and the APs chart shows information about APs that supported poor quality calls. You can also hover your mouse over the **Trend** or **Distribution** charts to view details about the highlighted section of that chart.
- **Quality Correlation:** These graphs display the correlation between the VoIP call quality and the VoIP client health of every UCC call. The **Trend** chart shows the number of calls with good, fair, or poor client health over the selected time period, while the **Scatterplot** chart shows the call quality and client health of each individual call.
- **Call Volume:** The Call Volume **Trend** graph displays the number of calls by UCC application type, for example, SIP, Lync, SCCP, H.323, NOE, SVP, VOCERA, or FaceTime. The Call Volume **APs** graph shows the names of the APs that supported these calls.
- **Devices:** These graphs display information about the calls made by different device types, such as Windows 7, Mac OS X, iPhone, or Android devices. The Devices **Trend** and **Distribution** graphs show the numbers of calls by each platform type, while the **Quality** graph shows the numbers of calls at each quality level made by each device type.

AMON provides data to populate the charts. The UCC feature also provides a Lync overlay that shows a historic view of calls, and a Lync Mobility trail to track historic call sessions.

**Figure 3: UCC Dashboard Example**



### Call Details and Diagnostics

You can mouse over any of these UCC charts to view details about that chart, or drill down to a detailed view to display more specific information based on call quality and client metrics. To display an aggregated list of UCC call data metrics, click any of the following hyperlinks on the **Home > UCC** page:

- Call Details
- Call Volume Details
- Device Details

Click on any call on the Quality Correlations **Scatterplot** graph to open the **Clients >Diagnostics** page. This page provides an overview of a WLAN user's general status and connectivity on the network

### UCC Overlay

VisualRF includes a new UCC Overlay that displays information about UCC calls. You can configure this overlay to display calls that match any of the following values:

- Protocol: **Lync** or **All**
- Type: **Voice**, **Video**, or **All**
- Quality: **All**, **Good**, or **Unknown**

### Additive Licensing

OV3600 8.0.0 introduces support for multiple licenses on one system. This enhancement allows you to install a new license for additional APs without modifying existing AP licenses.

### Client Health Graph

Starting with OV3600 8.0.0, the **Home** and **Folder** pages include a new graph that provides client health information. The graph shows the percentage of clients with good, fair, and poor health. To view the new graph from the **Home** page, select **Client Health** from the **Clients** menu.

The client health metric displayed in these charts is the efficiency at which that AP transmits downstream traffic to a particular client. This value is determined by comparing the amount of time the AP spends transmitting call data to a client to the amount of time that would be required under ideal conditions, that is, at the maximum Rx rate supported by client, with no data retries.

## New Supported Devices

- Alcatel-Lucent Access Points
  - OAW-AP103/OAW-AP103H and OAW-IAP103
  - OAW-AP114/OAW-AP115 and OAW-IAP114/OAW-IAP115
  - OAW-AP204/OAW-AP205 and OAW-IAP204/OAW-IAP205
  - OAW-AP205H (starting in OV3600 8.0.7) and OAW-IAP205H (starting in OV3600 8.0.9)
  - OAW-AP214/OAW-AP215 and OAW-IAP214/OAW-IAP215
  - OAW-AP228 (starting in OV3600 8.0.7) and OAW-IAP228 (starting in OV3600 8.0.9)
  - OAW-AP274/OAW-AP275 and OAW-IAP274/OAW-IAP275
  - OAW-AP277 (starting in OV3600 8.0.7) and OAW-IAP277 (starting in OV3600 8.0.9)
  - OAW-AP324/OAW-AP325 starting in OV3600 8.0.9.2
- Multi-Vendor Devices
  - Cisco 5760 wireless LAN controller\*
  - Cisco 3700 and 1550 access points
  - Motorola Wing5 RFS controllers and 6532, 6522 and 6521 APs\*\*
  - Brocade ICX switches\*

\* Monitoring only; configuration within OV3600 not supported

\*\* These AP and controller models may require adjustments to the OV3600 SNMP timeouts to compensate for known SNMP issues on these devices.

## Changes

Changes to OV3600 were made to the following general categories:

- ["Audit Page Enhancements "](#) on page 22
- ["License Limit Alert"](#) on page 23
- ["Automatic IGC Policy Upgrade "](#) on page 23
- ["IGC Policy Copy "](#) on page 23
- ["Introduced in OV3600 8.0.5:"](#) on page 23
- ["VisualRF Improvements"](#) on page 23
- ["List Changes"](#) on page 24
- ["Configurable Tables"](#) on page 24
- ["Enhanced Export Report Option"](#) on page 25
- ["switch Backups and Restoration"](#) on page 25
- ["System Resources Trigger"](#) on page 25
- ["LDAP Enhancements"](#) on page 25
- ["Redis Statistics"](#) on page 26
- ["Match Events Table Improvement"](#) on page 26
- ["Local switch Configuration"](#) on page 26
- ["Other Categories"](#) on page 26

## Audit Page Enhancements

Starting with OV3600 8.0.6, the **Audit** page is divided into multiple subsections, improving the time it takes that page to load.

The **Audit** page appears when you select a device from the **Devices** list on the **AP/Devices > List** page. Each section of this page sends requests separately and loads as soon as a response is received. This eliminates a dependency on the other sections and reduces bottlenecks in data loading. Additionally, if there is a delay in response, a loading message is now displayed while the data is sent.

## License Limit Alert

Introduced in OV3600 8.0.6, in addition to displaying the number of days remaining on a license, the **Home > Licenses** page now displays a warning message when usage levels for a license exceeds 90%. If your OV3600 deployment includes temporary or evaluation licenses, the **License** page shows the **License Usage: xx%** warning next to the **Days Remaining: xx** message.

## Automatic IGC Policy Upgrade

Introduced in OV3600 8.0.6, if all IAPs in a group upgrade to a new software version, the IGC now migrates the group policy to the new version if the new version of software is higher than the current one.

## IGC Policy Copy

Introduced in OV3600 8.0.6, the IGC is now notified to copy the group policy from the original group to the new group when you duplicate a group using the IGC.

## Instant Improvements

Introduced in OV3600 8.0.6:

- OV3600 8.0.6 introduces support for destination IP and reverse DNS lookup for IAP AppRF data.
- Beginning with OV3600 8.0.6, Instant thin AP batch configuration supports DNS and swarm mode configuration.

Introduced in OV3600 8.0.5:

- The IAP reboots automatically when you change the IP address of the IAP.
- In the IGC, the multi-edit save function now saves a change but does not apply it until you click the **Apply** button.
- In the IGC, you can view and edit the **Longitude, Latitude, Altitude**, and **Notes** configuration values of a VC or an AP. For a VC, view or edit these values from the **AirWave > OV3600 Settings** pages of the IGC. To view or edit values for an AP associated with a VC, select that device from the **Access Points** page of the IGC, then select **OV3600 Settings**.
- A new configuration option has been added that allows you to perform bulk template modifications on virtual controller timezones .
  1. From the **Groups > List** page, select a group of Instant devices and click **Modify Devices**.
  2. Click the **Change device Group/Folder** drop-down list and select **Alcatel-Lucent Instant virtual controller variables**.
  3. Select one or more VCs and click **Update**. If the selected devices are *not* managed using the IGC, the **Groups > Monitor** page opens, allowing you to modify the **Clock\_timezone** field.
- IAP certificate authentication performance has been improved.

## VisualRF Improvements

The following VisualRF Enhancements were introduced in OV3600 8.0.4 to improve performance:

- Background loading of AP and client discovery data in the UI. This causes the floor plan and AP heatmaps to appear immediately while client, rogues, association line data loads in the background.

- Background fetching of AP bandwidth, uptime, AP Radio Channel Utilization and Client health data when user clicks on AP or client to view properties. OV3600 will now only fetch the data when a particular AP is clicked on instead of fetching the data for all APs when the floorplan loads.
- Optimize fetching of data from internal caches.
- Reduce startup time by not fetching ap\_detail values from OV3600 during startup. Viewing of client and rogue data on floor plan is delayed until the next switch SNMP poll cycle period.
- Read-only users can now use location history.
- The loading icon now appears when a floor plan is opened in any view.
- The channel utilization overlay now loads properly in 8.0.4.
- When using VisualRF in Mozilla Firefox, devices do not stick to the cursor when moving them around the floor plan.

## List Changes

The lock icon in the configuration column of an AP/Devices List has been reimplemented in OV3600 8.0.4. The lock icon indicates that the device in that row is in **Monitor only** mode.

For a new Instant device in the **APs/Devices > New** page, the admin user can mouse over the value under the **Type** column to verify the device's Shared Secret with the OV3600 server.

The **Manage** (wrench) icon has been removed in OV3600 8.0.4, however the same functionality has been maintained. If you mouse over an device's line in a list, a popup menu appears, allowing you to select options such as **Manage**, **Audit**, **Monitor**, and **Compliance**. Clicking any of the links takes you to the corresponding page in the UI; additionally, clicking on the device link takes you to the monitor page.

**Figure 4:** Device Drop Down Menu

Device ▲	Status ▼
00:0b:86:f0:33:20	Up
00:1a:1e:c0:1a:dc	Up
00:1a:1e:c0:55:3a	Up
00:24:6c:c7:f8:1c	Up
00:24:6c:c8:de:8a	Up
6c:f3:7f:ca:84:f0	Up

Manage

Audit

Monitor

Compliance

## Configurable Tables

By default, the tables on the pages listed show 25 rows of information. OV3600 8.0.2 allows you to change this value and display a different number of table rows on each page. Click the **Page Length** drop-down menu above the table and select any of the predefined page lengths, or select **Custom** and enter a value in the **Page Length** field to create a new custom page length. You can force all lists to take on a change made to the **Default Number of Records per List** setting on the **User Info** page by clicking the **Reset** button directly below it.


- **APs/Devices > List**
- **APs/Devices > Up**
- **APs/Devices > Down**
- **APs/Devices > Mismatched**
- **Groups > Monitor**
- **Clients > Connected**
- **Clients > All**
- **RAPIDS > List**





Although this feature allows you to configure a page length of up to 2000 table entries, longer page lengths require more time to load the page in the Web browser. Best practices are to limit the page display to display 500 or fewer entries.

**Figure 5: Defining a Custom Page Length**

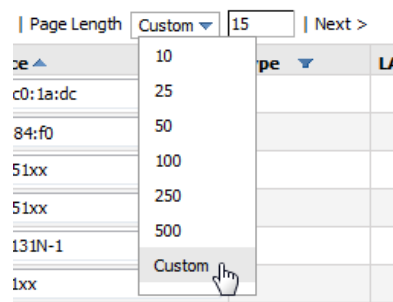

## Enhanced Export Report Option

Introduced in OV3600 8.0.0, a new **Export Report** option allows you to use SCP or FTP protocols to transfer a report to an external server. To export a report, the report must be in the .csv or .pdf format. The export parameters are set in the **Export Options** field on the **Reports Definitions** page. Click **Yes** in the **Export Report** field to open the **Export Options** pane, which allows you to define settings for external server.

## switch Backups and Restoration

Starting in OV3600 8.0.0, you can create a backup on demand by creating and collecting a flash backup from the switch. Daily backups are also created. At a minimum, there are four backup files:

- Two daily backups
- One backup from last week
- One backup from last month

The backup saved from a firmware upgrade is automatic and requires no manual intervention. All backups can be saved or restored and are displayed on the **Audit** page. You can only perform a backup on a device if the firmware version of the device and the backup image are identical. After you click Restore, the device on which the restoration is being performed automatically switches from monitor mode to maintenance mode. After you restore a backup image to a device, you must restart OV3600.

## System Resources Trigger

Starting in OV3600 8.0.0, system resources usage values are now available as Trigger types. To create a **System Resources** trigger,

1. go to **System > Triggers** and click **Add**.
2. In the **Type** drop down list, select **OV3600 Health>System Resources**.
3. The available matching conditions for this trigger are **CPU Utilization Percentage**, **Disk I/O Utilization Percentage**, and **Memory Utilization Percentage**. You must configure at least one matching condition before you can save the new trigger.
4. Click **Add** to save your trigger.

## LDAP Enhancements

Starting in OV3600 8.0.0, OV3600 includes an option to define an LDAP rule that assigns an OV3600 user role. The configurable parameters for this LDAP rule are **Position**, **Role Attribute**, **Operation**, **Value** and **OV3600Role**. If you create multiple LDAP rules, rules are processed in order based on the rule position value, so

the position you assign to the LDAP rule represents the order in which the LDAP rule is applied to determine the OV3600 role. LDAP rules can only be configured and applied after LDAP authentication is enabled. The LDAP rules are similar to the rules used by the switch to derive the OV3600 role.

## Redis Statistics

Starting in OV3600 8.0.0, the **System>Performance** page includes three **Redis Statistics** charts: **Redis Activity**, **Redis Used Memory**, and **Redis Keyspace**. Use these charts under the supervision of Alcatel-Lucent support to troubleshoot Redis activity and keys.

## Match Events Table Improvement

Starting in OV3600 8.0.0, the **Match Events** table in the **Clients>Diagnostics** page now includes dBm information in the **From AP Signal** and **To AP Signal** columns. The far right column of the table now uses a green check mark to indicate successful events.

## Local switch Configuration

In OV3600 8.0.0, an enhancement was added to the local switch configuration feature allows you to configure additional settings and perform a bulk edit on those switch settings during local configuration. Local configuration is disabled by default and can be enabled or disabled under **Groups > Basic**.

You can change the following variables using the bulk edit feature:

- VLAN ID
- Interface VLAN
  - ID
  - IP
  - Netmask
  - Secondary IP
  - Secondary Netmask
- Interface Loopback IP
- Interface - Group Gigabit Ethernet
- Site-to-site VPN
  - IKE shared secret,
  - IP Netmask
- Site-to-site (IPSEC Map)
  - Source Network Address
  - Source Netmask
  - Local FQDN ID
  - Peer Gateway IP Address
- DHCP Server (DHCP scopes)
  - Server Pool IP Address
  - Server Pool Mask
  - Default Router Address
- IP-Profile - Default Gateway

## Other Categories

- Starting in OV3600 8.0.6, a tooltip displays in the OV3600 UI when your mouse hovers over any cluster in the list and not just the selected cluster.

- Starting in OV3600 8.0.6, an in-progress status displays in the OV3600 UI anytime a change is being applied.
- Starting in OV3600 8.0.0 the **RAPIDS** Rules feature now includes a new Channel rule. The Channel rule allows you to search for devices and classify whether the devices are or are not on a specific channel. The specific channel to search for is set when configuring the rule. The rule is configured on the **RAPIDS > Rules** page.
- Starting in OV3600 8.0.0, the **Client Session Summary** box at the end of the **Client Session Report** page now includes information about total traffic in and out, average traffic in and out per session, and average traffic in and out per client. Traffic statistics are presented in MB.

## Supported Infrastructure Devices

OmniVista 3600 Air Manager provides a range of features to manage network infrastructure devices from Alcatel-Lucent and other vendors. This document describes the supported product families, software versions, and feature set for Alcatel-Lucent products. For a list of supported products from other vendors, see the *OmniVista 3600 Air Manager 8.0 Supported Infrastructure Devices* document, which can be found at <https://service.esd.alcatel-lucent.com>.

### Alcatel-Lucent AOS-W

OV3600 supports all switches and most access points that are running Alcatel-Lucent AOS-W 6.4.x and all prior versions, and that have not reached the End of Support milestone. The AP-80M series of access points is not supported by OV3600.

### FIPS

Alcatel-Lucent switches running AOS-W 6.0.x through 6.4.x FIPS and all prior versions that have not reached the End of Support milestone are supported by this version of OV3600, including the management of global configuration profiles and software upgrades.

### Instant

Alcatel-Lucent Instant access points running Instant software versions 6.4.3.x-4.2 and prior are also supported, including the management of configuration settings and software upgrades. The following table shows when each new version of Instant was initially supported in OV3600.

**Table 12:** *Instant Support in OV3600*

Instant Version	Support For Template Configuration	Support for IGC Configuration
Instant 4.2	OV3600 8.0.9	OV3600 8.0.9
Instant 4.1.1	OV3600 8.0.4	OV3600 8.0.4
Instant 4.1	OV3600 8.0	OV3600 8.0.4
Instant 4.0	OV3600 8.0 and OV3600 7.7.10	OV3600 7.7.8
Instant 3.4	OV3600 7.7.3	OV3600 7.7.8
Instant 3.3	OV3600 7.6.4	OV3600 7.7.8
Instant 3.2	OV3600 7.6.1	OV3600 7.7.5
Instant 3.1	OV3600 7.5.6	N/A
Instant 3.0	OV3600 7.5	N/A

## Aruba Mobility Access Switches

The Aruba series of Mobility Access Switches (S3500, S2500, and S1500) are supported for profile configuration, monitoring, and software upgrades.

In addition to the port statistics supported for most Ethernet switches with the supported firmware described below, OV3600 also tracks the activity of authenticated wired clients on Aruba switches.

**Table 13:** *Aruba MAS Supported Firmware and Devices*

Firmware Version	Switch Type
Validated up to 7.3.2.0 and 7.4.0.0	Standalone and stacked switches

## Fixed Issues

This table lists the fixed issues in OV3600 8.0.11.

**Table 14:** *Issues Fixed in OV3600 8.0.11*

ID	Description
DE21373	An issue is resolved where the daily RF Health report could only display a maximum count of 200 under the <b>MAC/PHY Errors</b> field for devices using either the 5 GHz or 2.4 GHz radios. The <b>MAC/PHY Errors</b> fields in this report have been replaced with the <b>MAC Errors (%)</b> and <b>PHY Errors (%)</b> fields. The <b>MAC Errors (%)</b> field represents the maximum percentage of MAC errors out of the total errors reported for a given period, and <b>PHY Errors (%)</b> represents the maximum percentage of PHY errors out of the total errors reported for a given period.
DE22284	Line breaks have been restored in email alerts from OV3600, allowing Microsoft Outlook to display the proper paragraph alignment in email alert messages.
DE23543 DE24065	An issue is resolved that prevented data from being populated in the graphs on the <b>APs/Devices &gt; Monitor &gt; Radio Statistics</b> page. Internal improvements ensure that the graphs are properly displaying data from a valid source.
DE23767	Users creating new time-based services using the <b>Groups &gt; Instant Config &gt; System &gt; Time Based Services</b> page no longer encounter a "Policy Change Failed" error message.
DE23788	The HTML link to the <b>Supported Infrastructure Devices</b> document on the <b>Home &gt; Documentation</b> page no longer sources content from a location that does not exist. This resolves an issue in OV3600 8.0.10, where clicking this link displayed output with missing content.
DE23803	The <b>Clients &gt; Client Details</b> page and <b>APs/Devices &gt; Monitoring</b> page now correctly display client data sent from switches running any version of Alcatel-Lucent AOS-W. This resolves an issue where OV3600 failed to correctly parse AMON messages from a switch running Alcatel-Lucent AOS-W 6.4.2.9.
DE24004	When the OV3600 server is upgraded to OV3600 8.0.10, the <b>Action</b> drop-down list under <b>Instant Config &gt; Security &gt; Roles</b> now displays the options for <b>Source-NAT</b> and <b>Destination-NAT</b> for all IAPs. Previously, the OV3600 server only displayed these options for IAPs with firmware versions lower than 6.4.3.4-4.2.1.0.
DE24042	An OV3600 server configured as a master console no longer reverts back to a regular AirWave server after the master console license expires. Starting with OV3600 8.0.11, when the master console license expires, the device enters a 90-day grace period. During this grace period users may continue using the master console and failover servers without any changes in functionality or visibility.
DE24385	The nightly VisualRF backup period has been extended to one hour, allowing the backup process to reach completion before timing out. The backup process previously timed out before all VisualRF sites could be incorporated, producing backup files with missing data.

**Table 14: Issues Fixed in OV3600 8.0.11 (Continued)**

ID	Description
DE24387	OV3600 now validates the IP address or FQDN of a primary or secondary Network Time Protocol (NTP) server configured on <b>OV3600 Setup &gt; Network &gt; Network Time (NTP)</b> , to ensure that the NTP is configured with valid network addresses.

This table lists the fixed issues in OV3600 8.0.10.1.

**Table 15: Issues Fixed in OV3600 8.0.10.1**

ID	Description
DE23915	An issue is resolved where an upgrade to OV3600 8.0.10 incorrectly triggered an error which stated that the GNU Transport Layer Security Library (GNUTls) package was already installed. Improvements to the internal upgrade processes resolve this issue in OV3600 8.0.10.1.
DE23810	Improvements in OV3600 8.0.10.1 refined the logic for internal checks for database table size. If you see the OV3600 error message " <i>Database tables need vacuuming before you can proceed with upgrade</i> " prior to an upgrade, contact support for further assistance.

This table lists the fixed issues in OV3600 8.0.10.

**Table 16: Issues Fixed in OV3600 8.0.10**

ID	Description
DE20082	Adding a single device from thousands on the <b>New Devices</b> list now takes less than one second.
DE20179	Mismatches are cleared for the IKE Server Certificate and CA Certificate when Site to Site IKE settings are being imported to OV3600.
DE21161	SHA Authentication Protocol and AES Privacy Protocol options can be selected for HP ProCurve switches under <b>Device Setup &gt; Communication</b> and <b>Device Setup &gt; Add</b> .
DE21215	Rogue device alerts are not triggered for devices outside of the folder configured in the trigger definition. This applies only to rogue devices that do not have a last discovery event in the database.
DE21720	Access to the <b>/api/ap_bssid_list.json</b> and <b>/api/ap_bssid_list.xml</b> API queries has been updated to allow read-only users or greater.
DE21750	The funnel mechanism used to classify rules under <b>RAPIDS &gt; List</b> has been updated to display all rule names consistently when the <b>Classifying Rule</b> is set to <b>All</b> .
DE21821	Polling enhancements have been enabled for thin AP clients and thin AP rogues on the MSM switch to prevent clients from being reported with unknown SSIDs when they are in a transition state and do not have a valid vsc_index. A check has also been added to the AMP server to verify whether a client has a valid vsc_index. Clients without a valid vsc_index are ignored by OV3600.
DE21972	The RAPIDS rogue signal calculation has been fixed to ensure all rogue signal strengths are calculated and classified correctly. High-threat rogues no longer display unusually low signal strengths, which previously caused OV3600 to classify these potential threats incorrectly and delete them from RAPIDS, where only the highest threats are retained.
DE22144	Upgrade triggers are now enforced in all IAP firmware upgrades. Each IAP is upgraded successfully, and no upgrade job is deleted when the IAP reboots. OV3600 no longer triggers the <b>Needs Firmware Upgrade</b> alert or restarts the upgrade process once the IAP has already been upgraded.
DE22163 DE22763	The <b>Channel Utilization</b> widget calculates and displays the correct max channel usage by storing tx_time and rx_time as percentages and determining the time at which tx_time + rx_time is the greatest. Max channel usage was previously calculated using greatest tx_time + greatest rx_time.

**Table 16: Issues Fixed in OV3600 8.0.10 (Continued)**

ID	Description
DE22259	A duplicate <b>vpn hold time</b> command has been removed from the IGC CLI command file. The IGC page no longer crashes or requires constant rebooting when IAPs are deployed in place of existing APs. The IGC page can now load successfully when an IAP configuration is pushed to the deployment.
DE22279	When the <b>Alcatel-Lucent Controller Role</b> is set to <b>root</b> from the <b>AMP Setup &gt; Roles</b> page, OV3600 is now directed to the VPN IP address of a virtual switch instead of the "real" IP address of the virtual switch when a user clicks on the VPN IP address hyperlink found on the switch's <b>Monitor</b> page
DE22319	Channel Utilization calculations have been fixed to ensure that both OV3600 and the IAP display the same data.
DE22340	When a global group template is modified on the primary AMP of the Master Console, the SSID display updates successfully, and the Master Console no longer crashes due to a timezone and HTTP timeout error.
DE22342	A new <b>change owner</b> command has been added to the following folders/files so the VisualRF file permissions no longer change when a user attempts to add a new floorplan to the VisualRF server, as this previously caused floorplan uploads to fail: <ul style="list-style-type: none"> <li>● The <b>/var/airwave/temp</b> folder</li> <li>● OV3600 VisualRF directories</li> <li>● <b>set_visualrf_file_perms</b></li> </ul>
DE22345	After a new virtual switch is created from an IAP factory reset, the AMP whitelist is re-imported to authorize and map dynamic AP variables to the new switch, which requires the dynamic variables for successful configuration.
DE22413	The <b>send_interferes_to_vrf</b> command is now enabled on the <b>seas_config</b> table, allowing VisualRF to receive information on interfering devices and display those devices on the VisualRF floorplans.
DE22419	Variables can now be referenced twice on a single line of the switch configuration template.
DE22466	The <b>New AP Monitor</b> page of the AMP server no longer displays an error message indicating that the "AP is not associated to Virtual switch" when a new AP is provisioned and successfully replaces an AP that goes down in a cluster.
DE22468	When an IAP is added to an AMP server and assigned the static OV3600 IP address through the IGC, the shared ams-key for the server can be configured on the IAP under the <b>Admin</b> tab of the <b>Groups &gt; Instant Config &gt; System</b> page. The IAP can now authenticate and connect to the AMP server using the shared key.
DE22474	The OV3600 server now discovers HP 560 APs under the correct device type.
DE22481	The IAP <b>CPU Utilization</b> graph no longer displays sudden, unwarranted drops in CPU usage, with the added support for IAP 4.2.1 in the IGC 4.2.0 UI. If an IAP client's IP address is 0.0.0.0, the radio mode must be set to the actual radio mode manually, as the reported radio mode may be incorrect and produce inaccurate data. The <b>batch command</b> and <b>run-command</b> APIs have also been updated with new parameters and improved security features.
DE22523	WMS offload messages are now sent to the PAPI daemon using RabbitMQ, preventing the airbus from stalling while sending large messages (1MB or larger).
DE22543	AP transmit power levels are now updated and synchronized automatically in the VisualRF without requiring users to execute the <b>poll_aps_now.xml</b> command. As long as the synchronization timer is set (2mins/5mins/15mins), VisualRF no longer fails to display the updated power levels periodically. The new <b>Refresh</b> button also allows users to view the most recently updated power levels.
DE22547	Load time for the <b>Client Monitoring</b> page has been improved.

**Table 16: Issues Fixed in OV3600 8.0.10 (Continued)**

ID	Description
DE22563	Cisco WLC 5760 switches that are configured successfully and respond to queries no longer appear as 'down' on the AMP server . The AMP server is also able to retrieve firmware information from the WLC switch through the <b>constants.pm</b> file without encountering the "error: fetching existing configuration" message.
DE22599	The RabbitMQ snoop for VisualRF no longer fails and displays an error message when a user executes the <b>rabbitmq_snoop</b> command to view the data sent to the VisualRF bus.
DE22600	The VisualRF channel overlay now displays the name of each AP instead of the AP ID, even if the APs are on different floors. APs that are in a planned state appear as <b>PlannedAp:&lt;last four digits of AP ID&gt;</b> since they do not have a name or MAC address.
DE22636	The <b>Instant Config &gt; OV3600 &gt; Config Archive</b> page now updates and displays the archived configuration properly when a user selects a specific archived config, such as <b>Show Delta</b> or <b>Show Audit</b> .
DE22664	After a configuration is pushed to an AP group, the server no longer deadlocks when the template changes are being saved and applied.
DE22671	Upstream device information is now available on the <b>IAP Monitoring</b> page.
DE22674	Users can now select and delete one or more firmware jobs from the WebUI without deleting every job posted on the page.
DE22729	Users are now able to push configurations to the Alcatel-Lucent S1500 and S2500 switches successfully without encountering mismatches in the configuration output.
DE22767	<p>The OV3600 <b>Groups</b> page and VisualRF now display the same AP and client counts through the following enhancements:</p> <ul style="list-style-type: none"> <li>● Updated RabbitMQ snoop message</li> <li>● Fixed <b>database flush</b> command</li> <li>● New debug message to debug client count issues</li> </ul>
DE22818	AP and client database tables no longer overload on data and cause the AMP server to slow down due to a database cleanup failure during the nightly maintenance.
DE22879	The IGC encryption option is now set correctly so it does not get disabled automatically after the IGC security configuration is saved under <b>IGC &gt; Networks &gt; Security</b> .
DE22892	The RF Health Report no longer causes out-of-memory issues due to the accumulation of data in stashed arrays, in which data is continuously pushed on top of itself until memory runs out. OV3600 now processes data in a stream-like fashion, removing data at the same rate that it is read. Speed has also been optimized in bottlenecks to help improve the flow of data.
DE22901	OV3600 performs a safe eval on individual rogue AP classifications to prevent the database cleanup from failing during the nightly maintenance.
DE23046	Whenever a <b>walls.xml</b> file is overwritten due to a clean shutdown or a wall retrieval error in the database, multiple backup copies of the file are saved in the system.
DE23193	When a new VM server is installed on an OV3600 deployment, to which IAP devices have successfully connected, the OV3600 IGC no longer executes duplicate <b>pppoe-username</b> and <b>pppoe-passwd</b> commands for adding and removing the PPPoE username and password under <b>pppoe-uplink-profile</b> . The virtual switch retrieves and displays the proper configuration parameters from the OAW-IAP under <b>System &gt; Uplink</b> and contains a VC configuration override link.

**Table 16: Issues Fixed in OV3600 8.0.10 (Continued)**

ID	Description
DE23273	When a device attempts to connect to a virtual switch, it is automatically added to an appropriate group, which contains a desired configuration that is pushed to all new devices joining the group. If auto-configuration is enabled for a virtual switch, the IGC compares the desired configuration, which is set in the IGC, with the actual IAP configuration to locate mismatches and deltas. The user can automatically or manually handle mismatches and push the delta configurations from the IGC to the OAW-IAP.  If auto-configuration is disabled for the virtual switch, mismatches and delta configurations can only be handled and pushed to the IAP manually.
DE23327	A <b>umask</b> is explicitly set at the start of the OV3600 installation process to ensure proper permissions are granted for installed AMP files, allowing OV3600 to install successfully on Redhat 6.7.
DE23330	The schema migration has been updated, and the <b>report cleanup</b> code has been removed so OV3600 no longer removes files from the <b>graphs</b> directory and produces empty <b>Network Usage</b> reports after upgrading the Master Console to OV3600 8.0.9.1.
DE23518	The Master Console's <b>Device Inventory</b> report has been fixed to display data even if the <b>Devices</b> widget or 'Include details about every device' option is not selected.
DE23532	Master Console reports are no longer exported for each managed OV3600 due to multiple FTP/SCPs. The Master Console now exports only one report when the option to export the MC report is set.

There are no new fixed issues in OV3600 8.0.9.1.

This table lists the fixed issues in OV3600 8.0.9.

**Table 17: Issues Fixed in OV3600 8.0.9**

ID	Description
DE18515	Rogue devices manually set as valid are no longer incorrectly reclassified as unclassified by OV3600. This improvement resolves an issue where different rogue devices with the same source IP address were treated as duplicate devices.
DE20233	Cloning a group in OV3600 no longer triggers an error which can cause the UI to stop responding.
DE20516	OV3600 correctly follows configured folder hierarchy restrictions for RADIUS client authentication failure alerts. This resolves an issue where RADIUS authentication alerts appeared in an incorrect folder.
DE20920	Using the <b>Master switch IP Address/DNS</b> field under the <b>Configuration &gt; Wireless &gt; AP Installation &gt; Provisioning</b> on the switch to provision an AP no longer causes a configuration mismatch.
DE21162 DE21777	Using the crop option on a .jpg or .png image in the HTML5 version of VisualRF no longer results in a stretched and zoomed image. The crop option now behaves correctly in Flash and HTML5 versions of VisualRF.
DE21470	Filtered data from Syslog messages or SNMP trap reports can now be successfully exported to a CSV file. OV3600 no longer exports the entire report when a filter is applied.
DE21494	The <b>RF Performance</b> tab now includes an IAP client health graph. This information was previously only available in the <b>Clients &gt; Diagnostics</b> page.
DE21683	RAPIDS now supports rogue device information in Alcatel-Lucent Instant deployments. AirWave can display information about wireless and wired rogues seen by Instant APs running Instant 4.2.
DE21694	An issue is resolved where a device misconfigured with incorrect SSH credentials could cause errors in the OV3600 authentication processes, delaying or preventing the configuration verification of other devices.
DE21698	In the IAP configuration template, custom variables for <b>wlan access-rule</b> and <b>wlan ssid-profile</b> settings that contain spaces are now successfully pushed to the virtual controller.



**Table 17: Issues Fixed in OV3600 8.0.9 (Continued)**

ID	Description
DE21723	OV3600 now correctly handles description information in user derivation rules sent to a switch. This resolves an issue where the inverted commas could be absent from the rule description in the command, causing the command to fail due to a syntax error.
DE21730	OV3600 now correctly generates disk usage alerts when disk usage for the OV3600 server has met or surpassed a defined threshold and the Alert Notification setting <b>Suppress Until acknowledged</b> is set to <b>No</b> .
DE21837	OV3600 allows you to correctly remove an old WLAN authentication server from the IGC after adding a new one. This resolved an issue where OV3600 could retain the old authentication server and attempt to push both to the IAPs.
DE21838	Beginning with OV3600 8.0.9, firmware distribution over HTTP is disabled by default. To enable this feature, navigate to <b>AMP Setup &gt; General &gt; Firmware Upgrade/Reboot Options</b> and select the <b>Yes</b> radio button for the <b>Enable firmware distribution via http</b> option.  This change impacts upgrades from Instant 4.0 and lower. Enable this feature before upgrading from Instant 4.0 or lower.
DE21856	Valid access points marked as neighbors, are no longer incorrectly classified as rogues after upgrading OV3600. The Wireline Alcatel-Lucent Instant Data discovery method for IAPs was removed to prevent this.
DE21861	A nightly maintenance failure due to "unsuccessful jobs: clean_database" has been resolved by moving the operation from the server's RAM to the disk.
DE21868	If the IGC receives only virtual controller configuration information from an IAP but no IAP information, it no longer removes the IAP from its database. The IGC now tries to retrieve the IAP information again when it gets incomplete information.
DE21880	An issue is resolved where adding or removing a URL in the <b>Security &gt; Custom Blocked Page URL</b> page of the IGC caused mismatches in the Instant devices using that configuration.
DE21962	When managing the IAPs with OV3600, the option to deauthenticate a client from OV3600 behaves as expected. This resolves an issue where the <b>Deauthenticate Client</b> option on the <b>Clients &gt; Client Detail</b> page appeared to be disabled.
DE21964	When an IAP's configuration is reverted, OV3600 now generates an entry in the event and AP logs. This change provides an alert for administrators in cases where a network error occurs while OV3600 pushes a configuration update to a virtual controller and the push is unsuccessful.
DE21999	The IGC no longer rejects IP addresses containing 255. The acceptable IP range is now 0.0.0.0 to 255.255.255.255.
DE22042	An issue is resolved where a failure in database migration upon upgrade caused the OV3600 UI to stop responding.
DE22059	The IGC correctly saves a configured DHCP Scope and accepts a DHCP Scope imported to OV3600 from an IAP. The error message "Policy Change Failed - cannot set no command on multi-allowed command-set, Comparer handles this" is no longer returned when saving a DHCP Scope in IGC.
DE22060	When an Instant AP creates a GRE tunnel to a switch, the VPN session appears as a user in the VPN sessions table, where the user is mapped to the folder ID of the Instant AP. An issue is resolved where the folder ID for this user would not update when the Instant AP was moved to another folder, preventing the network administrator from deleting the folder that previously contained the Instant AP.

**Table 17: Issues Fixed in OV3600 8.0.9 (Continued)**

ID	Description
DE22128	OV3600 displays more accurate AP metrics on the <b>APs/Devices &gt; Monitor &gt; Radio Statistics</b> page due to an improved handling of missing AP data from the switch. In previous releases, missing AP SSID values could cause OV3600 to return null values for the following AP metrics: <ul style="list-style-type: none"> <li>Radio Errors</li> <li>Radio Power</li> <li>Usage</li> <li>Clients</li> </ul>
DE22144	An issue is resolved where a reboot command sent to Instant APs that recently attempted a firmware upgrade caused some of those devices to attempt another firmware upgrade, greatly increasing the amount of time elapsed until those devices appeared in OV3600.
US13499	If the <b>Network Interface Vendor</b> field in the <b>Clients &gt;Client Details</b> page or the <b>By WLAN Vendor</b> graph on the <b>Clients &gt; Overview</b> page displays a large number of <b>unknown</b> vendors, this issue can be resolved by manually running a script to update the OV3600 OUI database. <ol style="list-style-type: none"> <li>1. Access the command-line interface of the AirWave server or appliance using a secure shell (SSH) connection.</li> <li>2. Log into the device as a root user.</li> <li>3. Issue the command <code>/usr/local/airwave/bin/update_client_vendor.pl</code> to run the embedded OUI update script.</li> </ol>

This table lists the fixed issues in OV3600 8.0.8.1

**Table 18: Issues Fixed in OV3600 8.0.8.1**

ID	Description
DE21669	The error message "Nightly maintenance failed because of unsuccessful jobs: clean_database" no longer appears on the OV3600 UI homepage when the OV3600 attempts to rebuild the AP Alcatel-Lucent Role table during nightly maintenance. This error only affected users that had deleted an Alcatel-Lucent AP.
DE21687	The error message "Nightly maintenance failed because of unsuccessful jobs: unknown" no longer appears on the OV3600 UI homepage while nightly maintenance is running. This message displayed because OV3600 attempted to parse the empty error file before maintenance was complete.
DE21707	Generating an RF Health Report using the folder options under <b>Reports &gt; Definitions &gt; Report Restrictions &gt; Summarize report by</b> no longer returns the error message "The server encountered an error while performing your request".
DE21715	Signal and Signal-to-Noise Ratio (SNR) values shown across different tables in the OV3600 UI, as well as neighbor client locations in VisualRF, are now correct. Starting in Alcatel-Lucent AOS-W 6.4.2.5, Alcatel-Lucent AOS-W changed the way it communicated Signal and SNR values. This caused incorrect Signal and SNR-related information to display in OV3600.

This table lists the fixed issues in OV3600 8.0.8

**Table 19: Issues Fixed in OV3600 8.0.8**

ID	Description
US13278	Tzdata on OV3600 was updated to tzdata-2015b-1 to account for the 2015 leap second.
DE17243	The <b>Target</b> column in the <b>VisualRF Audit</b> log now updates correctly when a building is deleted.

**Table 19: Issues Fixed in OV3600 8.0.8 (Continued)**

ID	Description
DE18839	OmniVista 3600 Air Manager no longer misclassifies a CPPM device type as an access point when a trigger is set up. The device type <b>ClearPass Policy Manager</b> was added as a trigger condition. The device type in the <b>Device Setup</b> page changed from <b>Aruba ClearPass Policy Manager</b> to <b>ClearPass Policy Manager</b> .
DE18679	In VisualRF, the x and y coordinates now adjust to the correct size when a client is moved within a floor plan boundary.
DE19572	The proper heatmap now generates correctly when a planned AP is moved.
DE19913	The <b>Device Setup &gt; Certificates</b> page now more quickly; the database query for the tables of certificates was optimized.
DE19947	The IAP now connects successfully to OV3600 when any port is changed.
DE20489	Heatmaps now display properly for the Cisco 3700I LWAPP when it is connected to a Cisco 5760 running at 5 GHZ.
DE20493	The OV3600 now correctly displays the SSID for Juniper and Trapeze APs on the <b>APs/Devices &gt; Monitor</b> page.
DE20770	The <b>Rogue Overview</b> and <b>Rogue &gt; List</b> pages now load properly for users. This transaction caused deadlocks in the database.
DE20894	The VisualRF <b>ListView</b> page no longer loads slowly. The page load performance time has been improved.
DE20895	Depending on the OAW-IAP configuration, more messages were received from the AP than required and this caused performance issues. VisualRF can now clobber the incoming messages. To clobber the messages, add <b>svg.clobber.aps=true</b> in the <b>/usr/local/airwave/lib/java/svg</b> property file.
DE20951	OV3600 no longer crashes unexpectedly due a memory fragmentation. Two non-GUI settings were added to control when ALC daemons terminate. By default the ALC now recycles after completing 60K payloads or after growing past 4G in memory.
DE20963	Local firmware versions are now listed in the <b>Group &gt; Group name &gt;Firmware</b> drop-down menu in the <b>Desired Version</b> pane.
DE21010	The VisualRF <b>Deployed Devices</b> pop-up displays APs without a delay. Previously, when navigating to a floor in VisualRF, clicking <b>Edit</b> and then <b>Add Deploy Devices</b> caused the pop-up to load quickly but it took several minutes to display all the APs.
DE21022	An extra slash in the XML file has been removed and no longer adversely affects the floor mapping.
DE21023	VisualRF now accepts negative integers as floor numbers.
DE21038	The OV3600 now passes the band value in XML. This allows the OV3600 to calculate the channel overlay in VisualRF more efficiently.
DE21065	All relevant commands are executed successfully when pushing an OV3600 template, which contains wired-port profiles, from OV3600 to the IAP.
DE21073	The OV3600 now considers the build numbers of Alcatel-Lucent AOS-W when upgrading a switch. This allows the OV3600 to accept a new build of the currently installed version of Alcatel-Lucent AOS-W as an upgrade.
DE21078	OV3600 no longer sequentially scans the aggregate session table for each dimension when running nightly maintenance. This change reduces the time required for OV3600 to complete clean_database.pl.
DE21082	The <b>Juniper ND Hostname/IP Address</b> field on <b>OV3600 Setup &gt; Third Party Integration</b> is now blank instead of displaying 0.0.0.0 after a fresh OV3600 installation or upgrade.

**Table 19: Issues Fixed in OV3600 8.0.8 (Continued)**

ID	Description
DE21098	The <b>split-tunnel</b> option now works properly when adding a centralized DHCP scope on the <b>Groups &gt; Instant config &gt; DHCP server</b> page.
DE21134 DE21119	When IAPs are added to an IGC group, the IAPs all sync properly now after the devices are upgraded to the group enforced firmware.
DE21121	This release of OV3600 introduces a security fix for CVE-2014-8159.
DE21131	Exporting AP run commands from the <b>IAP &gt; Monitor</b> page now runs without returning the <b>Request URI is too long</b> error.
DE21137	An IGC bootstrap error no longer incorrectly appears in igc.log when attempting to view the IGC GUI when the IGC is disabled.
DE21156	Editing and deleting of the Alcatel-Lucent controller time-range ACL profiles is now supported in OV3600.
DE21170	The IGC now generates the correct order of commands for the WLAN profile. The IGC now pushes the <b>auth-server</b> command before pushing the <b>auth- survivability</b> command.
DE21196	The IGC now sorts the commands <b>no wlan ssid-profile</b> and <b>no wlan access-rule</b> correctly when using the <b>del ssid profile</b> command to delete the SSID profile on the IGC Network page.
DE21213	VisualRF now supports the configuration of floor numbers with decimals up to one digit in HTML5.
DE21214	The OV3600 no longer attempts to push any system default ACLs, the RAP Whitelist, or user roles to Alcatel-Lucent switches. Since Alcatel-Lucent AOS-W 6.3, the Alcatel-Lucent switch has treated system default ACLs, the RAP Whitelist, and user roles as part of the global configuration. When OV3600 tried pushing those values to the switch, it resulted in an error and no other configuration changes were pushed. Additionally, <b>opcode</b> has been deleted from the policy rule <b>any any svc-kerberos redirect opcode 51 queue low position 1</b> since it does not exist on the switch. The policy rule now reads as <b>any any svc-kerberos redirect 51 queue low position 1</b>
DE21231	Executing the command <b>show ap monitor arp-cache</b> from the <b>IAP &gt; Monitor</b> page no longer returns an <b>AP Monitor ARP Cache</b> error.
DE21239	After Client Session reports are run, OV3600 now deletes unneeded temporary databases entries.
DE21244	This releases provides to the performance of the <b>Groups &gt; Lists</b> page.
DE21247	The MAC ID now displays on the <b>switch Monitoring</b> page for the Cisco 5760.
DE21252	The IGC configuration performance time has improved.
DE21256	When a planned AP is added and automatched to a deployed AP using MAC addresses, heatmaps correctly appear in VisualRF. When automatching, OV3600 now checks whether a radio configuration already exists for a particular ID and only attempts to add the new one after removing the old.
DE21261	The VisualRF audit log is now less verbose and easier to read. VisualRF server log events are now recorded in <b>/var/log/visualrf/visualrf_server_audit.log</b> and only user events are logged in <b>/var/log/visualrf/visualrf_audit.log</b> .
DE21298	Improvements to the performance of the <b>RAPIDS &gt; Overview</b> page were made.
DE21302	In VisualRF, the buttons <b>Delete Planned</b> and <b>Delete Deployed</b> and related warning pop-up text now include the word <b>all</b> . The buttons now say <b>Delete All Deployed Devices</b> and <b>Delete All Planned Devices</b> . Additionally, if a single AP is selected, the <b>Delete All</b> options are hidden and only the <b>Actions</b> sub-menu is visible.
DE21307	The <b>Apply All</b> button now works properly after adding a new route and saving the changes. Previously, this button was grayed out.

**Table 19: Issues Fixed in OV3600 8.0.8 (Continued)**

ID	Description
DE21309	The IGC configured <b>Network</b> page now displays properly. Previously the default configuration <b>Network</b> page displayed when trying to view a network configuration.
DE21311	Catalog errors preventing heatmaps from appearing for some APs in VisualRF are resolved.
DE21358	In the IGC, the LED display option in <b>General</b> tab now works properly.
DE21632	The internal <b>Captive Portal</b> page under <b>Instant Config</b> now works properly and can be edited.
DE21364	Changing the order of authentication servers on the <b>Security</b> tab now works properly on the IGC.
DE21376	Changing a wired profile on a network port now displays properly on the IGC.
DE21382	The average RRD values are now calculated correctly.
DE21386	In the IGC, enabling and disabling the <b>Security Firewall</b> setting options display correctly after saving and applying changes.
DE21388	On the AP List page, an IGC IAP's configuration state is now displayed accurately instead of only displayed <b>Verifying</b> after upgrading OV3600.
DE21399	Dragging APs when adding planned APs now works correctly in Firefox.
DE21457	When creating a DHCP Scope, the OV3600 automatically creates invalid DHCP Scope entry (CL2) with undefined type and VLAN. This entry can now be edited.
DE21462	IAP cluster SSIDs are now displayed correctly on the <b>Groups &gt; List</b> page.
DE21471	Clicking the magnifying glass icon in the <b>Add Deployed Devices</b> list now filters the list as expected.
DE21511	Users are now able to adjust the <b>Environment Factor</b> , by using the environment slider, when uploading a new floor plan. Additionally, similar capabilities are available through the <b>Region Properties</b> tab. Upon adding a planning region to a floor, users can click the properties tab and use the <b>Coverage Calculator</b> window to estimate the number of planned APs in a given region.
DE21520	OV3600 now sets the <b>HttpOnly</b> flag in cookies to safeguard against cross-site scripting attacks.
DE21561	The <b>AP Group</b> page time to load performance has improved.

This table lists the fixed issues in OV3600 8.0.7.1

**Table 20: Issues Fixed in OV3600 8.0.7.1**

ID	Description
DE21201	This release of OV3600 includes updated openssl packages to resolve the affected vulnerabilities described by Red Hat Security Advisory RHSA-2015:0715-1.

This table lists the fixed issues in OV3600 8.0.7

**Table 21: Issues Fixed in OV3600 8.0.7**

ID	Description
DE18310	The <b>config_verifier</b> log no longer displays incorrect warnings saying that device mismatch has occurred on the Audit tab.
DE18556	In VisualRF, the <b>View in Google Earth</b> link now works properly.
DE19018	An issue is resolved where OV3600 was not pushing rogue AP reclassification commands to an IAP

**Table 21: Issues Fixed in OV3600 8.0.7 (Continued)**

ID	Description
DE19822	The Instant configuration page now loads properly.
DE19841	In VisualRF, SVG files is now scale correctly when cropped thus allowing floor plans to be uploaded accurately.
DE19898	SSIDs in the Radio list now show what is being broadcast at that moment.
DE20139	VisualRF walls now appear in the proper place after upgrading from OV3600 7.7.11 to OV3600 8.0.4.1.
DE20152	APs listed from the switch Monitor page or the group/folder view, now show the down radio indicator. The AP list view also shows if the radio is enabled or disabled.
DE20164	An issue is resolved where floor plans in a .dwg format could not be uploaded using the Firefox web browser.
DE20239	The Device UP and DOWN alerts are no longer getting auto acknowledgments and now work properly.
DE20269	IAP no longer shows as being mismatched when there are no mismatches in the IGC.
DE20302	In VisualRF, the error message, "The file you are trying to upload might be corrupted. Please check the file and try again" inaccurately displayed. This no longer occurs.
DE20347	In Visual RF, a campus relationship can be dropped from a building when the strongest permission is set to admin and when the object has no parents.
DE20357	The Policy Version for Specific IAP Groups running the IGC now maps properly on Firefox.
DE20874	When updating the Syslocation setting for each virtual switch, the IGC no longer indicates the virtual switch as <b>down</b> in OV3600, even though it is up and running.
DE20895	VisualRF no longer times out and now works properly.
DE20903	A crash no longer occurs when logging into <b>amp_events</b> .
DE20922	Defining the stationary device in Visual RF HTML now works properly.
DE20424	Polling now works correctly for the Motorola RSF4000.
DE20949	List View transactions no longer slow down the OV3600 UI process. D
DE20479	This release of OV3600 introduces a security fix for CVE-2015-1390.
DE20489	Heatmaps are now correctly displayed in VisualRF for Cisco 3600 LWAPPs terminating on a Cisco 5760.
DE20536	This release of OV3600 introduces a security fix for CVE-2015-1391.
DE20537	Closed a cross-site scripting (XSS) GET request vulnerability.
DE20546	Captive Portal logos are now successfully pushed using the IGC.
DE20559	A configuration from a switch that gets its licenses from a centralized licensing server can be correctly imported into OV3600.
DE20571	AMP now reports AP uptime of APs connected to a Cisco 5760.
DE20587	The OV3600 UI no longer becomes unresponsive due to a database deadlock issue.
DE20596	When the IGC is enabled, clicking on the <b>Username</b> and <b>Password</b> fields on Configuration > Security > Users for Internal Server no longer returns and Invalid warning.
DE20626	A crash no longer occurs when navigating to the <b>Audit</b> page when you select a Alcatel-Lucent Controller or the <b>Manage</b> page for an AP.

**Table 21: Issues Fixed in OV3600 8.0.7 (Continued)**

ID	Description
DE20633	Floorplans are no longer incorrectly deleted when tasks for polling sites are removed.
DE20643	Alcatel-Lucent OAW-AP214 and OAW-AP215 Radio MAC addresses are populated from the AP device configuration.
DE20658	The following OUIs have been added to the OV3600 database: 10:08:B1 (HonHaiPr), 38:B1:DB (HonHaiPr), 34:E6:D7 (Dell), AC:87:A3 (Apple) 90:FD:61 (Apple), F4-4E-05 (Cisco), and FC-5B-39 (Cisco).
DE20715	Upper case letters are allowed in the URL field for configuring External Captive Portal in the IGC.
DE20770	To prevent the <b>RAPIDS &gt; Overview/List</b> Page from becoming inaccessible, OV3600 now deletes old discovery events for each discovery agent except the most recent.
DE20805	The links for <b>Rogues</b> and <b>Suspected Rogues</b> under the RAPIDS classifications list on the <b>RAPIDS &gt; Overview</b> page have been re-added. The <b>RAPIDS Classification</b> list, which is located on the <b>RAPIDS &gt; Overview</b> page, was not displaying the <b>Rogues</b> and <b>Suspected Rogues</b> links. These links now display properly.
DE20935	The IGC UI now displays the correct value for LDAP server and matches the value in the IAP UI.
DE20943	This release of OV3600 introduces a security fix for CVE-2015-2201.
DE21024	The User Inventory report now generates more quickly with improved performance.
DE21041	This release of OV3600 introduces a security fix for CVE-2015-2202.

This table lists the fixed issues in OV3600 8.0.6.3

**Table 22: Issues Fixed in OV3600 8.0.6.3**

ID	Description
DE20803	This release of OV3600 introduces a glibc security update (RHSA-2015:0092-1). See CVE-2015-0235 for more information.

This table lists the fixed issues in OV3600 8.0.6.2

**Table 23: Issues Fixed in OV3600 8.0.6.2**

ID	Description
DE20587	OV3600 UI access now works properly. Previously, access failed when OV3600 ran out of database connections.
DE20617	VisualRF no longer loses memory due to a leak in <b>AbstractTransactionAwareService</b> . The number of threads that a service can use is limited to 12.
DE20633	Floor plans now display properly in OmniVista 3600 Air Manager 8.0.x. A new separate file for auditing deleted items called <b>visualrf_audit_del.log</b> was added. This audit captures deleted campus, building, site ,and AP information.

This table lists the fixed issues in OV3600 8.0.6.1

**Table 24: Issues Fixed in OV3600 8.0.6.1**

ID	Description
DE20568	On VisualRF, the client and rogue location on the floor maps now works properly for all devices.

This table lists the fixed issues in OV3600 8.0.6

**Table 25:** *Fixed Issues in OV3600 8.0.6*

ID	Description
DE16753	In the IGC, the uplink priority list now works properly no longer generates an error index when eth1-4 were enabled .
DE18442	In VisualRF, the Edit tab removed all objects of different types. Now the Action menu has been deprecated with functionality was moved to the Dynamic Popup menu and the Action section.
DE18601	In VisualRF, all columns in the UI are properly aligned.
DE18917	In the IGC, Need seven minutes to change group basic's setting when group already has 2000 devices.
DE19124	In VisualRF, the client health model now automatically updates when a new client health value is added.
DE19197	DWF files are now uploaded correctly to VisualRF in the HTML5 mode.
DE19416	Newly added APs now display a heatmap properly on VisualRF.
DE19451	Console refresh issues regarding the list view have been fixed and now works properly.
DE19621	Stale PEF entries are now deleted from all pef_dim_tables during nightly maintenance.
DE19638	AP Audit issues that occurred when the IGC was enabled have been fixed.
DE19641	In the IGC 8.0, issues with the error log in async_logger_client have been fixed.
DE19690	The IGC external-captive-portal is now deleted if referenced by SSID.
DE19711	Monitor lock issues have been resolved and it now works properly in IAP when the IGC is enabled.
DE19712	In the IGC, Ethernet 0 now supports wired-instant profile.
DE19719	During Audit and Import, mismatch sequences no longer appear.
DE19744	Multi-byte username and SSID issues no longer cause AppRF to crash.
DE19745	The IAP IP address now updates correctly after it is changed in the IGC.
DE19746	The OV3600 server now cleans up the RRD files based on the historical retention setting properly.
DE19767	OV3600 now shows the IP of the APs associated to the Cisco WLC 5760 on the AP Monitor page.
DE19779	VisualRF performance improvements now prevent VisualRF from crashing during the startup inventory service check.
DE19812	Cluster AP name changes now work properly and appear in the IGC.
DE19821	In the IGC, the DHCP command now works properly.
DE19847	When a VC is deleted from the OV3600 cluster it no longer displays as being down.
DE19858	A new field in the <b>Group &gt; Basic</b> page was added that allows you to ignore the folder changes of the device. This is applies only for Aruba switches provisioned through Activate, DHCP or the switch CLI.
DE19859	The MAS ZTP VPN tunnel, changing the SNMP community in the Group configuration now works properly with no errors occurring in the syslog or traps.
DE19876	In the IGC, a new validation value for disallow role number has been added on the Service page.
DE19902	In the IGC the number of the users for an internal server now shows the correct value, and the Wi-Fi setting for uplink can now be deleted.



**Table 25: Fixed Issues in OV3600 8.0.6 (Continued)**

ID	Description
DE19903	In the IGC, all separate accounting server issues work properly for version Instant 4.1.1.
DE19904	The AMP whitelist Edit box IP list works properly now.
DE19905	In the IGC, the <b>no accounting-server</b> command now works properly when editing the account server option.
DE19906	In the IGC, when switching the accounting mode, the Apply button now works properly.
DE19907	In the IGC, when switching the accounting mode, the command <b>no accounting-server</b> now works properly.
DE19908	In the IGC, issues for separate accounting servers for version Instant 4.1.1 now perform correctly.
DE19909	In the IGC, the <b>Facebook</b> setting now works properly in the WLAN security page.
DE19912	In the IGC, the Wi-Fi setting on the <b>System &gt; Uplink</b> page now shows the correct value when you delete those uplink values.
DE19917	VisualRF performance works properly now.
DE19945	In the IGC, support is now available for a new channel for the 802.11ac radio.
DE19959	Viewing a certificate now works properly.
DE19960	The IAP no longer fails to log into OV3600 in cert mode.
DE19964	<p>The default values for the rf-arm-profile and HTSSID profiles have changed.</p> <p>In the ARM Profile, the default values for Client Match Load Balancing and Client Threshold is now 30 and Client Match Sticky Client Check SNR (dB) is 18 starting with AOS-W 6.3.1.7.</p> <p>In the HTSSID profile, the max number of MSDUs in an A-MSDU on Background AC, Max number of MSDUs in an A-MSDU on Best-effort AC, Max number of MSDUs in an A-MSDU on Video AC. All the three field defaults are now 2 instead of 3 in AOS-W 6.3.1.7 and later.</p>
DE19972	IAP now supports chained server certificate upload instead of single server certificate upload.
DE19973	In the IGC, the uplink priority list works properly and no longer generates an error index when Ethernet 1-4 were enabled for uplink.
DE19974	When guest security is selected, OV3600 now supports a Facebook secret command.
DE19979	The OV3600 UI now performs properly and no longer crashes after a reboot.
DE19983	In the IGC, all server drop-down lists now work properly.
DE19984	In the IGC, the <b>Uplink tab</b> on System and Settings page is now hidden if it is in Group mode.
DE19993	The VC no longer stays in a verifying state when a new IAP cannot be created.
DE19995	In VisualRF, auth in iconcontainer.find(id) is no longer commented out. AP Group/Folder drop-down lets read-write users add new APs to floorplans.
DE19998	Adding an AP to VisualRF no longer sets the Notes column value to null.
DE20011	Deleting all licenses and then re-adding them no longer creates duplicate daily or weekly report definitions.
DE20013	A license now saves unassigned user role information properly and no longer crashes.
DE20017	VisualRF works properly when floorplans are imported.

**Table 25: Fixed Issues in OV3600 8.0.6 (Continued)**

ID	Description
DE20025	The kernel security update (RHSA-2014:1392-2) has been applied.
DE20030	In VisualRF, heat maps are now updated when moving APs.
DE20032	The OV3600 UI now displays the proper OV3600 release.
DE20033	OV3600 now queries information from the <b>AP_detail.xml</b> file correctly.
DE20034	In the IGC, an issue is resolved where SSIDs could not be created if there were spaces in the SSID name, for example, "public - mobile".
DE20036	In the IGC, the second authentication server now performs properly when you create an SSID with a wireless or wired guest.
DE20044	In VisualRF, only the error code and message appear, and not the entire HTTP response, when the VisualRF backup fails.
DE20056	In the IGC, the message "Processing" appears on the cluster list when a VC is verifying or applying a configuration.
DE20057	In the IGC, the authentication server 1 no longer shows the selected value of authentication server 2 of the wired employee profile.
DE20070	The AMP Whitelist page now displays all information properly.
DE20071	The Duration column now shows the correct value on client lists.
DE20085	The Licenses table displays changed information more quickly now.
DE20103	The report definitions now load properly and efficiently after upgrading.
DE20105	In the IGC, the syslocation now performs properly regarding multi-edit.
DE20106	In the IGC, the VC and IAP monitor page now properly shows the note message.
DE20107	In the IGC, the VC status now works properly when a note message is modified.
DE20110	OV3600 charts now correctly display Chinese characters.
DE20115	This release of OV3600 includes a Wget security update for RHSA-2014:1764-1.
DE20117	After OVA deployment, OV3600 restarts daemons to prevent the OV3600 from becoming stuck.
DE20125	The IGC now correctly handles a change in Virtual Controller uplink. Re-adding the Virtual Controller after an uplink change is no longer required.
DE20127	When an Ethernet port network assignment is changed from one network to another, the deselected network is made available for use by other Ethernet ports and appears in the Network Assignments drop-down menu for each port.
DE20128	In the IGC, the configuration for enforce uplink value is correctly pushed to devices.
DE20129	The IGC is now able to successfully push commands from the uplink page.
DE20140	OV3600 now successfully pushes the <b>no accounting-server</b> command when a profile is edited.
DE20141	OV3600 pushes commands to the virtual controller in the correct order when editing the auth server configuration.
DE20143	When viewing the Internal User Number, the actual internal user value is now displayed.
DE20153	WCS files are now imported correctly into VisualRF using Safari, Firefox, or Chrome.

**Table 25: Fixed Issues in OV3600 8.0.6 (Continued)**

ID	Description
DE20158	Weekly reports no longer timeout during execution and no longer return empty Client and Usage graphs.
DE20165	The IGC now ignores any IAP Facebook commands since they may be different for each Virtual Controller and are not configurable.
DE20166	Deleting an access rule from the IGC no longer causes a mismatch.
DE20169	The IGC no longer allows the following characters to be used: % and &.
DE20171	After deleting all APs from OV3600, all APs can be re-added successfully. This resolves an issue where only a subset of detected APs were added.
DE20188	The Master Console Overview, Usage, and Clients graphs now only return data from the last complete update, preventing incomplete data being displayed.
DE20189	Quotation marks no longer erroneously appear around input text in the Internal Captive Portal configuration tab when the text is retrieved from the database.
DE20190	Editing an existing inbound firewall rule no longer causes the rule to appear on two lines.
DE20191	Changes made when editing an existing External Captive Portal are now saved correctly.
DE20192	A reboot log for resolve duplicate VC keys and per-ap-settings commands has been added.
DE20193	RADIUS Authentication configuration no longer incorrectly changes to Authentication Text after creating an External Captive Portal with RADIUS Authentication.
DE20194	The IGC now allows the change IP address retrieval method from manual to DHCP on the Access Point > General page and does not return any errors.
DE20197	Deleting the <b>Services &gt; Network</b> Integration configuration from the IGC no longer causes a mismatch.
DE20201	GlusterFS RPMs have been removed from OV3600.
DE20208	The <b>Discard Pending Changes</b> dialog no longer appears when moving from <b>System &gt; Admin</b> in the IGC when no changes were made.
DE20215	Information displayed by OV3600 is consistent with the information displayed on the Audit tab; OV3600 does not show a Virtual Controller mismatch when one does not actually exist. Additionally, a new indicator has been added that displays "Verifying" while OV3600 is waiting for Instant running config.
DE20217	Logged-in users are no longer able to see any file viewable by Apache.
DE20229	Improvements in OV3600's handling of state messages to prevent an internal server error in amp_ events.
DE20235	SSID bandwidth tracking for SSIDs with Chinese characters on IAPs no longer fails.
DE20244	New uplink priority items configured in the IGC now appear as expected.
DE20245	This release of OV3600 includes a kernel security update for RHSA-2014:1843-1.
DE20258	In the IGC, subnet addresses in ACL rules are now truncated according to netmask to prevent a mismatch for too long access rules.
DE20259	Editing an AppRF rule to add an option for Application Throttling and remove another rule now works as expected. It no longer deletes the old item without removing the new one.
DE20260	The value for the <b>set-role-machine-auth</b> , <b>set-role-mac-auth</b> , and <b>set-role-pre-auth</b> are no longer incorrectly set to False when they are already false.

**Table 25: Fixed Issues in OV3600 8.0.6 (Continued)**

ID	Description
DE20261	In the IGC, creating a WLAN profile with the WMM option configured no longer results in policy change failure.
DE20262	Deleting a WMM option from the <b>Networks &gt; General</b> page in the IGC no longer returns a Policy Change Failed error message.
DE20278	On the IGC system page, the value for the auto join option is now correctly reflects the configuration.
DE20280	The IGC now sends the correct commands for the Disable SSID on uplink failure option.
DE20281	In the IGC, the creation of centralized and local DHCP scopes now works as expected.
DE20282	The maximum length of an SSID name in the IGC increased to 32 from 31 to reflect the Instant software.
DE20291	Safe Migration of the failover OV3600 license has been enhanced to prevent license failure on the second make.
DE20295	Airtime and air radio options can now be saved in the WLAN profile in the IGC.
DE20296	SSID limits configured in the IGC are now correctly enforced.
DE20297	The IGC now accurately displays the Instant configuration and matches the corresponding Instant UI.
DE20298	LDAP servers no longer appear in the Authentication Server drop-down menu when termination is disabled.
DE20306	VisualRF performance has been improved by resolving a number of database issues causing campus and building floorplans to load slowly.
DE20313	The IGC no longer adds quotation marks around existing welcome text or policy text when opening the dialog to edit the text.
DE20316	The release introduces performance improvements of the new device page in the IGC.
DE20323	The IGC now correctly saves the values for access rule, for to particular server, except to a particular server, and to domain name instead of displaying 0.0.0.0.
DE20324	The IGC wired security page now supports the IAP Facebook commands.
DE20325	In the IGC, an error message is now displayed when more than one port is configured as an uplink-enable port.
DE20326	The maximum length of a hostname in the IGC increased to 32 from 31 to reflect the Alcatel-Lucent Instant software.
DE20334	The IGC wired network wizard page now blocks the creation of duplicate network names.
DE20335	In the IGC, when an internal server is selected as the auth server, authentication survivability is disabled and cannot be changed.
DE20336	The IGC uplink item priority index now performs as expected.
DE20343	The OV3600 now displays a configuration error when the IGC has a configuration error instead of displaying a mismatch.
DE20344	The config process error status reporting from OV3600 database has been improved to prevent inaccurate reporting of Virtual Controller status.
DE20345	Editing access rules in the IGC no longer returns an error when done correctly.
DE20359	When AP license limit is reached, OV3600 now displays an error messaging informing the user that no additional APs can be added.

**Table 25: Fixed Issues in OV3600 8.0.6 (Continued)**

ID	Description
DE20360	The restore option on the <b>Audit</b> page now works as expected and no longer requires the user to manually refresh the browser.
DE20367	On the <b>Network</b> page in the IGC, a validation has been added when deleting a wired or wireless profile to prevent a mismatch.
DE20369	Using multi-edit for syslocation in the IGC now allows spaces in the parameter string.
DE20370	In the IGC, the TACACS Accounting checkbox now appears a TACACS server is chosen as the auth server.
DE20371	The auth server can now be edited successfully from the <b>System &gt; Admin</b> page in the IGC.
DE20381	On the L3 Mobility tab in the IGC, the IP address will automatically update to match the subnet when the subnet is modified.
DE20382	The IGC now correctly pushes SNMPv3 configuration to devices
DE20386	Zero (0) can now be typed into the Port field in the SNMP Trap Receivers dialog box in the IGC.
DE20387	In the IGC, on the <b>WLAN General</b> page, the Disable SSID on uplink failure checkbox is now unchecked by default.
DE20390	After configuring and applying L2 DHCP server setting in the IGC, the <b>Option Type</b> configuration is saved correctly.
DE20391	In the IGC, the domain name is no longer saved as false when the Domain Name field is left empty on the <b>Access Point</b> page.
DE20392	The Centralized DHCP Scopes configuration dialog in the IGC now displays correctly in Mozilla Firefox.
DE20393	The DLNA Media and DLNA Print checkboxes on the <b>Service &gt; Airgroup</b> page in the IGC remain checked when changes are saved.
DE20394	The IGC now allows the use of spaces in non-Virtual Controller AP names.
DE20395	SNMPv3 Users are correctly deleted from the System-Monitor page in the IGC; they no longer exist after applying the changes to delete them.
DE20396	The IGC now requires at least eight characters in the password fields on SNMPv3 page from Instant 4.1.1.
DE20397	The <b>OK</b> button on the VPN Tunnel profile configuration page now works correctly.
DE20398	An 802.11ac new channel option at customize valid channel was added to the RF page in the IGC.
DE20399	The IAP configuration no longer disappears, resulting in an IGC mismatch when the Restore Default Value option is used on the RF Radio page.

This table lists the fixed issues in OV3600 8.0.5

**Table 26: Fixed Issues in OV3600 8.0.5**

ID	Description
DE16614	When the "Prefer AMON vs SNMP Polling" option is enabled, the number of clients reported in OV3600 now matches the number of clients that are reported on the switch.
DE16649	Unaudited stacked MAS member switches no longer appear on the <b>APs/Devices &gt; Mismatch</b> page.
DE18556	Viewing an outdoor AP location in Google Earth now works properly.
DE18915	The Modify Devices Apply All option now works with remote users.

**Table 26: Fixed Issues in OV3600 8.0.5 (Continued)**

ID	Description
DE18937	VisualRF no longer displays campuses and the location of APs in folders outside of the user's access level.
DE19072	The VisualRF > List page now appears properly and no longer displays the zoom bar.
DE19101	The VisualRF Campus view background can be set to None from a custom background image.
DE19299	OV3600 refreshes the FQDNs of APs when an entry is not available in the dns_result table periodically.
DE19444	Pagination now works for the bulk override feature. Accepted parameters include: <ul style="list-style-type: none"> <li>• start_row: this number is the first row of the table. Default is 0.</li> <li>• page_length: this number indicates how many records to send in API response.</li> <li>• has_next: this indicates if the table has more records in next page.</li> </ul>
DE19445	The OV3600 Audit page performance issues have been fixed.
DE19503	An HTTP response splitting vulnerability in the network management framework on the remote web server has been resolved.
DE19544	The headers in a CSV file from a connected client list are now in English.
DE19547	An Aruba S1500-24 Mobility Access Switch can be successfully upgraded and rebooted from OV3600.
DE19590	Down devices in the Monitor page no longer show the uptime.
DE19622	Setting a table's custom page length to something other than a number no longer causes OV3600 to crash.
DE19626	The <b>AppRF &gt; Destinations &gt; Summary</b> total destinations count now works properly. Previously the summary total displayed the page length number instead of the number of entries in the Destination list.
DE19652	An explanation now displays if a license is not verified during migration.
DE19667	The <b>Client Detail</b> page performance has been improve by optimizing the query for rogue client historical data.
DE19674	A name displays with a link to down devices with AP IDs.
DE19678	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:1167-1, which resolves vulnerabilities that could allow users to gain additional system privileges, , leak memory to the user space, or cause the system to stop responding.
DE19680	UCC calls now display on the Client Detail page.
DE19698	The Whitelist populates variables to virtual controller.
DE19704	An IAP can be verified and configured now as long as the firmware is upgraded successfully.
DE19705	To improve the loading time of the AppRF tab, missing indicies have been restored to the start and stop columns on aggregate.
DE19706	JSON encoding has been enhanced to prevent AMON data loss and Papi/AMON graph spikes.
DE19707	The error messages displayed on the licensing tab now accurately reflect the error instead of displaying inaccurate information.
DE19718	Show commands can now be executed when logged in with view-only credentials.
DE19721	A timeout was added back to the last_process mmap to help prevent the UI from becoming inaccessible.
DE19722	IAP cert auth performance has been improved.

**Table 26: Fixed Issues in OV3600 8.0.5 (Continued)**

ID	Description
DE19730	The IGC displays the slave IAP IP address on the access point page.
DE19737	The VisualRF backup script no longer stops the current running VisualRF process.
DE19740	The visualrf_backup.pl no longer fails.
DE19742	OV3600 no longer inverts the Radio Mode for 2.4 GHz and 5.0 GHz. The correct information is displayed for the appropriate radio.
DE19743 DE19138	The HTML5 UI now matches the Flash UI in older versions of OV3600 and correctly draws holes or gaps in the wireless coverage for heatmaps.
DE19749	Acknowledge and Delete buttons are no longer displayed on the alert lists for read-only users.
DE19752	The character length for airwave-ip and airwave-backup-ip is changed from 15 to 127 to allow for domain name, IP, and port.
DE19754	OS details are now accurately displayed for iPhone 6 devices.
DE19757	Role assignment rules can now be reordered in the IGC.
DE19762	Template versions can now be updated when unsupported commands are shown.
DE19781	This version of OV3600 includes a fix for the Bash Code Injection Vulnerability via specially crafted environment variables, which was announced publicly on September 24, 2014. See CVE-2014-6271 and CVE-2014-7169 for more information.
DE19782	The attenuation grid is recalculated when the transmit power for planned APs is changed by the user.
DE19799	The report process for IAP devices has been made more robust.
DE19800	The config push result has been added to the IGC log file.
DE19813	The <b>Discard Pending Changes</b> pop-up message no longer appears when navigating away from <b>Network &gt; Security</b> if no changes are made.
DE19820	On the DHCP server page, the domain name in the dialog is limited to 64 characters and in panel is limited to 32 characters.
DE19824	This OV3600 release includes a fix for the Authenticated Privilege Escalation Vulnerability. See CVE-2014-8368 for more information.
DE19842	Client list views and client search have been optimized to reduce the loading time of client data.
DE19878	VisualRF now works properly during startup, visualrf_bootstrap file deletion is not required.
DE19884	Abbreviations for standard protocols are now used in AppRF in regards to Instant devices.
DE19885	In the IGC <b>System &gt; Admin</b> page, the cursor no longer jumps to the <b>Password</b> field when characters are entered in the Username field.
DE19897	OV3600 now correctly interprets 2.4 GHz and 5.0 GHz IAP radio information, preventing VisualRF from displaying a wrong heatmap.
DE19922	Auditing is still performed if OV3600 has the correct credentials to perform an audit but the <b>encrypt disable</b> command fails.
DE19931	This release of OV3600 eliminates exposure to the POODLE SSL vulnerability. See CVE-2014-3566 for more information.
DE19940	This release of OV3600 closes two OpenSSL vulnerabilities, an SRTP Memory Leak and a Session Ticket Memory Leak. See CVE-2014-3513 and CVE-2014-3567 for more information.
DE19965	This version of OV3600 includes an update to a Critical Java Security update (RHSA-2014:1657-01).

This table lists the fixed issues in OV3600 8.0.4.1

**Table 27:** *Fixed Issues in OV3600 8.0.4.1*

ID	Description
DE19781	This version of OV3600 includes a fix for the Bash Code Injection Vulnerability via specially crafted environment variables, which was announced publicly on September 24, 2014. See CVE-2014-6271 and CVE-2014-7169 for more information.

The table below lists fixed issues in OV3600 8.0.4.

**Table 28:** *Issues Fixed in OV3600 8.0.4*

ID	Description
DE18124	An update to RPM Security (RHSA-2012:0451-3) has been added.
DE18292	Modifications made to the default profile of the Gigabit Ethernet Group are saved and pushed to devices as expected; OV3600 no longer returns the error <b>Invalid slot(ALL) for Interfaces.</b>
DE18502	Read-only users can now use location history.
DE18888	OV3600 can push passwords with special characters in the management user and enable passwords.
DE19049	Creating and saving a custom report using the config detail widget, while not editing the email settings, no longer returns the error <b>Cannot email configuration audit widget in CSV format."</b>
DE19054	Devices can now be filtered based on a single SSID and the output will contain all devices that are transmitting the selected SSID. This includes those devices that are transmitting multiple SSIDs.
DE19059	When creating multiple profiles in OV3600 in the Group Config UI, the newly created profiles are not incorrectly deleted if an error occurs when saving and applying the profiles.
DE19066	When you select a Mobility Access Switch from the <b>APs/Devices &gt; List</b> page, the <b>Switch Role</b> column now displays the switch's actual role (Primary, Secondary, etc.) instead of an integer value.
DE19068	OV3600 no longer uses the same defaults for switches and controllers, which prevents a mismatch for <b>Download Role from Clearpass</b> under the AAA profile.
DE19091	When a new interface is created in AMP, such as Interface Gigabitethernet 0/0/2, fields that use default named profiles are pre-populated by default.
DE19118	The <b>Overview &gt; License</b> page now displays the correct technical support email address.
DE19189	List views stay on the same page and retain all configured filters after a console refresh.
DE19191	Rogue client reports are generated and can be viewed properly.
DE19198	The AMP no longer returns the <b>Invalid XML data</b> error message when running a Network Wide Usage and Network Client Session error reports.
DE19221	A new menu for configuring <b>Site-to-Site IKE</b> on the controller has been added under <b>Advanced Services &gt; VPN Services &gt; IKE &gt; Site to Site IKE.</b>
DE19234	Configuring WPA-2 Personal key management on a new network no longer returns the error message <b>wrong value: wpa-psk-tkip,wpa-psk-aes.</b>
DE19244	An error message displays if "Prefer AMON to SNMP" is enabled and the audit is disabled or there are no credentials for the CLI.



**Table 28: Issues Fixed in OV3600 8.0.4 (Continued)**

ID	Description
DE19253	Attempting to simultaneously edit and delete separate items on the Manual Blacklisting page and then applying those changes no longer returns an error message and incomplete changes.
DE19269	If an SSH user attempts to use the <b>encrypt disable</b> command and does not have permission, the configuration fails and an error message displays.
DE19270	On the <b>Instant Config</b> page, the VC <b>Name</b> and <b>Organization</b> fields now support spaces in the name.
DE19290	On the IGC, the <b>Auth server 1</b> and <b>Auth server 2</b> fields under <b>Admin</b> now work properly.
DE19305	The IGC no longer generates a mismatch message when the Host IP is deleted from the manual GRE.
DE19371	On the OV3600 8.0.4 Instant <b>Config &gt; Access Points</b> page, users can set the AP radio modes separately.
DE19375	OV3600 no longer pushes existing port channels while it is creating new channels.
DE19383	The loading icon now appears when a floor plan is opened in any view.
DE19395	The channel utilization overlay now loads properly in OV3600 8.0.4.
DE19396	AppRF supports up to a maximum of 39K clients.
DE19415	Adding new devices to a group in IE 9 now works properly.
DE19440	Deleting a VC from a group and then re-adding it to the same group no longer causes the VC to be duplicated.
DE19460	Configuring ports when creating Access Rules using the IGC now works properly.
DE19468	When using VisualRF in Mozilla Firefox, devices do not stick to the cursor when moving them around the floor plan.
DE19475	Both OV3600 8.0.4 and Instant produce the same report regarding detection of rogues.
DE19476	AMON process performance improvements were made to reduce the chances of a backlog in handling AMON messages and provide a more up-to-date view of the network.
DE19477	The IGC System Location field now works in Instant 4.1 and greater.
DE19502	The single poller now starts and works properly.
DE19532	Dragging VisualRF icons now works properly.
DE19633	Sorting by the Radio Antenna on AP lists now works properly.

The table below lists issues fixed in OV3600 8.0.3.1

**Table 29: Issues Fixed in OV3600 8.0.3.1**

ID	Description
DE19149	An additional internal issue was fixed in OV3600 8.0.3.1 so that VisualRF is now using the proper amount of CPU.
DE19295	A VisualRF performance issue that was caused by an architectural change has been fixed. VisualRF performance now works properly.

**Table 29: Issues Fixed in OV3600 8.0.3.1 (Continued)**

ID	Description
DE19395	VisualRF now loads properly when the Channel Utilization overlay is applied to a floor plan.
DE19423	<p>The clean_database.pl maintenance script did not execute for users running 8.0.3. This problem has been resolved with OV3600 8.0.3.1. Users upgrading from 8.0.3 to this release may experience a longer than usual clean_database.pl run time initially to make up for it not being run since upgrading to 8.0.3.</p> <p>Users running OmniVista 3600 Air Manager 8.0.3 who do not want to upgrade to OV3600 8.0.3.1 can run this command to fix the issue:  <b>mv /usr/local/airwave/bin/clean_database /usr/local/airwave/bin/clean_database.pl</b></p>
DE19475	The issue, where only a reported classification of valid from a device is allowed to demote the threat level, has been fixed.

The table below lists issues fixed in OV3600 8.0.3.

**Table 30: Issues Fixed in OV3600 8.0.3**

ID	Description
DE18908	Floor Upload Wizard changes are now saved correctly after clicking <b>Finish</b> .
DE19141	VisualRF is no longer using too much CPU. Previously it was using over 40% CPU.
DE19149	The Floor plan page is no longer timing out after upgrading the server to OmniVista 3600 Air Manager 8.x.
DE19320	The loading speed of floors in the Flash UI has been improved.
DE19358	The loading speed of densely-populated floor plans has been improved.

The table below lists issues fixed in OV3600 8.0.2.

**Table 31: Issues Fixed in OV3600 8.0.2**

ID	Description
DE17161	OV3600 includes includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0917-1, which resolves vulnerabilities that could allow users to return unencrypted information to the server.
DE18122	OV3600 includes ca-certificates security update (RHSA-2013:1866-3).
DE18533	The Uptime report, which was not 100% for IAPs, has been resolved.
DE18753 DE17510	When sorting AppRF data by MAC address, the <b>Home &gt; AppRF &gt; MAC address</b> window filters out entries that do not have MAC address data.
DE18449	HTTPD has been updated to resolve <a href="https://rh.redhat.com/errata/RHSA-2014-0370.html">https://rh.redhat.com/errata/RHSA-2014-0370.html</a>
DE18609	In VisualRF, an issue is resolved where changing the <b>band</b> setting for channel bands displayed by the VisualRF overlay triggered an error that could cause the VisualRF UI to stop responding and display an "Unresponsive script" error.
DE18680	In previous versions of OV3600, a file locking error could lead to concurrency issues with OV3600 tools interacting with data stored in the OV3600 database. This issue is resolved in OV3600 8.0.2.

**Table 31: Issues Fixed in OV3600 8.0.2 (Continued)**

ID	Description
DE18694	The number of items viewable on a list is changeable and maximum value is capped at 2000. <b>NOTE:</b> The user info list settings only apply to the first time viewing the list. If the setting was ever changed manually, then changing user info setting will not have any effect.
DE18733	A lock option has been added to the VisualRF floor plan to prevent accidental changes to the location of campuses, buildings, APs, etc.
DE18745	When VisualRF requests information from the OV3600, it logs in with a randomly generated username and password. An improvement in OV3600 8.0.2 prevents unnecessary external authentication requests for these internally generated usernames and passwords.
DE18718	802.11 ac is now bucketed by channel width (20/40/80/160). This appears corrected on the RF Performance page and lists.
DE18792	This change corrects a VRRP shutdown processing issue. Additionally, <b>ip access-group &lt;name&gt; session</b> is correctly understood in <b>interface vlan</b> .
DE18853 DE17510	When sorting AppRF data by MAC Address, data that does not include the MAC address is not returned.
DE18860	When list view refreshed per the console refresh rate, the list view stays on the current page and retains all filters.
DE18904	The <b>Restore Backup</b> function no longer fails between OV3600 and the switch.
DE18913	On the Rapids setup page, a warning message appears anytime a user enables containment.
DE18954	When selecting Show Label in Channel in VisualRF, the full ap name and 802.11 channels are displayed.
DE18968 DE18784	The change helps prevent a database lock contention between multiple processes
DE18985	The maximum viewable columns in list view is 20. Once you reach 20, the available options go grey and you cannot slide over any other column options.
DE18994	Exported CSV files no longer displays device uptime in epoch format. Uptime is now displayed as days, hours, minutes.
DE18997	LV pagination options are now available for 25,50,100,250,500, and Custom.
DE19143	OV3600 includes includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0924-1, which resolves vulnerabilities that could allow users to gain additional system privileges, or cause the system to stop responding.
DE19149	In VisualRF, the floor plan data is now working properly and is no longer timing out.
DE19174	Recent IAP template changes, including several Instant and IAP changes, are now available in OV3600 8.0.

The table below lists issues fixed in OV3600 8.0.1.

**Table 32: Issues Fixed in OV3600 8.0.1**

ID	Description
DE15596	If you override the <b>Routed Virtual Interface</b> value an Aruba switch inherits from its group profile, and then move that device to another group, the routed virtual interface count in the <b>AP/Devices &gt; Manage</b> page increases correctly.
DE15994	Action icons in the UI display tooltips when you mouse over those icons.
DE17274	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0475-1, which resolves vulnerabilities that could allow users to gain additional system privileges, or cause the system to stop responding.
DE17619	The VPN session client graphs displayed on the Clients VPN Sessions page correctly show <b>Usage</b> as the default Y-axis value. Previously, this value was undefined until the <b>Usage</b> value was selected.
DE17642	In VisualRF, clicking on a campus or building link in the List view correctly displays the campus or building Map view, regardless of the browser used to access the OV3600 UI.
DE17987	The <b>Clients &gt; Diagnostic</b> page for a wired client no longer displays data fields applicable to wireless clients only.
DE18117	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0126-1, which resolves vulnerabilities that could allow a remote attacker to crash an OpenLDAP server.
DE18118	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2013:1409-1, which resolves extended Internet daemon (xinetd) package vulnerabilities that could allow users to gain additional system privileges.
DE18125	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0043-1, which resolves vulnerabilities in the way Berkeley Internet Name Domain (BIND) handles queries for NSEC3-signed zones,
DE18169	If you edit a Routed Virtual Interface profile to define an IP Netmask for multiple devices, the confirmation page now correctly shows the IP Netmask value is associated with the <b>IP Netmask</b> field. In previous releases, the confirmation page incorrectly showed the netmask value associated with the <b>IP Address</b> field, even though the netmask value was correctly defined in the profile.
DE18182	When the <b>Use Global Alcatel-Lucent Configuration</b> setting is enabled in the <b>OV3600 Setup &gt; General</b> page, changes to a Gigabit Ethernet interface port on the <b>Device setup &gt; Alcatel-Lucent Configuration &gt; Local Config Network &gt; Ports/interfaces</b> page can now restrict the Gigabit Ethernet interface port setting to devices within a selected group or set of groups.
DE18371	VisualRF correctly displays properties for APs with disabled radios. In previous versions of OV3600, an AP with a disabled radio incorrectly appeared as an AP with an error in VisualRF.
DE18378	Association or neighbor lines in an HTML5 VisualRF floor plan correctly display settings for the connection PHY band (5 Ghz and/or 2.4 GHz).
DE18405	VisualRF floor plans correctly show distances in metric units (rather than US [imperial] units), when the <b>Use Metric Units</b> setting is selected in the <b>VisualRF &gt; Setup</b> page.
DE18410	By default, VisualRF allocates 2,500 grid cells to each floor plan, and calculates grid cell size by dividing the square footage of the floor plan by 2,500. The grid cell size shown in the floor plan lists on the <b>VisualRF &gt; Floor Plans</b> page now limits the cell size value to two decimal places. (for example, 1.85 ft.)

**Table 32: Issues Fixed in OV3600 8.0.1 (Continued)**

ID	Description
DE18413	Users logging in to OV3600 with read-only credentials are able to change the size of VisualRF icons.
DE18419	A user logging in to OV3600 with read-only credentials is no longer incorrectly logged out of OV3600 when the user selects and drags a region point on a VisualRF floor plan.
DE18422	VisualRF correctly prevents users from drawing walls outside the floorplan background when editing a floor plan.
DE18437	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014-0513, which resolves a libxml2 vulnerability that could allow a remote attacker to launch a Denial of Service (DoS) attack on the system.
DE18489	An issue has been resolved where resizing a VisualRF floorplan before adding planned APs prevented the floor from loading correctly.
DE18490	An issue is resolved where settings from an Instant Virtual Controller were not imported correctly, triggering a configuration mismatch error. OV3600 now correctly stores the VLAN ID, netmask and gateway for a Virtual Controller.
DE18522	The 802.11g Radio profile now appears in the list of switch profile settings that can be managed using the Alcatel-Lucent switch override list in the <b>APs/Devices &gt; Manage Page</b> .
DE18538	In VisualRF, the grid size for an AutoCad floorplan can be configured correctly using either the flash UI or the default HTML5 UI, and the size of the floorplan no longer limits the available grid size settings.
DE18551	Importing a configuration from a OAW-4550/4650/4750 Series Switch switch caused the OV3600 UI to stop responding. This issue is resolved by changes that allow OV3600 to ignore an unrecognized configuration setting imported from a switch running a newer version of AOS-W not yet unsupported by that version of OV3600.
DE18558	The information on the <b>Home &gt; UCC</b> page correctly refreshes with the frequency defined in the <b>Console Refresh Rate</b> field in the <b>Home &gt; User</b> page.
DE18578	When OV3600 is installed on a virtual machine, the OV3600 monitoring process recognizes the correct number of CPU cores allocated in the VM. Previously, the monitoring process on an OV3600 installed on a VM did not get updated with this information, and would use the number of cores configured in the <b>OV3600 Setup &gt; General &gt; Performance</b> page.
DE18582	An issue is resolved where importing a configuration from a master switch with a local switch did not correctly add the local switch's IPsec keys.
DE18588	OV3600 includes security fixes for OpenSSL Security Advisory CVE-2014-0224, which resolved vulnerabilities for a Man-in-the-middle (MITM) attacks that could allow an attacker to decrypt and modify traffic from the attacked client and server.
DE18594	An issue is resolved where the OV3600 UI would stop responding because longer data retention periods caused the cached data to reach the maximum cache size of 4 Gb. There is no longer a defined limitation on the cache size, which is now limited only by the size of the OV3600 server.
DE18619	The device uptime reported in the <b>Device Info</b> section of the <b>APs/Devices &gt; Monitor</b> page displays accurate uptime values.
DE18621	The VisualRF List View correctly refreshes the information on that page with the frequency defined in the <b>Console Refresh Rate</b> field in the <b>Home &gt; User</b> page.
DE18628	OV3600 can import planned APs using the Ekahau format into VisualRF floor plans.

**Table 32: Issues Fixed in OV3600 8.0.1 (Continued)**

ID	Description
DE18650	The Instant GUI Configuration (IGC) feature now supports configuration of the OV3600 AMS-IP, AMS-backup-IP and Organization settings.
DE18675	An issue is resolved where rogue APs did not correctly appear in Visual RF floor plans.
DE18710	OV3600 includes security fixes for Red Hat Enterprise Security Advisory RHSA-2014:0771-1, which resolves vulnerabilities that could allow local users to gain additional system privileges, or cause the system to stop responding and display an unresponsive script warning.

The table below lists issues fixed in OV3600 8.0.0.

**Table 33: Issues Fixed in OV3600 8.0.0**

ID	Description
DE15403	The default view for user graphs is now the <i>maximum</i> user count. In previous releases, user count graphs showed the <i>average</i> user count by default.
DE15629	The <b>client diagnostics</b> page no longer displays an unnecessary blue area in the <b>match events</b> popup window.
DE16457	Time stamps on for traps on the <b>System &gt; Syslog &amp; Traps</b> page correctly coincide with the time stamp value on SNMP trap messages.
DE17077	The <b>SNMP Source</b> column that appears in the <b>Client</b> lists has been renamed to <b>Source</b> , as this column can now show information for the following source types: <ul style="list-style-type: none"> <li>• SNMP Poll</li> <li>• SNMP Trap</li> <li>• AMON</li> <li>• HTTPS</li> </ul>
DE17731	The <b>User</b> column in the in the <b>Home &gt; AppRF &gt; Users</b> table correctly resizes to display the entire <b>User</b> name. In previous releases, longer user names could be truncated.
DE17839	Open menus close correctly when a user scrolls up and down a page in the OV3600 UI using a mouse scroll wheel.
DE17939	The AppRF graphs <b>Trend for Top 3 Destinations</b> and <b>Trend for Top 3 Applications</b> correctly show data for the selected time period, without any unexpected data gaps.
DE18022	The Interface Gigabit Ethernet profile and Port Channel profiles used for Alcatel-Lucent device configuration includes fields for configuring a session ACL and a session VLAN ACL.
DE18078	Changes to client diagnostic page thresholds are saved as expected.
DE18133	The VisualRF <b>Auto-match Planned Devices</b> feature correctly displays the total number of floors for the view of all campuses.
DE18171	OV3600 has an internal whitelist that allows administrators to use the UI to view the log files on the <b>System&gt;Status</b> page. If a user attempts to access a file not on this list through the UI, OV3600 displays an 'Access Denied' error message.
DE18178	An issue is resolved that prevented a VLAN without a description or AAA profile from being correctly pushed to a switch and created on the device.
DE18185	If you use the switch UI to assign an IP address to a VLAN, and then delete that VLAN from the <b>Device Setup &gt; Alcatel-Lucent Configuration &gt; Local Config &gt; Network &gt; VLANS &gt; VLAN</b> page of the OV3600 UI, OV3600 correctly deletes the IP address for the VLAN before it deletes the VLAN itself. In previous versions, the VLAN was deleted <i>before</i> its IP address, triggering a configuration mismatch error.

**Table 33: Issues Fixed in OV3600 8.0.0 (Continued)**

ID	Description
DE18188	The DHCP Option 82 setting configurable in the <b>Device Setup &gt; Alcatel-Lucent Configuration &gt; Local Config&gt;Network&gt;IP</b> page of the OV3600 UI is correctly applied to the switch configuration.
DE18275	Resizing campus icons on the <b>VisualRF&gt;Network</b> map no longer causes the campus icons to move to an incorrect location on the map.
DE18287	Instant template configurations created and edited in OV3600 support WPA2 passwords with an apostrophe (') or other special characters.
DE18367 DE18372	When you configure a report definition to allow that report to be exported via FTP or SCP, the <b>Reports &gt;Definitions</b> page displays a warning if the FTP or SCP settings are invalid.
DE18424	You can use VisualRF to create and export a bill of materials for a campus, building or floor by right-clicking on the icon for that location, and selecting <b>Bill of Materials</b> . Earlier versions of OV3600 could incorrectly display an error message when a user attempted to create a bill of materials using the right-click menu.
DE18433	VisualRF allows you to drag-and-drop an AP onto a floor plan using the Internet Explorer 11 browser.
DE18487	VisualRF supports .svg files as floor plan background images.

## Known Issues

The table below lists known issues in OV3600 8.0.11.

**Table 34: Known Issues in OV3600 8.0.11**

ID	Description
DE19307	The <b>Home &gt; UCC</b> page did not correctly display call quality, device trend, call volume and call quality data for a group of over 9,100,000 calls generated by a UCC simulation script. The httpd log file displayed an out of memory error for the event.
DE21611	OV3600 may fail to send large report messages via email if the report is longer than 1000 lines. These longer reports may also not display correctly in the <b>Reports &gt; Details</b> page of the OV3600 WebUI.
DE21674	An MDM server configured using <b>OV3600 Setup &gt; MDM Server</b> cannot be accessed using the <b>View Device in SOTI MobiControl</b> link on the <b>Clients &gt; Client Details</b> page if the device is managed using SOTI version 9.0 or higher.
DE22214	Adding or deleting a group using the <b>Group &gt; List</b> page does not trigger an entry in the event log files. When a group name is changed, however, the name change does trigger a log entry which shows the name of the user that updated the group.
DE23283	The <b>Clients</b> and <b>Usage</b> graphs on the <b>APs/Device &gt; Monitor</b> page may show some inconsistencies in the total numbers of clients and traffic for an IAP cluster with a VPN tunnel, if the virtual controller is itself a VPN client. This is because the "total clients" value displayed in the in the <b>Clients</b> graph does not include VPN clients, which appear as a separate "total VPN clients" value.
DE23419	When you use the Instant GUI Config (IGC) wizard on the <b>Groups &gt; Instant Config</b> page to create a new wired network, the <b>New Rule</b> portion of the Access configuration steps allow you to select the <b>Disable Scanning</b> option, even though that setting applies to wireless networks only, not wired networks.

There are no new known issues in OV3600 8.0.10.1.

The table below lists known issues in OV3600 8.0.10.

**Table 35:** *Known Issues in OV3600 8.0.10*

ID	Description
DE23716	<p>IGC migration removes a virtual controller's override settings after the IAP's firmware is upgraded and then migrating the IGC to the corresponding version. However, the overrides for the following components are not removed:</p> <ul style="list-style-type: none"> <li>● Uplink</li> <li>● OV3600 info (IP address, key, organization)</li> <li>● System location</li> <li>● Virtual controller IP address, netmask, gateway, VLAN, and name</li> <li>● Per AP (thin AP) settings</li> </ul>
N/A	<p>It is recommend that you do not enable the <b>IGC &gt; AirWave &gt; AirWave Settings &gt; Allow Configuration of AirWave Settings</b> option in releases prior to 8.0.10 before migrating to 8.0.10. Enabling this option creates an ams-key mismatch after upgrading to 8.0.10 and it may cause IAPs disconnect from OV3600. This option is disabled by default in the IGC. After the midnight auto audit, the IGC retrieves and stores a device's ams-key after migration is complete.</p>
DE22425	<p>OV3600 does not create the default ACLs that a switch creates upon role creation. In Alcatel-Lucent AOS-W 6.4.x, this creates a conflict that prevents OV3600 from correctly pushing policy configuration to the switch. As a workaround, create new roles on the switch first and then import them to OV3600.</p>
DE23282 DE23670	<p>OV3600 sends incorrect trigger alerts for AP down events during the switch upgrade process. For example, OV3600 might send AP down alerts when the AP is down for less than the time configured in the trigger. This issue is caused when OV3600 picks up an old entry when the AP went down instead of the most recent down event. Since the time since the old entry meets the configured trigger time, an alert is sent.</p>
DE23289	<p>When viewing VisualRF in the Microsoft Edge browser on a Windows 10 client, double clicking on a building or floor does not open the floor or map page.</p>
DE23697	<p>If an invalid or unreachable IP address is configured on a virtual controller through the IGC, the OAW-IAP cluster managed by the misconfigured VC becomes completely unreachable. Additionally, attempting to change the VC IP address from the Instant UI does not work because the VC thinks it is being managed by OV3600.</p>

There are no new known issues in OV3600 8.0.9.2.

The table below lists known issues in OV3600 8.0.9.1.

**Table 36:** *Known Issues in OV3600 8.0.9.1*

ID	Description
123937	<p>In Alcatel-Lucent AOS-W 6.4.2.12, the PhyType message sent by the switch to OV3600 for wireless clients does not include the proper encoding information. This causes OV3600 to display 802.11g clients as 802.11b.</p>



The table below lists known issues in OV3600 8.0.9

**Table 37: Known Issues in OV3600 8.0.9**

ID	Description
DE21393	The <b>OV3600 Setup &gt; General</b> page allows you to configure time periods for retaining historical data. If you run a report for a longer period of time than the configured data retention period (e.g., you want to view 30 days of data for IDS events, but AirWave is configured to retain only 14 days of IDS data) then the reports may show unexpected results due to the limited data available. OV3600 does not display a warning message if an administrator runs a report for a longer amount of time than the data retention window.
DE22133	In VisualRF, when you edit a floor plan to add a deployed device, the names of the folders in the <b>Devices</b> pane may appear as a question mark (?) instead of the correct folder name. This is only a display issue, as you can still drag and drop devices from these folders onto the floor plan.
DE22139	In VisualRF, the auto-match feature matches a managed device to a planned device with the same name or MAC address. In OV3600 8.0.9, when you right-click a floor plan, campus or network icon and select the <b>Auto-Match Planned Devices</b> option, those devices may incorrectly appear as down, even if the managed device is correctly matched with the planned device, and is active on the network.

The table below lists known issues in OV3600 8.0.8

**Table 38: Known Issues in OV3600 8.0.8**

ID	Description
DE21374	AirWave does not allow you to Telnet to a switch from the OV3600 server. The browser opens a pop-up to launch the Telnet application but no response is returned from the Telnet application.
DE21464	In the IGC, the global <b>DHCP Server scope</b> cannot be deleted from the cluster.
DE21465	The IGC continues pushing a configuration to IAPs after the configured Retry Limit is reached. This occurs when the configured value of <b>Clients Per Branch</b> , in the <b>Branch Size</b> tab under <b>DHCP Servers &gt; Distributed DHCP Scopes</b> , is larger than the value calculated by OV3600. Because the configured number is out the required range, the configuration is not pushed to the IAPs and results in a mismatch.  To work around this issue, configure a value smaller than the maximum value suggested in the UI.
DE21551	VisualRF does not display all the folders when you add APs to floors.
DE21570	When two IAPs are configured as a preferred master in the same cluster, the following occurs: <ol style="list-style-type: none"> <li>1. Each IAP becomes a virtual controller (VC). However, they do not form a cluster together and instead enter standalone mode.</li> <li>2. Because they both become virtual controllers and were configured to be in the same cluster, they have the same VC key.</li> <li>3. Each VC fluctuates between the up and down states because both VCs attempt to connect to OV3600 with the same VC key.</li> <li>4. OV3600 detects this situation and, after for 10 minutes, resolves the conflict by making one VC key unique and rebooting both VCs.</li> </ol>
DE21581	VPN traffic statistics (VPN IN and VPN OUT) and VPN client statistics do not populate correctly in the <b>Client</b> graph on the <b>Clients &gt; VPN Sessions</b> page. The VPN client count appears as zero.

**Table 38:** *Known Issues in OV3600 8.0.8 (Continued)*

ID	Description
DE21607	<p>When you use the IGC to add a new IAP, there may be a configuration mismatch because IAPs do not support the command <b>no wlan captive-portal</b>. Since OV3600 does support that command, the resulting configuration mismatch cannot be resolved.</p> <p>To avoid this issue, on <b>Groups &gt; Instant Config &gt; Security &gt; Internal Captive Portal</b>, set the <b>Authenticated</b> field to <b>Enabled</b>. Alternately, if a mismatch occurs, factory reset the IAP after the IAP is added to an existing IAP group.</p>

The table below lists known issues in OV3600 8.0.7

**Table 39:** *Known Issues in OV3600 8.0.7*

ID	Description
DE20356	Users are unable to change the <b>Orientation, Gain, and Beamwidth</b> values for IAPs in VisualRF.
DE20493	The <b>Radios</b> table on the <b>APs/Devices &gt; Monitor</b> page displays a blank SSID column for Juniper APs. This is due to a defect in the base code implementation for Trapeze from where the Juniper code is derived.
DE20541	A CDP error appears for Motorola SNMP polling. When a Motorola switch is polled through SNMP, timeouts are seen while polling a few OIDs. The timeouts appear in the OV3600 Events log.
DE20908	Instant auth-fail SNMP traps send seven parameters, but OV3600 does not currently support this. OV3600 currently supports two parameters.
DE20922	In VisualRF, the <b>Defining Stationary Devices</b> option does not work properly. In the VisualRF HTML5-based interface, the client changes when the client is placed in the floor plan as static. This option does work properly in the flash-based UI.

The table below lists known issues in OV3600 8.0.6.3

**Table 40:** *Known Issues in OV3600 8.0.6.3*

ID	Description
DE20768	The <b>Download OV3600 Management Client</b> link on the <b>Home &gt; Documentation</b> does not work correctly. Clicking the link does not start the file download and may cause the page to stop responding. To download the file, right-click on the link and select <b>Save As</b> to properly save the file.

The table below lists known issues in OV3600 8.0.6.2

**Table 41:** *Known Issues in OV3600 8.0.6.2*

ID	Description
DE20751	The <b>List</b> view in VisualRF has an extraneous lock icon to the right of the <b>List</b> link. This is a cosmetic defect and has no impact on VisualRF behavior.
DE20753	Heatmaps in VisualRF and heatmaps in Bill of Material (BOM) reports do not match because BOM reports calculate heatmaps with a default signal cutoff of -85dBm.
DE20754	Sensor maps are not shown in BOM reports for floors that have Air Monitors.

The table below lists known issues in OV3600 8.0.5

**Table 42:** *Known Issues in OV3600 8.0.5*

ID	Description
DE15549	The <b>Total Disk Usage</b> chart may not display the total number of disk mounts that have taken place. If more than eight disks have been mounted, OV3600 only displays the first eight mounted disks. Once the limit on historical mount points is reached, subsequent mounts are not graphed, regardless of whether the previous mounts are connected.
DE19741	Running nightly maintenance during midnight can cause OV3600 to temporarily stop monitoring the network. Normal monitoring resumes once nightly maintenance completes.

The table below lists known issues in OV3600 8.0.4

**Table 43:** *Known Issues in OV3600 8.0.4*

ID	Description
DE19369	To enable Console Access, use the following procedure: From the OV3600 UI, navigate to <b>System &gt; General</b> . Click <b>Console access: enable</b> again, then select <b>Save</b> or <b>Apply All</b> .
DE19548	The nightly backup log may have errors related to the VisualRF backup. Ignore these errors as they do not affect the overall OV3600 nightly backup.

The table below lists known issues in OV3600 8.0.3.1.

**Table 44:** *Known Issues in OV3600 8.0.3.1*

ID	Description
DE19491	The VisualRF UI takes longer to load after the VisualRF engine has been restarted.
DE19490	Floorplans with a high client density take a long time to load.

There are no new known issues in OV3600 8.0.3.

The table below lists known issues in OV3600 8.0.2.

**Table 45:** *Known Issues in OV3600 8.0.2*

ID	Description
DE23819	AppRF data from an IAP running Instant 4.2.1 does not appear on the AppRF chart on the <b>Clients &gt; Diagnostics</b> page of the OV3600 WebUI.

The table below lists known issues in OV3600 8.0.0.

**Table 46:** *Known Issues In OV3600 8.0.0*

ID	Description
DE12398	OV3600 servers using Security Technical Implementation Guide (STIG) management standards do not run the security-hardening script <b>stig.pl</b> upon each upgrade.

**Table 46: Known Issues In OV3600 8.0.0 (Continued)**

ID	Description
DE12888	SecureAMP has no menu item for setting the clock. A re-installation may be necessary if the clock is wrong, because login attempts are denied for significant clock deviations.
DE12919	VMWare tools cannot be installed during the SecureAMP installation procedure, and must be pre-loaded before the installation. The tools should be pre-loaded, or loaded from the CLI menu.
DE13668	In the legacy flash-based <b>VisualRF</b> UI, the QuickView <b>Preferences&gt;General</b> , <b>Preferences&gt;APs</b> and <b>Preferences&gt;Clients</b> menus display configuration options that are no longer applicable to VisualRF. This is not a known issue for the default HTML5 VisualRF UI.
DE13678	The <b>overlay</b> and <b>display</b> menus in the legacy flash-based <b>VisualRF</b> UI refers to "sensors", while the default HTML5 UI refers to these devices as "air monitors."
DE13683	When you edit and save the <b>Virtual Controller Variables - Default Values</b> template, the <b>Confirm Changes</b> page shows the database changes, rather than the user-defined settings.
DE15112	When you perform a search in OV3600, then resize the <b>Search Results</b> pop-up window, you have to scroll to see some of the buttons in this window.
DE15239	If OV3600 is not getting health data from Alcatel-Lucent switches, the user diagnostic page shows an empty health graph.
DE15304	On the <b>Groups &gt; Templates</b> page, there is a note saying you can use templates to manage the configuration of devices. Although this list includes HP, only HP WesM devices support template configuration.
DE15512	<p>When you perform a search in OV3600, pressing <b>Enter</b> and clicking the magnifying glass icon return different results.</p> <ul style="list-style-type: none"> <li>● Pressing <b>Enter</b> does a search based on what is specified on the OV3600 Setup &gt; <b>General</b> page under the <b>Search Method</b> section.</li> <li>● Clicking the magnifying glass always does a quick search.</li> </ul>
DE15814	When an inactive client expires, RRD files containing AMC Signal Data for that client are retained.
DE15921	Links in the UI do not allow you to right-click the link and select the <b>Open in new Tab</b> or <b>Open in New Window</b> options.
DE16144	Adding a user to the internal user database using the Instant GUI Config (IGC) feature incorrectly triggers a <b>no user</b> error for a configuration mismatch when you save and apply the change, even though the user is added correctly.
DE17613	The OV3600 UI does not fully support the Safari for Windows browser. (5.1.7 or earlier)
DE17665	OV3600 can allow more devices to be added than are supported by the current license count. Exceeding the device licensing limits can cause performance issues.
DE17739	Active APs making UCC calls can appear to be down when the device is polled using SNMP. This can cause OV3600 to incorrectly report that a down AP is supporting an active UCC call.

**Table 46:** *Known Issues In OV3600 8.0.0 (Continued)*

ID	Description
DE17897	OV3600 uses outdated timezone data, which incorrectly calculates the date that daylight savings time in Brazil. OV3600 can also encounter errors when it attempts to calculate reoccurring event times during the changeover period between standard time and daylight savings time in Brazil.
DE17960 DE17998	The table in the <b>RAPIDS &gt; List</b> page cannot be sorted or filtered by the by the following data columns. <ul style="list-style-type: none"> <li>● Name</li> <li>● Detecting APs</li> <li>● Channel</li> <li>● Threat level</li> <li>● Confidence</li> </ul>
DE17971	The Scatterplot UCC data chart supports a maximum of 1000 datapoints.
DE17998	The device table on the <b>RAPIDS &gt; List</b> page does not allow you to filter data by the <b>Detecting APs, Channel, Threat level</b> or <b>Confidence</b> table columns.
DE18051	Reinstalling OV3600 doesn't overwrite and clear all previous database entries.
DE18259	In VisualRF, if the <b>Draw Walls</b> tool is selected, moving an AP to a new location on the floor plan will draw a wall between the previous location of the AP and its new location on the floor plan.
DE18920	With the parameter as "none" in the xml request ( <a href="https://&lt;your.ov3600.server&gt;/amp_stats.xml">https://&lt;your.ov3600.server&gt;/amp_stats.xml</a> ), the following parameters are not listed in the xml response: <ul style="list-style-type: none"> <li>● bandwidth_in</li> <li>● bandwidth_out</li> </ul> <p>To get all the attributes (including bandwidth details) in the amp_stats response, use the URL <a href="https://&lt;your.ov3600.server&gt;/amp_stats.xml?include_bandwidth=1">https://&lt;your.ov3600.server&gt;/amp_stats.xml?include_bandwidth=1</a>.</p>
DE19266	When enabling AMON, auditing should be set to <b>daily</b> and have been successful at least once to allow OV3600 to calculate the proper BSSIDs per radio. If these BSSIDs do not exist, clients are dropped because they do not have any corresponding BSSIDs in the OV3600 database.
US12233	Buildings cannot be moved to new campuses under the HTML5 version of OmniVista 3600 Air Manager 8.0.11. To work around this issue: <ul style="list-style-type: none"> <li>● Disable the HTML5 user interface (revert back to flash).</li> <li>● Restart the VisualRF engine and make the necessary changes.</li> </ul>

