

AOS-W 8.10.0.13 Release Notes



Copyright Information

The Alcatel-Lucent name and logo are trademarks of Nokia used under license by ALE. To view other trademarks used by affiliated companies of ALE Holding, visit: www.al-enterprise.com/en/legal/trademarks-copyright. All other trademarks are the property of their respective owners. The information presented is subject to change without notice. Neither ALE Holding nor any of its affiliates assumes any responsibility for inaccuracies contained herein.

© Copyright 2024 ALE International, ALE USA Inc. All rights reserved in all countries.

Open Source Code

This product includes code licensed under the GNU General Public License, the GNU Lesser General Public License, and/or certain other open source licenses.

Contents	3
Revision History	4
Release Overview	5
Important	5
Related Documents	5
Supported Browsers	6
Terminology Change	6
Contacting Support	6
What's New in AOS-W 8.10.0.13	8
Behavioral Changes	8
Supported Platforms	9
Supported Platforms in AOS-W 8.x	9
Regulatory Updates	14
Resolved Issues in AOS-W 8.10.0.13	15
Known Issues in AOS-W 8.10.0.13	21
Known Issues	21
Limitations in AOS-W 8.10.x	27
Upgrade Procedure	29
Important Points to Remember	29
Memory Requirements	30
Low Free Flash Memory	30
Backing up Critical Data	33
Upgrading AOS-W	34
Verifying the AOS-W Upgrade	36
Downgrading AOS-W	36
Before Calling Technical Support	38

The following table lists the revision numbers and the corresponding changes that were made in this release:

Table 1: *Revision History*

Revision	Change Description
Revision 01	Initial release.

This AOS-W release notes includes the following topics:

- New Features and Enhancements
- Supported Platforms
- Regulatory Updates
- Resolved Issues
- Known Issues and Limitations
- Upgrade Procedure

Important

- Upgrading from AOS-W 8.10.0.6 or earlier versions on OAW-41xx Series and 9200 Series switches will take longer than usual as we will be automatically upgrading the BIOS version to support additional functionality in the future. This upgrade is estimated to take up to 15 minutes and should not be interrupted for any reason. Power failures and interruptions during the upgrade may make the switch unusable. Please use caution and plan accordingly.



Cluster Rolling Upgrade is not supported when a BIOS upgrade is required. AOS-W must be manually upgraded for these controllers. In a (very rare) scenario where, post reload command, the unit does not come up in 15-20 minutes, apply power cycle only once and wait for a minimum of 15 minutes without re-applying power cycle again.

- As mandated by the Wi-Fi Alliance, AOS-W 8.10.0.0 and later versions require Hash-to-Element (H2E) for 6 GHz WPA3-SAE connections. H2E is supported on Android 12 or later versions, Linux wpa_supplicant version 2.10 or later versions, macOS Catalina or later versions, Windows 11 or later versions. Users must upgrade their clients to support successful 6 GHz WPA3-SAE connections.
- The factory-default image of APs introduced in AOS-W 8.9.0.0 or later versions use **aruba-conductor** as the host name instead of **aruba-master** to identify a target managed device or stand-alone switch during DNS discovery. However, the factory-default image of APs that were introduced prior to AOS-W 8.9.0.0 still use **aruba-master** during DNS discovery. The usage of **aruba-conductor** is to align with the Inclusive Language Initiative.

Related Documents

The following guides are part of the complete documentation for the Alcatel-Lucent user-centric network:

- *AOS-W Getting Started Guide*
- *AOS-W User Guide*
- *AOS-W CLI Reference Guide*
- *AOS-W API Guide*
- *Alcatel-Lucent Mobility Conductor Licensing Guide*

- *Alcatel-Lucent Virtual Appliance Installation Guide*
- *Alcatel-Lucent AP Software Quick Start Guide*

Supported Browsers

The following browsers are officially supported for use with the AOS-W WebUI:

Web Browser	Operating System
Microsoft Edge (Microsoft Edge 92.0.902.62 and Microsoft EdgeHTML 18.19041) or later	<ul style="list-style-type: none"> ■ Windows 10 or later ■ macOS
Firefox 107.0.1 or later	<ul style="list-style-type: none"> ■ Windows 10 or later ■ macOS
Apple Safari 15.4 (17613.17.1.13) or later	<ul style="list-style-type: none"> ■ macOS
Google Chrome 108.0.5359.71 or later	<ul style="list-style-type: none"> ■ Windows 10 or later ■ macOS

Terminology Change

As part of advancing Alcatel-Lucent Enterprise's commitment to racial justice, we are taking a much-needed step in overhauling ALE engineering terminology to reflect our belief system of diversity and inclusion. Some legacy products and publications may continue to include terminology that seemingly evokes bias against specific groups of people. Such content is not representative of our ALE culture and moving forward, ALE will replace racially insensitive terms and instead use the following new language:

Usage	Old Language	New Language
Campus Access Points + Controllers	Master-Slave	Conductor-Member
Instant Access Points	Master-Slave	Conductor-Member
Switch Stack	Master-Slave	Conductor-Member
Wireless LAN Controller	Mobility Master	Mobility Conductor
Firewall Configuration	Blacklist, Whitelist	Denylist, Allowlist
Types of Hackers	Black Hat, White Hat	Unethical, Ethical

Contacting Support

Table 2: *Contact Information*

Contact Center Online	
Main Site	https://www.al-enterprise.com

Contact Center Online	
Support Site	https://myportal.al-enterprise.com
Email	ebg_global_supportcenter@al-enterprise.com
Service & Support Contact Center Telephone	
North America	1-800-995-2696
Latin America	1-877-919-9526
EMEA	+800 00200100 (Toll Free) or +1(650)385-2193
Asia Pacific	+65 6240 8484
Worldwide	1-818-878-4507

This chapter describes the features, enhancements, and behavioral changes introduced in this release.

Support for EnOcean's new USB Dongles for IoT

APs now support EnOcean's new USB 300 DE dongles. Like earlier models, these dongles support wireless connectivity to EnOcean sensors in a customer's physical environment.

Behavioral Changes

This release does not introduce any changes in AOS-W behaviors, resources, or support that would require you to modify the existing system configurations after updating to 8.10.0.13.

Supported Platforms in AOS-W 8.x

This section displays the supported platforms in AOS-W 8.x. The **minimum version supported** column displays the minimum AOS-W 8.x version that can be run on a platform. The **latest version supported** column displays the newest AOS-W 8.x version that can be run on a certain device. Patch releases do not affect platform support. For example, a device which **latest supported version** is 8.10.0.x can run on any 8.10.0.x version, such as 8.10.0.2 or 8.10.0.10.

Mobility Conductor Platforms

Mobility Conductors		AOS-W 8.x Versions Supported	
Conductor Family	Conductor Model	Minimum	Latest
Hardware Mobility Conductor	MCR-HW-1K, MCR-HW-5K, MCR-HW-10K	8.1.0.x	8.12.0.x
Virtual Mobility Conductor	MCR-VA-500, MCR-VA-1K, MCR-VA-5K, MCR-VA-10K	8.0.0.x	8.12.0.x
	MCR-VA-50	8.1.0.x	8.12.0.x

OmniAccess Mobility Controller Platforms

OmniAccess Mobility Controllers		AOS-W 8.x Versions Supported	
switch Family	switch Model	Minimum	Latest
9200 Series	9240	8.10.0.x	8.12.0.x
OAW-41xx Series	9012	8.7.0.x	8.12.0.x
	OAW-4104	8.5.0.x	8.12.0.x
OAW-4x50 Series	OAW-4850	8.3.0.x	8.12.0.x
	OAW-4450, OAW-4550, OAW-4650, OAW-4750, OAW-4750XM	8.0.0.x	8.12.0.x
OAW-40xx Series	OAW-4005, OAW-4008, OAW-4010, OAW-4024, OAW-4030	8.0.0.x	8.12.0.x

OmniAccess Mobility Controllers		AOS-W 8.x Versions Supported	
switch Family	switch Model	Minimum	Latest
Virtual OmniAccess Mobility Controllers	MC-VA-50, MC-VA-250, MC-VA-1K	8.0.0.x	8.12.0.x
	MC-VA-10	8.4.0.x	8.12.0.x

Access Point Platforms

Access Points			AOS-W 8.x Versions Supported	
AP Family	AP Series	AP Model	Minimum	Latest
6xx	670 Series	AP-675, AP-675EX, AP-677, AP-677EX, AP-679, AP-679EX	8.12.0.x	8.12.0.x
	OAW-AP650 Series	OAW-AP655	8.10.0.x	8.12.0.x
		AP-654	8.11.2.x	8.12.0.x
	OAW-AP630 Series	OAW-AP635	8.9.0.x	8.12.0.x
		AP-634	8.11.2.x	8.12.0.x
	OAW-AP610 Series	AP-615	8.11.0.x	8.12.0.x
	600 Series	AP-605H	8.12.0.x	8.12.0.x

Access Points			AOS-W 8.x Versions Supported	
AP Family	AP Series	AP Model	Minimum	Latest
5xx	OAW-AP580 Series	AP-584, AP-585, AP-585EX, AP-587, AP-587EX	8.10.0.x	8.12.0.x
	OAW-AP570 Series	OAW-AP574, OAW-AP575, OAW-AP577, AP-575EX, AP-577EX	8.7.0.x	8.12.0.x
	OAW-AP560 Series	OAW-AP565, OAW-AP567, AP-565EX, AP-567EX	8.7.1.x	8.12.0.x
	OAW-AP550 Series	OAW-AP555	8.5.0.x	8.12.0.x
	OAW-AP530 Series	OAW-AP534, OAW-AP535	8.5.0.x	8.12.0.x
	OAW-AP510 Series	OAW-AP518	8.7.0.x	8.12.0.x
		OAW-AP514, OAW-AP515	8.4.0.x	8.12.0.x
	OAW-AP500 Series	OAW-AP504, OAW-AP505	8.6.0.x	8.12.0.x
		OAW-AP505H, OAW-AP505HR	8.7.0.x	8.12.0.x
		OAW-AP503H, OAW-AP503HR	8.7.1.x	8.12.0.x
		AP-503	8.11.1.x	8.12.0.x

Access Points			AOS-W 8.x Versions Supported	
AP Family	AP Series	AP Model	Minimum	Latest
3xx	380 Series	OAW-AP387	8.4.0.x	8.10.0.x
	OAW-AP370 Series	OAW-AP374, OAW-AP375, OAW-AP377, OAW-AP375EX, OAW-AP377EX, OAW-AP375ATEX	8.3.0.x	8.12.0.x
	OAW-AP360 Series	OAW-AP365, OAW-AP367	8.3.0.x	8.12.0.x
	OAW-AP340 Series	OAW-AP344, OAW-AP345	8.3.0.x	8.10.0.x
	OAW-AP330 Series	OAW-AP334, OAW-AP335	8.1.0.x	8.10.0.x
	OAW-AP320 Series	OAW-AP324, OAW-AP325	8.0.0.x	8.10.0.x
	OAW-AP310 Series	OAW-AP318	8.3.0.x	8.12.0.x
		OAW-AP314, OAW-AP315	8.1.0.x	8.12.0.x
	OAW-AP300 Series	OAW-AP304, OAW-AP305	8.1.0.x	8.12.0.x
		OAW-AP303H, OAW-AP303HR	8.2.0.x	8.12.0.x
		OAW-AP303P	8.4.0.x	8.12.0.x
		OAW-AP303	8.3.0.x	8.12.0.x

Access Points			AOS-W 8.x Versions Supported	
AP Family	AP Series	AP Model	Minimum	Latest
2xx	OAW-AP270 Series	OAW-AP274, OAW-AP275, OAW-AP277	8.0.0.x	8.10.0.x
	OAW-AP 220 Series	OAW-AP224, OAW-AP225, OAW-AP228	8.0.0.x	8.10.0.x
	OAW-AP210 Series	OAW-AP214, OAW-AP215	8.0.0.x	8.10.0.x
	OAW-AP200 Series	OAW-AP207	8.1.0.x	8.10.0.x
		OAW-AP204, OAW-AP205, OAW-AP205H	8.0.0.x	8.10.0.x
		OAW-AP203H, OAW-AP203R, OAW-AP203RP	8.2.0.x	8.10.0.x
1xx	OAW-AP 170 Series	OAW-AP175AC, OAW-AP175AC-F1, OAW-AP175DC, OAW-AP175DC-F1, OAW-AP175P, OAW-AP175P-F1	8.0.0.x	8.6.0.x
	OAW-AP130 Series	OAW-AP134, OAW-AP135	8.0.0.x	8.6.0.x
	OAW-AP110 Series	OAW-AP114, OAW-AP115	8.0.0.x	8.6.0.x
	OAW-AP100 Series	OAW-AP103, OAW-AP104, OAW-AP105	8.0.0.x	8.6.0.x
		OAW-AP103H	8.0.0.x	8.3.0.x
9x	OAW-AP90 Series	OAW-AP92, OAW-AP93, AP-93H	8.0.0.x	8.2.0.x

This chapter contains the Downloadable Regulatory Table (DRT) file version introduced in this release. Periodic regulatory changes may require modifications to the list of channels supported by an AP. For a complete list of channels supported by an AP using a specific country domain, access the switch Command Line Interface (CLI) and execute the **show ap allowed-channels country-code <country-code> ap-type <ap-model>** command.

For a complete list of countries and the regulatory domains in which the APs are certified for operation, refer to the Downloadable Regulatory Table or the DRT Release Notes at <https://myportal.al-enterprise.com>.

The following DRT file version is part of this release:

- DRT-1.0_90131

Chapter 6

Resolved Issues in AOS-W 8.10.0.13

This chapter describes the resolved issues in this release.

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-209580	The output of the show ap database command did not display the o or i flags, which indicate whether an AP is an outdoor AP or an indoor AP. This issue occurred when the AP installation type was not set to default. The fix ensures that the command displays the o or i flags. This issue was observed in Mobility Conductors running AOS-W 8.3.0.13 or later versions.	AOS-W 8.3.0.13
AOS-219150	Some Mobility Conductors failed to push the SRC NAT pool configuration to the managed devices. This issue occurred when the ESI redirect ACL was configured using the WebUI. The fix ensures that Mobility Conductors push the SRC NAT pool configuration to the managed devices. This issue was observed in Mobility Conductors running AOS-W 8.7.1.1 or later versions.	AOS-W 8.7.1.1
AOS-231283	The log files of some Wi-Fi 6E APs incorrectly displayed the 6G radio 2 disabled due to mfg configuration message. This issue occurred even when the 6 GHz radio mode was not disabled when the APs booted up. The fix ensures that the error message is not displayed. This issue was observed in OAW-AP630 Series and OAW-AP650 Series access points running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-232208 AOS-241285	The Maintenance > Software Management > Upload AOS image for controller page of the WebUI did not allow for image upgrades in OEM builds, yet the WebUI displayed it as an option. The fix ensures image upgrades for OEM builds can be done through the WebUI. This issue was observed in OmniAccess Mobility Controllers running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-233809	Users were unable to add GRE tunnels to a tunnel group when the tunnel was being referenced in Route ACL configuration. As a result, a misleading error message Error: Tunnel is already part of a different tunnel-group was displayed. The tunnel settings were not allowed to be modified when the tunnel was referred to in the Route ACL configuration, and the above error message was displayed. The fix ensures that the correct error message is displayed when GRE tunnels are added or modified, whether they are part of the tunnel-group or Route ACL configuration. This issue was observed in managed devices running AOS-W 8.6.0.8 or later versions.	AOS-W 8.6.0.8
AOS-236200	Some OAW-AP374 access points configured as mesh APs crashed unexpectedly. The log file listed the reason for the crash as kernel panic: Fatal exception . The fix ensures that the APs work as expected. This issue was observed in OAW-AP374 access points running AOS-W 8.7.1.9 or later versions.	AOS-W 8.7.1.9

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-238427 AOS-238648	In the output of show ap association client-mac command, Client Bandwidth Rate(kbps) result did not match the value in the WebUI under Managed Networks > Overview > Clients > Throughput . The fix ensures the information coincides between the CLI and WebUI. This issue was observed in switches running AOS-W 8.6.0.17 or later versions.	AOS-W 8.6.0.17
AOS-239504 AOS-245543	Some APs showed dp_find_ast_id_by_addr 3745 Invalid priority: ff messages when app_priority was 0xff . The fix ensures the APs work as expected. This issue was observed in OAW-AP535 access points running AOS-W 8.6.0.0 or later versions.	AOS-W 8.7.1.9
AOS-241918	Some access points detected high interference in 5 GHz after upgrading to AOS-W 8.10.0.4. The fix ensures APs work as expected. This issue was observed in OAW-AP500 Series access points running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.4
AOS-242425	The show transceiver command incorrectly displayed Aruba Certified field as NO due to a missing entry in the supported SFP+ database. The fix ensures the SFP+ supported transceivers are added. This issue was observed in switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-244210	Users were unable to configure a negative value for the transmit power setting in the Overview > Profiles > IoT Profile > BLE Transmit Power page of the WebUI. The fix ensures negative values can be configured through the WebUI. This issue was observed in OmniAccess Mobility Controllers running AOS-W 8.10.0.6 or later versions.	AOS-W 8.10.0.6
AOS-245414	SNMP queries to switches returned valid traffic data for GigE interfaces but sometimes showed all zeroes for GRE tunnel interfaces. The fix ensures the process works as expected. This issue was observed on OmniAccess Mobility Controllers running AOS-W 8.0.0.0 or later versions.	AOS-W 8.6.0.17
AOS-245777	The Dashboard > Overview > Clients page of the WebUI did not organize client data or display the graphics based on signal quality when applying the Grouped by signal quality filter. This issue was observed in managed devices running AOS-W 8.10.0.6 or later versions.	AOS-W 8.10.0.6
AOS-249361 AOS-247054 AOS-247632 AOS-252702 AOS-253220	A few boot arguments were missing for OAW-41xx Series and OAW-4104-LTE gateways. This issue occurred after the gateways were upgraded to AOS-W 8.10.0.7. The fix ensures the gateways work as expected. This issue was observed in gateways running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.7
AOS-249485	Some access points were not provisionable. The log files listed the issue as Read-bootinfo from LMS failed . The fix ensures that the LMS information can be successfully read, enabling the provisioning process. This issue was observed in access points running AOS-W 8.10.0.5 or later versions.	AOS-W 8.10.0.5

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-249913 AOS-250946 AOS-250987	Some APs were shown as Down in the WebUI page, while the CLI showed them as Up . The issue occurred after upgrading from AOS-W 8.6.x to AOS-W 8.10.x. The fix ensures the information coincides between the CLI and WebUI, as expected.	AOS-W 8.10.0.7
AOS-249939	In some standalone switches, the ip mobile domain default entries were duplicated in the output of the running-config command. The fix ensures the command works as expected. This issue was observed on switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-250468 AOS-251897 AOS-253095	In some controllers running AOS-W 8.10.0.8 or later versions, some OWE client devices were not authenticated. This occurred while the security mode was set to Enhanced Open with Transition Mode enabled. The controller's log files listed the error message auth_wpa3_owe_supplicant_up PMK Cache not found for OWE user Cannot proceed further . This issue infrequently occurred due to a race condition. The fix ensures client devices are able to authenticate and connect in this scenario.	AOS-W 8.10.0.8
AOS-250612	Some discrepancies in license usage reporting were noted between global and lower-level pools in setups with Mobility Conductors, managed devices, and Campus APs. The fix ensures no discrepancies are seen. This issue was observed in managed devices running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.9
AOS-250773	OmniVista 3600 Air Manager was seeing delayed or missing SNMP responses from some switches, causing SNMP timeouts. As a result, OmniVista 3600 Air Manager incorrectly marked a switch as Down , prompting the switch to send an error message stating WARN> snmp Processing of GET(next) request failed . This issue was observed in OAW-4550switches running AOS-W 8.10.0.6 or later versions.	AOS-W 8.10.0.6
AOS-250876	The J8177D 1G SFP RJ45 T 100m Cat5e transceiver manufactured in Taiwan did not work on OAW-4x50 switches. The fix ensures the transceiver works as expected. This issue was observed in controllers running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-250883	When a logging server type was deleted, it caused the removal of all other logging types from the show running-config and show logging server command's output. The fix ensures that deleting specific logging server types works as expected. This issue was observed in switches running AOS-W 8.0.0.0 or later versions.	AOS-W 8.10.0.5
AOS-251664	In some standalone switches, the process monitor log entries were duplicated in the output of the running-config command. The fix ensures the command works as expected. This issue was observed on switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-251702	Some OAW-AP310 Series and OAW-AP320 Series access points did not inherit their switch's country code. This occurred whenever the switch's country code was changed during the conversion process. This resulted in the AP displaying US as the only option. The fix ensures that other country codes besides US can be set. This issue was observed in switches running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-251742 AOS-252082	Users experienced increased latency in applications with short, bursty traffic patterns when connected to APs. The fix ensures applications work as expected. This issue was observed in OAW-AP515 and OAW-AP505 access points running AOS-W 8.10.0.8 or later versions.	AOS-W 8.10.0.8
AOS-251921	Some OAW-AP518 access points running AOS-W 8.10.0.9-FIPS rebooted when provisioned as OAW-RAPs. The logs listed the reboot reason as AP Reboot reason: BadAddr:ffffffc04000000 PC:avs_status+0xf0c/0xf50 [wl_v6] Warm-reset . The fix includes an update to the AP driver image, which resolves the issue and allows the APs to be provisioned as OAW-RAPs.	AOS-W 8.10.0.9
AOS-252002	In some Mobility Conductors the output of the show airgroup switches command showed Discovery State as Start and Transport State as Init for several controllers. As a result, AirGroup did not work in those switches. This occurred due to an unhandled event triggered after the switches reloaded. The fix ensures the switches work as expected. This issue was observed in Mobility Conductors running AOS-W 8.10.0.10 or later versions.	AOS-W 8.10.0.10
AOS-252306	In a cluster of two gateways with uplink sharing enabled, EF traffic was dropped in one of the queues, which prevented the deployment of redundant gateways. This issue occurred due to incorrect prioritization of fragmented packets when the uplink MTU limit was hit. The fix ensures bandwidth priorities work as expected in this scenario. This issue was observed in 9240 switches running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-252377	The crypto-local isakmp route ipsec command, configured for uplink 2 on managed devices, was missing from the running configuration. The fix ensures the configuration is kept in the running configuration. This issue was observed on managed devices running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-252468 AOS-250887 AOS-250928 AOS-252880	Some OAW-40xx Series and OAW-4x50 Series switches with IPv6 became unreachable at random intervals. This occurred due to a memory leak causing the ipv6 destination cache table in kernel to reach its maximum size. The fix handles the memory leak and ensures that the switches perform as expected. This issue was observed in switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-252609	Some 600 Series access points were unable to successfully migrate from one cluster to another when using a DHCP server. The issue occurred when the APs received the new switch's IP address from the DHCP server, but they continued to operate with the old switch. The fix ensures APs work as expected. This issue was observed in 600 Series access points running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-252656	Some switches did not report client count through SNMP OID in 6 GHz connections. The fix ensures the switches work as expected. This issue was observed in switches running AOS-W 8.9.0.0 or later versions.	AOS-W 8.10.0.8
AOS-252830	Delayed device initialization in the crash kernel caused core dump collection failure. This issue occurred because of insufficient storage. The issue was resolved by checking for storage initialization for a specific number of retries. If unable to find the device block within the specific period, the core dump collection is aborted, and the device is rebooted. This issue was observed in devices running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.8
AOS-252888	In some switches, a list index out of range exception error was seen when a netdestination alias was configured. The fix ensures the error messages is not displayed and switches work as expected. This issue was observed in switches running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-253118	Upgrading from AOS-W 8.9.0.0 to AOS-W 8.10.0.8 caused telemetry WebSocket transport profile connection to report 50% less data. The fix ensures the drops are minimized by increasing the buffer sizes on the APs and switches. This issue was observed in managed devices running AOS-W 8.10.0.8 or later versions.	AOS-W 8.10.0.8
AOS-253185 AOS-249544	Some APs detected an unusually high amount of daily radar events. The fix includes an update for the AP driver image, which will reduce the number of radar events detected by the AP to an acceptable amount. This issue was observed in OAW-AP515 access points running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.8
AOS-253248	Some APs experienced high interference issues due to lower Rx time values. The fix ensures APs work as expected. This issue was observed in OAW-AP535 and OAW-AP555 access points running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-253263	Managed devices failed to connect to the Mobility Conductor and lost their IP addresses and L2 connectivity. This issue was caused by the LACP configuration being overwritten after upgrading to AOS-W 8.10.0.10. The fix ensures upgrades work as expected.	AOS-W 8.10.0.8
AOS-253333	In some Mobility Conductors' WebUI, the Dashboard > Infrastructure > Access Devices page displayed the State Reason as Hbt Timeout . Although performance was not impacted, the incorrect information was misleading. The fix ensures the correct information is displayed. This issue was observed in switches running AOS-W 8.6.0.21 or later versions.	AOS-W 8.6.0.21

Table 3: Resolved Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-253336	Some APs crashed and rebooted due to memory issues. The issue occurred because of a system memory consumption error triggered by an incorrect API. The fix ensures APs work as expected. This issue was observed in OAW-AP655 access points running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.9
AOS-253554 AOS-253772 AOS-255047 AOS-255307	After performing a live upgrade, some APs were shown as Down in two node clusters. On switches, the output of the show ap debug system-status displayed the following error message: Power report to SAAC failed: UNKNOWN_AP . The fix ensures that the APs joined the managed device without issue after performing a live upgrade. This issue was observed in a Mobility Conductor-managed switches running AOS-W 8.10.0.10 or later versions.	AOS-W 8.10.0.12
AOS-253793	After replacing an OAW-AP225 with an OAW-AP655, some users experienced dropout issues and slow performance on Zoom calls due to unexpected spikes in channel utilization. The issue occurred because the incorrect API was used to calculate sensitivity levels. The fix ensures APs work as expected. This issue was observed in access points running AOS-W 8.10.0.10 or later versions.	AOS-W 8.10.0.10
AOS-254108	The mDNS process crashed unexpectedly in a Mobility Conductor Virtual Appliance topology. The log file listed the reason for the event as Segmentation fault . The fix ensures the mDNS process functions as expected. This issue was observed in switches running AOS-W 8.10.0.9 or later versions.	AOS-W 8.10.0.9
AOS-254322	Mobility Conductor and managed devices unexpectedly crashed after running the show ap database status up flags B command, displaying the Module SAPM is busy. Please try later error message. The fix ensures the command works as expected. This issue is observed in devices running AOS-W 8.10.0.8 or later versions.	AOS-W 8.10.0.8
AOS-254362 AOS-254312 AOS-255167 AOS-255723 AOS-255758 AOS-256129 AOS-256183	Some access points randomly crashed and rebooted with reason Reboot caused by WLAN target assert with watchdog reset . This issue was related to the AP driver image, which has been updated to prevent these crashes from happening. This issue was observed on AP-53x, OAW-AP555, AP-58x, and OAW-AP655 access points running AOS-W 8.10.0.11 or later versions.	AOS-W 8.10.0.11

This chapter describes the known issues observed in this release.

Known Issues

Following are the known issues observed in this release.

Table 4: *Known Issues in AOS-W 8.10.0.13*

New Bug ID	Description	Reported Version
AOS-205650 AOS-231536	DHCP traffic from relay agent is not forwarded through the next-hop list configured in Layer 3 GRE tunnel. This issue is observed in managed devices running AOS-W 8.6.0.15 or later versions.	AOS-W 8.6.0.15
AOS-217948	Some APs experience issues with Wi-Fi uplink 802.1X authentication due to a conflict in certificate validity period verification. This issue is observed in APs running AOS-W 8.7.1.1 or later versions.	AOS-W 8.7.1.1
AOS-221308	The execute-cli command does not work as expected for a few show commands. This issue is observed in Mobility Conductors running AOS-W 8.7.1.4 or later versions.	AOS-W 8.7.1.4
AOS-229024	Some OAW-AP505 access points running AOS-W 8.7.1.5 or later versions crash and reboot unexpectedly. The log files list the reason for the event as PC is at wlc_mbo_parse_ie+0x15c/0x2b0 [wl_v6] .	AOS-W 8.7.1.5
AOS-229770	switches may not display information on 802.1X connection statuses if 802.1X connection fails. This issue is observed in switches running AOS-W 8.7.1.8 or later versions.	AOS-W 8.7.1.8
AOS-231751	If the number of IP Flow cache entries in the datapath exceeds the high watermark before the ip-flow-export interval expires, the switch does not export the long running flows to the collector as per the configured interval. This issue is observed in switches running AOS-W 8.7.1.7 or later versions.	AOS-W 8.7.1.7
AOS-232092	Some OAW-AP305 and OAW-AP505 access points are not discoverable by Zigbee devices. The southbound traffic is giving the error in as AP not found . This issue is observed on devices running AOS-W 8.8.0.1 or later versions.	AOS-W 8.8.0.1
AOS-232233	Some OAW-4104-LTE switches cache the LAN side MAC address during boot up. Thus, the gateway does not get an IP address from the modem. This issue is observed in switches running AOS-W 8.7.0.0 later versions.	AOS-W 8.7.1.4

Table 4: Known Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-232875 AOS-239469	The mon_serv process crashes in certain high-load scenarios, particularly with a large number of APs and users with high roaming rates. The issue occurs in OmniAccess Mobility Controllers running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-233988 AOS-242222 AOS-252252	Wired clients are unable to ping each other on the same VLAN when the ACL is set to user any any permit policy. This issue occurs because SIP is used as the user for both forward and reverse session creation during session ACL lookup. This issue is observed in managed devices running AOS-W 8.6.0.20 or later versions.	AOS-W 8.6.0.20
AOS-236471	Alcatel-Lucent OAW-4740 switches running AOS-W 8.10.0.1 or later versions do not show the configured banner information in GUI login page.	AOS-W 8.10.0.1
AOS-236852	The error ofa: ofa ofa_gsm_event_user_process: port not found:19, tnm50c4ddb3b194 end point is not configured or is down is displayed when a client connects to an IAP-VPN tunnel. This issue is observed in Mobility Conductors running AOS-W 8.10.0.2 or later versions.	AOS-W 8.10.0.2
AOS-237174	Some 9240 switches record informational logs, even though the system log level is configured as warning . This issue is observed in switches running AOS-W 8.10.0.2 or later versions.	AOS-W 8.10.0.2
AOS-238407 AOS-236630 AOS-240428 AOS-241047	AppRF application or application category ACL is not blocking YouTube on devices connected to APs running AOS-W 8.6.0.16 or later versions.	AOS-W 8.6.0.16
AOS-238846	The error message Exceeds the max supported vlans 128 displays when creating Layer 2 VLANs at folder level. This issue is observed in Mobility Conductors running AOS-W 8.6.0.15 or later versions.	AOS-W 8.6.0.15
AOS-239521	Users are unable to add a tunnel to a tunnel group and an error message Error: All tunnels must have same vlan membership is displayed. This issue occurs when the VLANs are configured in a different order when compared to the order configured for other tunnels in the same group. This issue is observed in managed devices running AOS-W 8.6.0.15 or later versions.	AOS-W 8.6.0.15
AOS-239724 AOS-239529	Some APs unexpectedly increase the response time when using DHCP configuration. This issue is observed in APs running AOS-W 8.10.0.2 or later versions.	AOS-W 8.10.0.2
AOS-239814 AOS-239815	In some switches running AOS-W 8.6.0.11 or later versions, IPv4 and IPv6 accounting messages are using the same session ID with Passpoint. This causes multiple accounting messages to be sent repeatedly.	AOS-W 8.6.0.11

Table 4: Known Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-241212 AOS-241537	Some OAW-4650 switches running AOS-W 8.10.0.4 or later versions crash and reboot unexpectedly. The log files list the reason for the event as Nanny rebooted machine - low on free memory .	AOS-W 8.10.0.4
AOS-242532	Some OAW-AP535 access points are not available on OAW-4550 switches post power outage. This issue occurs when a USB converter and console cable are used, which interrupts the boot up process and results in the AP not showing up on the switch. The issue is observed in switches running AOS-W 8.6.0.9 or later versions.	AOS-W 8.6.0.9
AOS-243266	APs upgraded through TFTP get stuck in Upgrading status due to an incorrect automatic change of UDP ports. This issue is observed in OmniAccess Mobility Controllers running AOS-W 8.6.0.20 or later versions.	AOS-W 8.6.0.17
AOS-243536	Some OmniAccess Mobility Controllers running AOS-W 8.0.0.0 or later versions display incorrect values in Discovery State and Transport State for AirGroup services, after running the show airgroup switches command. This issue occurs due to a race condition. Therefore, users connected to the affected APs are unable to use AirGroup services.	AOS-W 8.10.0.6
AOS-244193	Some OAW-AP655 access points are frequently bootstrapping. The issue occurs due to a interoperability issue of the APs firmware with certain third-party switches. The issue is observed in access points running AOS-W 8.10.0.6 or later versions.	AOS-W 8.10.0.6
AOS-244965	An unnecessary debugging log appears as Received ICMP (DEST_UNREACH, PROT_UNREACH) from X.X.X.X for heartbeat tunnel . This issue is observed in switches running AOS-W 8.10.0.5 or later versions.	AOS-W 8.10.0.5
AOS-245367	In standalone switches, it is not possible to configure application speed limit under the Dashboard > Traffic Analysis > Applications tab. This feature works if the switch is in Master role, but this error is not reported properly. This issue is observed in switches running AOS-W 8.10.0.5 or later versions.	AOS-W 8.10.0.5
AOS-246103 AOS-247433 AOS-240688 AOS-250837	Some OAW-AP635 and OAW-AP535 access points reboot randomly with reboot reason - kernel panic: Take care of the TARGET ASSERT at ar_wal_tx_send.c:11778 first . This occurs due to issues with M3 switches recovery, to which the APs are connected. This issue is observed in APs running AOS-W 8.10.0.5 or later versions.	AOS-W 8.10.0.5
AOS-246170 AOS-245703	The Dashboard > Overview > Wireless Clients page of the WebUI does not show accurate information. For example, some column information like IP ADDRESS and ROLE might show as blank, and the NAME column might wrongly display other information like the MAC ADDRESS of the client. This issue is observed in Mobility Conductors running AOS-W 8.10.0.6 or later versions.	AOS-W 8.10.0.6

Table 4: Known Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-246195	After enabling the TLS toggle in the Managed Network node hierarchy > Configuration > System > Logging page of the WebUI, traffic is not initiated on datapath sessions. This causes logs not to be sent to the syslog servers. This issue is observed in managed devices running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-246606	The NVDA reader calls out only parameters that are not configured under the Services > Firewall page of the WebUI. This issue is observed in switches running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-246960	OmniAccess Mobility Controller upgrades trigger license changes which cause the unintended loss of configured user-roles and ACLs in managed devices. This issue is observed in OAW-4010 switches running AOS-W 8.6.0.21 or later versions. Workaround: Reload the managed device or restart the profmgr process to fix the issue.	AOS-W 8.6.0.21
AOS-247721	Mobility Conductor in a standby setup fail over and crashed unexpectedly. The log files list the reason as Datapath Exception . This issue is observed in Mobility Conductor running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-247793	Some OAW-AP535 access points crash and reboot unexpectedly. The log file lists the reason for reboot as AP crashed at ar_wal_vdev.c:3320 Assertion vdev_handle->type == WAL_VDEV_TYPE_STA . This issue is observed in access points running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.0
AOS-248466	The switch discovery preference field disappears when changing it from ADP to Static , under Dashboard > Configuration > Access Point > Provision . This issue is observed in switches running AOS-W 8.10.0.8 or later versions.	AOS-W 8.10.0.8
AOS-248899	The syslog server of some wireless switches is flooded with error messages related to OpenFlow. Logs such as ofa: <238503> <5843> ofa sdn ERRS ofml_openflow_mac_bridge_add_ap:322 AP client(mac-address) not found are repeatedly displayed on switches with varying MAC addresses. These errors are related to roaming when connected to a Remote AP and can be safely ignored. This issue is observed in switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.7
AOS-248905	Clients are assigned the wrong role when reconnecting to WPA3 Enterprise (GCM) SSIDs, in both CNSA and non-CNSA modes. The issue is related to PMK caching as part of dot1x authentication. This issue is observed in switches running AOS-W 8.10.0.0 or later versions. Workaround: Since this is a PMK caching issue, clearing the cache by using the aaa authentication dot1x key-cache clear <unk>station-mac command solves the problem.	AOS-W 8.10.0.0
AOS-249568	Rules added from the Configuration > Roles & Policies > Roles > role > Rules of this Role only section of the WebUI are not displayed. This issue is observed in switches running AOS-W 8.0.0.0 or later versions.	AOS-W 8.10.0.7

Table 4: Known Issues in AOS-W 8.10.0.13

New Bug ID	Description	Reported Version
AOS-249631	Cluster live upgrades fail while trying to upgrade to AOS-W 8.10.0.9. The log files list the reason of the event as Image copy failed on controller ip 172.21.7.12 ipv6 N/A, Incompatible file ArubaOS_72xx 8.10.0.9_88493 . This issue is observed in switches running AOS-W 8.10.0.7 or later versions.	AOS-W 8.10.0.9
AOS-250148	AirGroup's Transport State gets stuck on initializing status. The issue is related to the current handling of OpenFlow flows in AOS SDN switches. This issue is observed in managed devices running AOS-W 8.0.0.0 or later versions.	AOS-W 8.0.0.0
AOS-250956 AOS-245687	VLAN configuration changes trigger a reconfiguration in all VAPs that cause transient issues at scale. This issue is observed in APs running AOS-W 8.10.0.0 or later versions.	AOS-W 8.12.0.0
AOS-251605 AOS-241347	Wired AirGroup servers might disappear from the AirGroup server table when GE/PC ports are deactivated. This issue is observed on OmniAccess Mobility Controllers running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.9
AOS-251615	The HEALTH status displays as Unknown for some users under the Dashboard > Overview > Wireless Clients page of the WebUI. This issue occurs when AP datapath mistakenly sends fragment packets as DNS, which eventually fall into the incorrect workflow and drops communication. This issue is observed in OmniAccess Mobility Controllers and Mobility Conductors running AOS-W 8.10.0.8 or later versions.	AOS-W 8.10.0.8
AOS-252502	RADIUS accounting session statistics are randomly set as 0 in split-tunnel mode. The issue occurs when IPv6 statistics mistakenly override IPv4 statistics in a two-stack environment. This issue is observed in switches running AOS-W 8.10.0.9-FIPS or later versions. Workaround: It is recommended to disable IPv6 or add a new entry in valid_user to disable IPv6 link local address.	AOS-W 8.10.0.9
AOS-252538	The IKE XAuth process fails on OAW-RAPs, causing them to reboot and appear as Down on switches. The issue occurs when users do not modify the password in the WebUI while provisioning multiple RAPs. This issue is observed in access points running AOS-W 8.6.0.17 or later versions.	AOS-W 8.6.0.17
AOS-252798	The OFA process crashes on switches running AOS-W 8.10.0.10 or later versions after a RAP deployment. The issue occurs due to a segmentation fault while deleting a client object from the OFML library.	AOS-W 8.10.0.10
AOS-252910 AOS-252852	The captive portal does not display for some users. The issue occurs when DNS-resolved IP addresses are not mapped to their respective DNS names. This issue is observed in switches running AOS-W 8.0.0.0 or later versions. Workaround: Rebooting the switch temporarily fixes the issue.	AOS-W 8.10.0.5

Table 4: *Known Issues in AOS-W 8.10.0.13*

New Bug ID	Description	Reported Version
AOS-254669	The last digit of the sequence numbers is missing from the output of the show airmatch solution command, although the show airmatch debug optimization command displays the correct sequence numbers. This issue is observed OmniAccess Mobility Controllers running AOS-W 8.10.0.0 or later versions.	AOS-W 8.10.0.10
AOS-255698	Some access points might detect unusually high 5 GHz interferences (about a 20% gap) in their network. This issue is observed on AP-53x, OAW-AP555, AP-58x, and OAW-AP655 access points running AOS-W 8.10.0.11 or later versions.	AOS-W 8.10.0.11

This section includes the known limitations in 8.10.x.x releases.

Title	Description
Port-Channel Limitation in OAW-4850 switches	<p>The OAW-4850 hardware architecture consists of two Network Acceleration Engines (NAEs). The ethernet ports are split between the NAEs according to this mapping:</p> <ul style="list-style-type: none"> ▪ NAE 0: Ports 0/0/4 to 0/0/7 and 0/0/12 to 0/0/15 ▪ NAE 1: Ports 0/0/0 to 0/0/3 and 0/0/8 to 0/0/11 <p>When configuring a port-channel, it is recommended that member ports are distributed between the two different NAEs (e.g., 0/0/0 and 0/0/4) . This is to ensure hitless operation if one of the member ports experiences a link flap either due to a network event or a user-driven action. If member ports are on the same NAE, a link flap will be observed for less than a second. It is not recommended to form a 10 Gbe based port-channel larger than 2x 10 Gbe due to this hardware limitation.</p>
No Support for Airtime Fairness Mode	<p>Airtime Fairness Mode is not supported in 802.11ax access points.</p>
6 GHz Channel Information in Regulatory Domain Profile	<p>AOS-W does not display the 6 GHz channel information in the existing regulatory domain profile of Wi-Fi 6E APs by default.</p> <p>To include 6 GHz channel information, ensure that you change the country code to a different country code, apply the change, and then revert it to the original country code. Another option is to create a new regulatory domain profile that includes the 6 GHz channel information by default, or copy the existing regulatory domain profile into a new regulatory domain profile to save the configuration.</p> <p>The following example configures a regulatory domain profile and specifies a valid 6 GHz band.</p> <pre style="background-color: #f0f0f0; padding: 10px;"> (host) [mynode] (config) #ap regulatory-domain-profile reg-635 (host) [mynode] (Regulatory Domain profile "reg-635") #country-code US (host) [mynode] (Regulatory Domain profile "reg-635") #valid-6ghz-channel 165 </pre>
Limitations in OAW-AP650 Series and OAW-AP630 Series Access Points	<ul style="list-style-type: none"> ▪ No spectrum analysis on any radio ▪ No Zero-Wait DFS ▪ No Hotspot and Air Slice support on the 6 GHz radio ▪ No 802.11mc responder and initiator functionality on any radio ▪ Only 4 VAPs on the 6 GHz radio instead of 16 ▪ Maximum of 512 associated clients on any radio, instead of 1024

Title	Description
Air Slice is partially enabled on some OAW-AP500 Series APs	Air Slice is partially enabled on OAW-AP500 Series access points and OAW-AP510 Series access points. However, WMM boost will be functional even if Air Slice high-priority queuing is disabled.
cpboot command in OAW-40xx Series and OAW-4x50 Series switches	The cpboot command does not upgrade the AOS-W software version of OAW-40xx Series and OAW-4x50 Series controllers.

This chapter details software upgrade procedures. It is recommended that you schedule a maintenance window for the upgrade.



Read all the information in this chapter before upgrading your Mobility Conductor, managed device, or stand-alone switch.

Important Points to Remember

To upgrade your managed device or Mobility Conductor:

- Schedule the upgrade during a maintenance window and notify your community of the planned upgrade. This prevents users from being surprised by a brief wireless network outage during the upgrade.
- Avoid making any changes to your network, such as configuration changes, hardware upgrades, or changes to the rest of the network during the upgrade. This simplifies troubleshooting.
- Know your network and verify the state of the network by answering the following questions:
 - How many APs are assigned to each managed device? Verify this information by navigating to the **Dashboard > Access Points** page in the WebUI, or by executing the **show ap active** or **show ap database** commands.
 - How are those APs discovering the managed device (DNS, DHCP Option, Broadcast)?
 - What version of AOS-W runs on your managed device?
 - Are all managed devices running the same version of AOS-W?
 - What services are used on your managed device (employee wireless, guest access, OAW-RAP, wireless voice)?
- Resolve any existing issues (consistent or intermittent) before you upgrade.
- If possible, use FTP to load AOS-W images to the managed device. FTP is faster than TFTP and offers more resilience over slow links. If you must use TFTP, ensure the TFTP server can send over 30 MB of data.
- Always upgrade the non-boot partition first. If you encounter any issue during the upgrade, you can restore the flash, and switch back to the boot partition. Upgrading the non-boot partition gives you a smoother downgrade path, if required.
- Before you upgrade to this version of AOS-W, assess your software license requirements and load any new or expanded licenses that you might require. For a detailed description of these new license modules, refer the *Alcatel-Lucent Mobility Conductor Licensing Guide*.
- With the introduction of the Long Supported Release (LSR) and Short Supported Release (SSR) terminology in AOS-W 8.10.0.0, a Mobility Conductor running an LSR release supports managed devices running the same release and the three preceding releases. This is considered as N-3 support. This allows a customer to run the latest LSR, the previous SSRs and the previous LSR simultaneously. A Mobility Conductor running an SSR release supports managed devices running the same release and the two preceding releases. This would be considered N-2 support and is the same behavior as the pre-AOS-W 8.10.0.0 MultiVersion support.

- Only for the AOS-W 8.10.0.0 LSR release, AOS-W 8.6.0.0 is treated as an LSR despite being beyond N-3. As such a Mobility Conductor running AOS-W 8.10.0.0 supports managed devices running AOS-W 8.10.0.0, AOS-W 8.9.0.0, AOS-W 8.8.0.0, AOS-W 8.7.0.0 and AOS-W 8.6.0.0.

Memory Requirements

All Alcatel-Lucent managed devices store critical configuration data on an onboard compact flash memory module. Ensure that there is always free flash space on the managed device. Loading multiple large files such as JPEG images for RF Plan can consume flash space quickly. Following are best practices for memory management:

- Do not proceed with an upgrade unless 100 MB of free memory is available. Execute the **show memory** command to identify the available free memory. To recover memory, reboot the managed device. After the managed device comes up, upgrade immediately.
- Do not proceed with an upgrade unless the minimum flash space is available. Execute the **show storage** command to identify the available flash space. If the output of the **show storage** command indicates that there is insufficient flash memory, free some used memory. Copy any log files, crash data, or flash backups from your managed device to a desired location. Delete the following files from the managed device to free some memory:
 - **Crash data:** Execute the **tar crash** command to compress crash files to a file named **crash.tar**. Use the procedures described in [Backing up Critical Data on page 33](#) to copy the **crash.tar** file to an external server. Execute the **tar clean crash** command to delete the file from the managed device.
 - **Flash backups:** Use the procedures described in [Backing up Critical Data on page 33](#) to back up the flash directory to a file named **flash.tar.gz**. Execute the **tar clean flash** command to delete the file from the managed device.
 - **Log files:** Execute the **tar logs** command to compress log files to a file named **logs.tar**. Use the procedures described in [Backing up Critical Data on page 33](#) to copy the **logs.tar** file to an external server. Execute the **tar clean logs** command to delete the file from the managed device.



In certain situations, a reboot or a shutdown could cause the managed device to lose the information stored in its flash memory. To avoid such issues, it is recommended that you execute the **halt** command before power cycling.

Deleting a File

You can delete a file using the WebUI or CLI.

In the WebUI

From the Mobility Conductor, navigate to **Diagnostic > Technical Support > Delete Files** and remove any aging log files or redundant backups.

In the CLI

```
(host) #delete filename <filename>
```

Low Free Flash Memory

Sometimes, after extended use, the flash memory might get used up for logs and other files. The AOS-W image has increased in size and this may cause issues while upgrading to newer AOS-W images without cleaning up the flash memory.

Prerequisites

Before you proceed with the freeing up the flash memory:

- Ensure to always backup the configuration and flash memory. Issue the **backup configuration** and **backup flash** commands to backup the configuration and flash.
- Copy the **flashbackup.tar.gz** and **configbackup.tar.gz** files out of the switch. Then delete the **flashbackup.tar.gz** and **configbackup.tar.gz** files from the flash memory of the switch.
- Use only one partition for the upgrade activity and keep the other partition unchanged.

If you use the WebUI to perform an upgrade, a banner on the **Maintenance** page provides the following reminder to have sufficient free flash memory before initiating an upgrade.

For a healthy and stable system it requires free space of 360 MB for AOS v8.3 and 8.5, 570 MB for AOS 8.6 and 8.7 and 450 MB for AOS 8.8 and higher version in the /flash directory. Please make sure minimum required memory is available in /flash before upgrading to newer version.

Freeing up Flash Memory

The following steps describe how to free up the flash memory before upgrading:

1. Check if the available memory in **/flash** is greater than the limits listed in [Table 5](#) for all supported switch models:

Table 5: Flash Memory Requirements

Upgrading from	Upgrading to	Minimum Required Free Flash Memory Before Initiating an Upgrade
8.3.x	8.10.x	360 MB
8.5.x	8.10.x	360 MB
8.6.x	8.10.x	570 MB
8.7.x	8.10.x	570 MB
8.8.x	8.10.x	450 MB
8.9.x	8.10.x	450 MB
8.10.x	8.10.x	450 MB

To check the available free flash memory, issue the **show storage** command. Following is the sample output from a switch with low free flash memory:

```
(host) [mynode] #show storage
Filesystem      Size    Available      Use    %    Mounted on
/dev/usb/flash3 1.4G    1014.2M        386.7M  72%  /flash
```

2. If the available free flash memory is less than the limits listed in [Table 5](#), issue the following commands to free up more memory.
 - **tar crash**
 - **tar clean crash**

- **tar clean logs**
 - **tar clean traces**
3. Issue the **show storage** command again to check if the available space in **/flash** is more than the minimum space required for AOS-W upgrade as listed in [Table 5](#)
 4. **If you are unable to free up sufficient flash memory, contact Technical Support. Do not reboot the switch.**
 5. If sufficient flash memory is available, proceed with the standard AOS-W upgrade. See [Upgrading AOS-W](#).
 6. If a reboot was performed, you may see some of the following errors. Follow the directions below:

- Upgrade using standard procedure. You may see some of the following errors:
 - Error upgrading image: Ancillary unpack failed with tar error (tar: Short header). Please clean up the /flash and try upgrade again.**
 - Error upgrading image: Ancillary unpack failed with tar error (tar: Invalid tar magic). Please clean up the /flash and try upgrade again.**
 - Error upgrading image: Need atleast XXX MB space in /flash for image upgrade, please clean up the /flash and try upgrade again.**
 - Failed updating: [upgradelImageNew.c] extractAncTar (dev: /dev/usb/flash1 imgLoc: /flash/config/ArubaOS_70xx_8.8.0.0-mm-dev_78066**

- If any of the above errors occur, issue the **show image version** command to check for the default boot partition. The partition which was upgraded should become the default partition. Following is the sample output of the **show image version** command:

```
(host) [mynode] #show image version
-----
Partition           : 0:0 (/dev/usb/flash1) **Default boot**
Software Version    : AOS-W 8.9.0.0 (Digitally Signed SHA1/SHA256 - Production
Build)
Build number       : 81046
Label              : 81046
Built on           : Thu Aug 5 22:54:49 PDT 2021
-----
Partition           : 0:1 (/dev/usb/flash2)
Software Version    : AOS-W 8.7.0.0-2.3.1.0 (Digitally Signed SHA1/SHA256 -
Developer/Internal Build)
Build number       : 0000
Label              : arpitg@sdwan-2.3_arpitg-3-ENG.0000
Built on           : Tue Aug 10 15:02:15 IST 2021
-----
```

- If the default boot partition is not the same as the one where you performed the upgrade, change the default boot partition. Issue the **boot system partition <part_number>** command to change the default boot partition. Enter **0** or **1** for **part_number** representing partition 0:0 or partition 0:1, respectively.
- Reload the switch. If any of the errors listed in step 4 were observed, the following errors might occur while booting AOS-W 8.9.0.0.

```
Sample error:
[03:17:17]:Installing ancillary FS [ OK ]
Performing integrity check on ancillary partition 1 [ FAIL : Validating new
ancillary partition 1...Image Integrity check failed for file
/flash/img1/mswitch/sap/arm32.ari. Digest Mismatch]
Extracting Webui files..tar: Short read
chown: /mswitch/webui/*: No such file or directory
```



```
chmod: /mswitch/webui/wms/wms.cgi: No such file or directory
```

- After the switch reboots, the login prompt displays the following banner:

* WARNING: An additional image upgrade is required to complete the *
* installation of the AP and WebUI files. Please upgrade the boot *
* partition again and reload the controller. *

- Repeat steps 1 through 5. If sufficient free flash memory is available, proceed with the standard AOS-W upgrade procedure. See [Upgrading AOS-W](#).
- If sufficient free flash memory is not available, issue the **dir** and **dir flash** commands to identify large files occupying the flash memory.



- Exercise caution while deleting files. Contact Technical Support if you are not sure which large files in the **/flash** directory could be safely deleted to free up the required space.

Issue the **delete filename <filename>** command to delete large files to free more flash memory.

- Check if sufficient flash memory is free as listed in [Table 5](#).
- Proceed with the standard AOS-W upgrade procedure in the same partition. See [Upgrading AOS-W](#).

Backing up Critical Data

It is important to frequently back up all critical configuration data and files on the flash memory to an external server or mass storage device. You should include the following files in these frequent backups:

- Configuration data
- WMS database
- Local user database
- Licensing database
- Custom captive portal pages
- x.509 certificates
- Log files
- Flash backup

Backing up and Restoring Flash Memory

You can backup and restore the flash memory using the WebUI or CLI.

In the WebUI

The following steps describe how to back up and restore the flash memory:

1. In the Mobility Conductor node hierarchy, navigate to the **Maintenance > Configuration Management > Backup** page.
2. Click **Create Backup** to backup the contents of the flash memory to the **flashbackup.tar.gz** file.
3. Click **Copy Backup** to copy the file to an external server.

You can copy the backup file from the external server to the flash memory using the file utility in the **Diagnostics > Technical Support > Copy Files** page.

4. To restore the backup file to the flash memory, navigate to the **Maintenance > Configuration Management > Restore** page and click **Restore**.

In the CLI

The following steps describe how to back up and restore the flash memory:

1. Execute the following command in the **enable** mode:

```
(host) #write memory
```

2. Execute the following command to back up the contents of the flash memory to the **flashbackup.tar.gz** file.

```
(host) #backup flash
Please wait while we take the flash backup.....
File flashbackup.tar.gz created successfully on flash.
Please copy it out of the controller and delete it when done.
```

3. Execute either of the following command to transfer the flash backup file to an external server or storage device.

```
(host) #copy flash: flashbackup.tar.gz ftp: <ftphost> <ftpusername> <ftpuserpassword>
<remote directory>
```

```
(host) #copy flash: flashbackup.tar.gz usb: partition <partition-number>
```

You can transfer the flash backup file from the external server or storage device to the flash memory by executing either of the following command:

```
(host) #copy tftp: <tftphost> <filename> flash: flashbackup.tar.gz
```

```
(host) #copy usb: partition <partition-number> <filename> flash: flashbackup.tar.gz
```

4. Execute the following command to untar and extract the **flashbackup.tar.gz** file to the flash memory.

```
(host) #restore flash
Please wait while we restore the flash backup.....
Flash restored successfully.
Please reload (reboot) the controller for the new files to take effect.
```

Upgrading AOS-W

Upgrade AOS-W using the WebUI or CLI.



CAUTION

Ensure that there is enough free memory and flash space on your Mobility Conductor or managed device. For details, see [Memory Requirements on page 30](#).



NOTE

When you navigate to the **Configuration** tab in the WebUI, the managed device might display the **Error getting information: command is not supported on this platform** message. This message is displayed ccurs when you upgrade using the WebUI and navigate to the **Configuration** tab after the managed device reboots. This message disappears after clearing the Web browser cache.

In the WebUI

The following steps describe how to upgrade AOS-W from a TFTP server, FTP server, or local file.

1. Download the AOS-W image from the customer support site.
2. Upload the AOS-W image to a PC or workstation on your network.
3. Validate the SHA hash for the AOS-W image:
 - a. Download the **Alcatel.sha256** file from the download directory.
 - b. Load the AOS-W image to a Linux system and execute the **sha256sum <filename>** command. Alternatively, use a suitable tool for your operating system that can generate a **SHA256** hash of a file.

- c. Verify that the output produced by this command matches the hash value found on the customer support site.



The AOS-W image file is digitally signed and is verified using RSA2048 certificates preloaded at the factory. The Mobility Conductor or managed device will not load a corrupted AOS-W image.

4. Log in to the AOS-W WebUI from the Mobility Conductor.
5. Navigate to the **Maintenance > Software Management > Upgrade** page.
 - a. Select the **Local File** option from the **Upgrade using** drop-down list.
 - b. Click **Browse** from the **Image file name** to navigate to the saved image file on your PC or workstation.
6. Select the downloaded image file.
7. Choose the partition from the **Partition to Upgrade** option.
8. Enable the **Reboot Controller After Upgrade** toggle switch to automatically reboot after upgrading. If you do not want to reboot immediately, disable this option.



The upgrade does not take effect until reboot. If you chose to reboot after upgrade, the Mobility Conductor or managed device reboots automatically.

9. Select **Save Current Configuration**.
10. Click **Upgrade**.
11. Click **OK**, when the **Changes were written to flash successfully** message is displayed.

In the CLI

The following steps describe how to upgrade AOS-W from a TFTP server, FTP server, or local file.

1. Download the AOS-W image from the customer support site.
2. Open an SSH session to your Mobility Conductor.
3. Execute the **ping** command to verify the network connection between the Mobility Conductor and the SCP server, FTP server, or TFTP server.

```
(host)# ping <ftphost>
```

or

```
(host)# ping <tftphost>
```

or

```
(host)# ping <scphost>
```

4. Execute the **show image version** command to check if the AOS-W image is loaded on the flash partition. The partition number appears in the **Partition** row; **0:0** is partition 0, and **0:1** is partition 1. The active boot partition is marked as **Default boot**.

```
(host) #show image version
```

5. Execute the **copy** command to load the new image to the non-boot partition.

```
(host)# copy ftp: <ftphost> <ftpusername> <image filename> system: partition <0|1>
```

or

```
(host)# copy tftp: <tftphost> <image filename> system: partition <0|1>
```

or

```
(host)# copy scp: <scphost> <scpusername> <image filename> system: partition <0|1>
```

or

```
(host)# copy usb: partition <partition-number> <image filename> system: partition <0|1>
```

6. Execute the **show image version** command to verify that the new image is loaded.

```
(host)# show image version
```

7. Reboot the Mobility Conductor.

```
(host)#reload
```

8. Execute the **show version** command to verify that the upgrade is complete.

```
(host)#show version
```

Verifying the AOS-W Upgrade

Verify the AOS-W upgrade in the WebUI or CLI.

In the WebUI

The following steps describe how to verify that the Mobility Conductor is functioning as expected:

1. Log in to the WebUI and navigate to the **Dashboard > WLANs** page to verify the AOS-W image version.
2. Verify if all the managed devices are up after the reboot.
3. Navigate to the **Dashboard > Access Points** page to determine if your APs are up and ready to accept clients.
4. Verify that the number of APs and clients are as expected.
5. Test a different type of client in different locations, for each access method used.
6. Complete a backup of all critical configuration data and files on the flash memory to an external server or mass storage facility. See [Backing up Critical Data on page 33](#) for information on creating a backup.

In the CLI

The following steps describe how to verify that the Mobility Conductor is functioning as expected:

1. Log in to the CLI to verify that all your managed devices are up after the reboot.
2. Execute the **show version** command to verify the AOS-W image version.
3. Execute the **show ap active** command to determine if your APs are up and ready to accept clients.
4. Execute the **show ap database** command to verify that the number of APs and clients are as expected.
5. Test a different type of client in different locations, for each access method used.
6. Complete a backup of all critical configuration data and files on the flash memory to an external server or mass storage facility. See [Backing up Critical Data on page 33](#) for information on creating a backup.

Downgrading AOS-W

A Mobility Conductor or managed device has two partitions, 0 and 1. If the upgrade fails on one of the partitions, you can reboot the Mobility Conductor or managed device from the other partition.

Pre-requisites

Before you reboot the Mobility Conductor or managed device with the pre-upgrade AOS-W version, perform the following steps:

1. Back up your Mobility Conductor or managed device. For details, see [Backing up Critical Data on page 33](#).
2. Verify that the control plane security is disabled.
3. Set the Mobility Conductor or managed device to boot with the previously saved configuration file.
4. Set the Mobility Conductor or managed device to boot from the partition that contains the pre-upgrade AOS-W version.

When you specify a boot partition or copy an image file to a system partition, Mobility Conductor or managed device checks if the AOS-W version is compatible with the configuration file. An error message is displayed if the boot parameters are incompatible with the AOS-W version and configuration files.

5. After switching the boot partition, perform the following steps:

- Restore the pre-upgrade flash backup from the file stored on the Mobility Conductor or managed device. Do not restore the AOS-W flash backup file.
- Do not import the WMS database.
- If the RF plan is unchanged, do not import it. If the RF plan was changed before switching the boot partition, the changed RF plan does not appear in the downgraded AOS-W version.
- If any new certificates were added in the upgraded AOS-W version, reinstall these certificates in the downgraded AOS-W version.

Downgrade AOS-W version using the WebUI or CLI.

In the WebUI

The following steps describe how to downgrade the AOS-W version:

1. If the saved pre-upgrade configuration file is on an external FTP or TFTP server, copy the file to the Mobility Conductor or managed device by navigating to the **Diagnostics > Technical Support > Copy Files** page.
 - a. From **Select source file** drop-down list, select FTP or TFTP server, and enter the IP address of the FTP or TFTP server and the name of the pre-upgrade configuration file.
 - b. From **Select destination file** drop-down list, select **Flash file system**, and enter a file name (other than default.cfg).
 - c. Click **Copy**.
2. Determine the partition on which your pre-upgrade AOS-W version is stored by navigating to the **Maintenance > Software Management > Upgrade** page. If a pre-upgrade AOS-W version is not stored on your system partition, load it into the backup system partition by performing the following steps:



You cannot load a new image into the active system partition.

- a. Enter the FTP or TFTP server address and image file name.
 - b. Select the backup system partition.
 - c. Enable **Reboot Controller after upgrade**.
 - d. Click **Upgrade**.
3. Navigate to the **Maintenance > Software Management > Reboot** page, select **Save configuration before reboot**, and click **Reboot**.

The Mobility Conductor or managed device reboots after the countdown period.

4. When the boot process is complete, verify that the Mobility Conductor or managed device is using the correct AOS-W version by navigating to the **Maintenance > Software Management > About** page.

In the CLI

The following steps describe how to downgrade the AOS-W version:

1. If the saved pre-upgrade configuration file is on an external FTP or TFTP server, use the following command to copy it to the Mobility Conductor or managed device:

```
(host) # copy ftp: <ftphost> <ftpusername> <image filename> system: partition 1
```

or

```
(host) # copy tftp: <tftphost> <image filename> system: partition 1
```

2. Set the Mobility Conductor or managed device to boot with your pre-upgrade configuration file.

```
(host) # boot config-file <backup configuration filename>
```

3. Execute the **show image version** command to view the partition on which your pre-upgrade AOS-W version is stored.

```
(host) #show image version
```



You cannot load a new image into the active system partition.

4. Set the backup system partition as the new boot partition.

```
(host) # boot system partition 1
```

5. Reboot the Mobility Conductor or managed device.

```
(host) # reload
```

6. When the boot process is complete, verify that the Mobility Conductor or managed device is using the correct AOS-W version.

```
(host) # show image version
```

Before Calling Technical Support

Provide the following information when you call the Technical Support:

- The status of installation (new or existing) and recent changes to network, device, or AP configuration. If there was a configuration change, list the exact configuration steps and commands used.
- A detailed network topology including all the devices in the network with IP addresses and interface numbers.
- The make and model number of the wireless device and NIC, driver date, version, and configuration of the NIC, and the OS version including any service packs or patches.
- The logs and output of the **show tech-support** command.
- The syslog file at the time of the problem.
- The date and time when the problem first occurred. If the problem is reproducible, list the exact steps taken to re-create the problem.
- Any wired or wireless sniffer traces taken during the time of the problem.
- The device site access information.